
E¼ cor SEC. 13-103-16

NO INFORMATION FOUND
IN MOWER CO. RECORDS

11-25-97 GGG Eng. Surveying & Planning
BWS & JT
Could Not Locate Corner
Set Temp ½" Inside Diameter
Iron Pipe on Center Line
N-S Twp Road, and at Split
Between NE cor & SE cor.
Dist 2649.98, Found No Occupation
Lines E-W. No Occupation @
1/16th corners, No E-W Occupation
Lines @ Center of Sec.

7-22-03 JHS Dug corner with Backhoe
Dug at Location of Pipe Found
Found Pipe to be 14" Long.
And Found No other Evidence
of PLS corner - Lower Pipe
and Set 5/8" x 16" Iron with
Cast Iron Mon. over pipe
.60± Below Rd Surface

7-22-03 Cloudy 75° HLS tcm 40

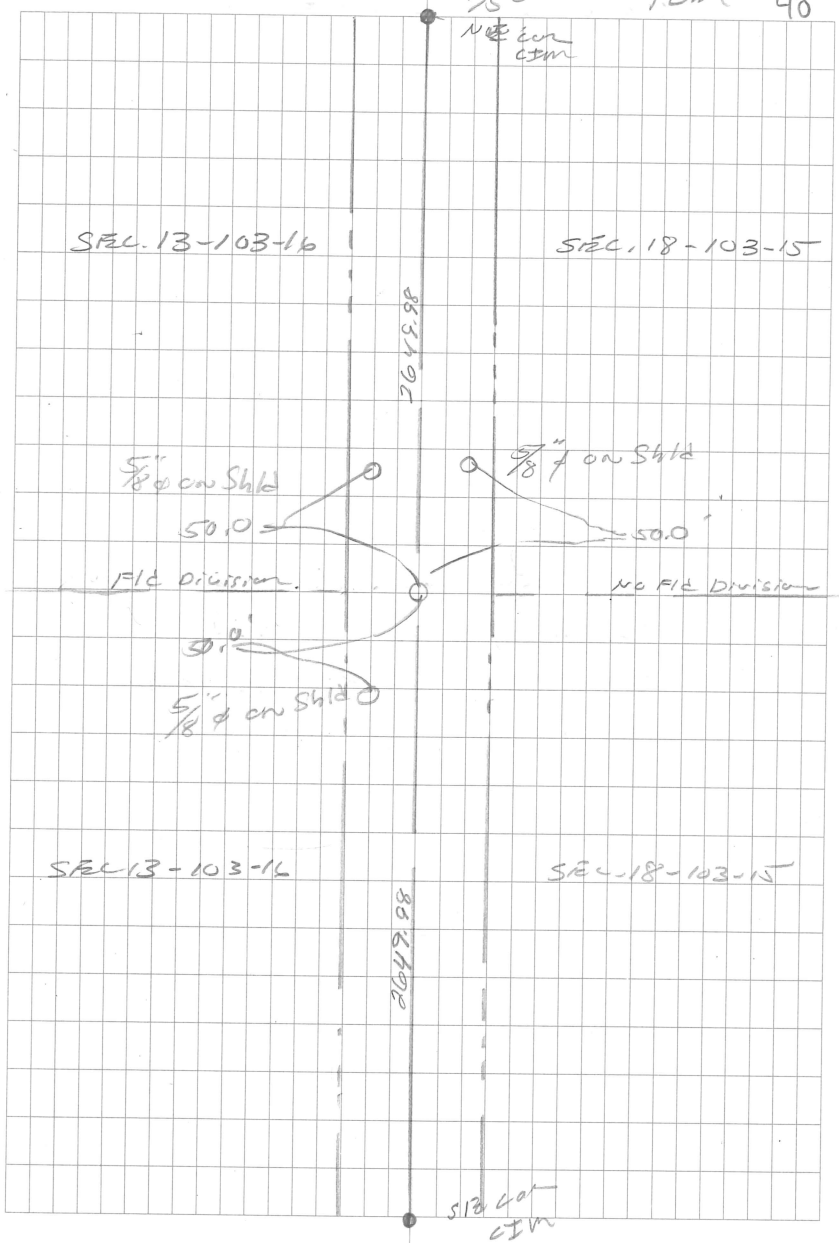

8-26-99 HLS
CLEAR DEK
85°.

77

RESET SW cor SEC. 18-103-17
CORNER DESTORYED by CONSTRUCTION
(REPLACE Bridge) (MOWER Co.)

TO NW cor SEC. 18 — FD CTM
BS N¼ cor SEC. 18
D 2821.74 V.S 2821.77 — FD CAP 5/8"ϕ
B W¼ cor SEC. 18
∠ 89°36'35"
D 2648.85
FS N¼ cor SEC. 13 — FD CTM
∠ 178°54'40"
D 2657.03

TO W¼ cor SEC. 18
BS NW cor SEC 18
D 2648.87
FS SW cor SEC. 18
∠ 180°01'03"
D 2657.80
FS TR. PT-
∠ 180°14'04"
D 3553.90

