CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 5, Township 102N, Range 17W, 5 P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

On 9-4-90 found 1" BAR (REMOVED DURING EXCAVATION)

☐ left monument as found, ☐ lowered monument, ☒ removed monument (explain)

On 9-4-90 placed 5/8" BAR AND COUNTY CAP

SKETCH OF REFERENCE TIES

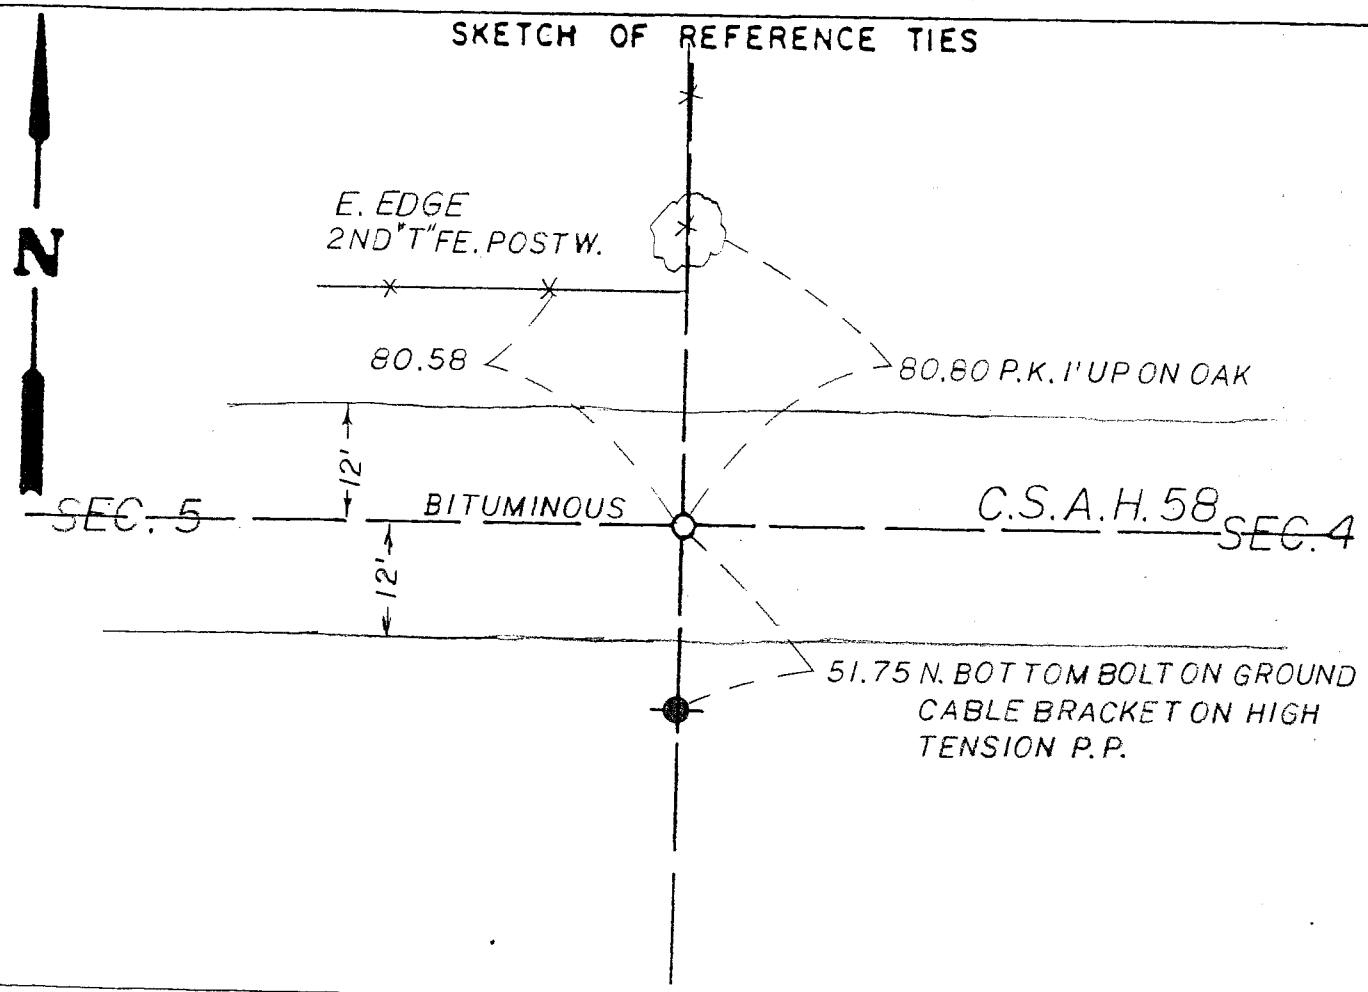

Statement of evidence relative to this corner location is on back of page

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Ronald J. Olson — Signature
11-6-90 — Date

Registration No. 11009

☒ Land Surveyor ☐ Prof Engineer
☐ County Surveyor ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Recorders office at _____ .M. on the ____ day of _____ A.D., 19___.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

STATEMENT OF EVIDENCE

East Quarter Corner Section 5, Township 102 North, Range 17 West, 5th P.M.

September, 1854	William Anderson, Deputy Surveyor, set post at quarter section corner during the original Public Land Survey. Page 20 of Surveyors Record shows inplace square top stone.
1957	Page 20 of Mower County Surveyors Record shows in place iron rod.
February 21, 1957	Minnesota Department of Highways Right-of-Way Map and Land Tie Notes of Interstate 90 shows iron pipe in place 1598.7 south of northeast corner of section 6.
1972	Mower County Engineer's Plan show in place concrete monument over stone.
September 4, 1990	Zenk Read Trygstad & Associates, Inc. excavated with a backhoe 2.5 feet North to 2.2 feet South of center line and 6 feet East to 5 feet West of fence line North and 4.5 feet deep and found a 1/2 inch bar 2.8 feet below the surface. The possible location of the concrete monument was evidenced by soil discoloration 2' below the surface. No exact location could be determined. A badly bent 5/8" rebar was found just below the bituminous surface. No exact location could be determined. An analysis of the record shows no indication of the origin of the bar. The bar is accepted as marking the location of the original Public Land Survey Corner.