CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter Corner of Section 25, Township 101, Range 14, 5th P.M. STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☐ On 6-6-90 found a Cast Iron Monument 0.3 feet below with a clay tile with 1" pipe inside.

☒ left monument as found, ☐ lowered monument, ☐ removed monument (expl.)

☐ On _____ placed a _____

SKETCH OF REFERENCE TIES

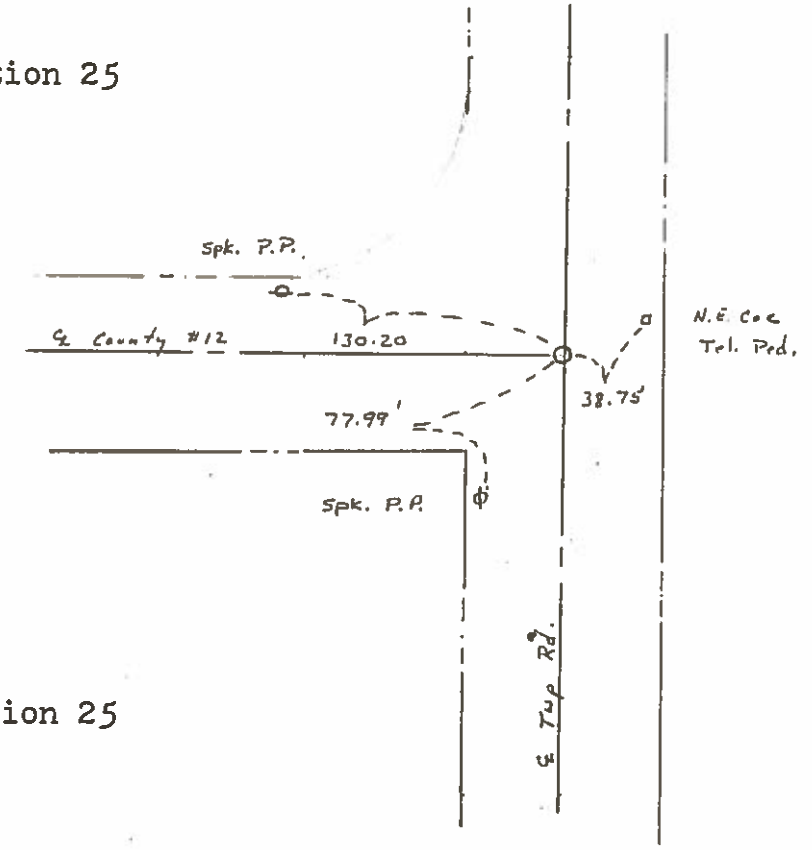

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Raymond A. Tucker — Signature
6-25-90 — Date

Registration No. 15471
☒ Land Surveyor, ☐ Prof. Engineer
☐ County Surveyor, ☐ County Engr.

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Recorders office at _____.M. on the ___ day of _____ A.D., 19____.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

STATEMENT OF EVIDENCE:

EAST QUARTER CORNER SECTION 25 - T101N - R14W

1853 - John Ball, Deputy Surveyor, set a quarter section post and drove a charred stake, raised mound per instruction and planted osage orange seeds at SE corner of trench during the Original Public Land Survey.

1934 - Mower County Highway Department placed a stone.

1982 - Mower County Highway Department notes show they found a 1/4" dia. iron pipe (tile) down 1.1 feet in rock road.

1985 - Dave Knutson, Fillmore County Surveyor, found a 1" pipe inside 4" clay tile (left in place) placed magnetic corner over 1" pipe (0.2 feet deep).

1990 - Mower County Highway Department notes show they placed a magnetic corner.

June 1990 - Raymond J. Tucker, R.L.S., assisted by Mower County Highway Department personnel found a cast iron monument 0.3 feet below with a clay tile with 1" pipe inside beneath 1.6 below. Also found a charred wood stake 1.3 feet west of cast iron monument 1.0 feet below. Cast iron monument was left as corner wood stake was discarded.

The above corner agrees with a electronis survey made of monuments and occupation lines in the area and is accepted as a perpetuation of the public land survey corner.

For details of the analysis and electronic survey data contact: Tucker Land Surveying, Dexter, Minnesota 55926.

TIE BOOK P. 24'

Index No. 124

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

WEST QUARTER Corner of Section 30, Township 101, Range 13, 5TH P.M.

STATE OF MINNESOTA, County of FILLMORE - MOWER E 1/4 Cor. Sec. 25 T104N-R14W


At the corner location shown on the sketch:

☒ On 8/2/74 (DATE) found a 1½ inch inside diameter iron pipe set inside a sewer pipe (tile) and down 1.1 feet in rock road.

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On _____ (DATE) placed a _____

SKETCH OF REFERENCE TIES

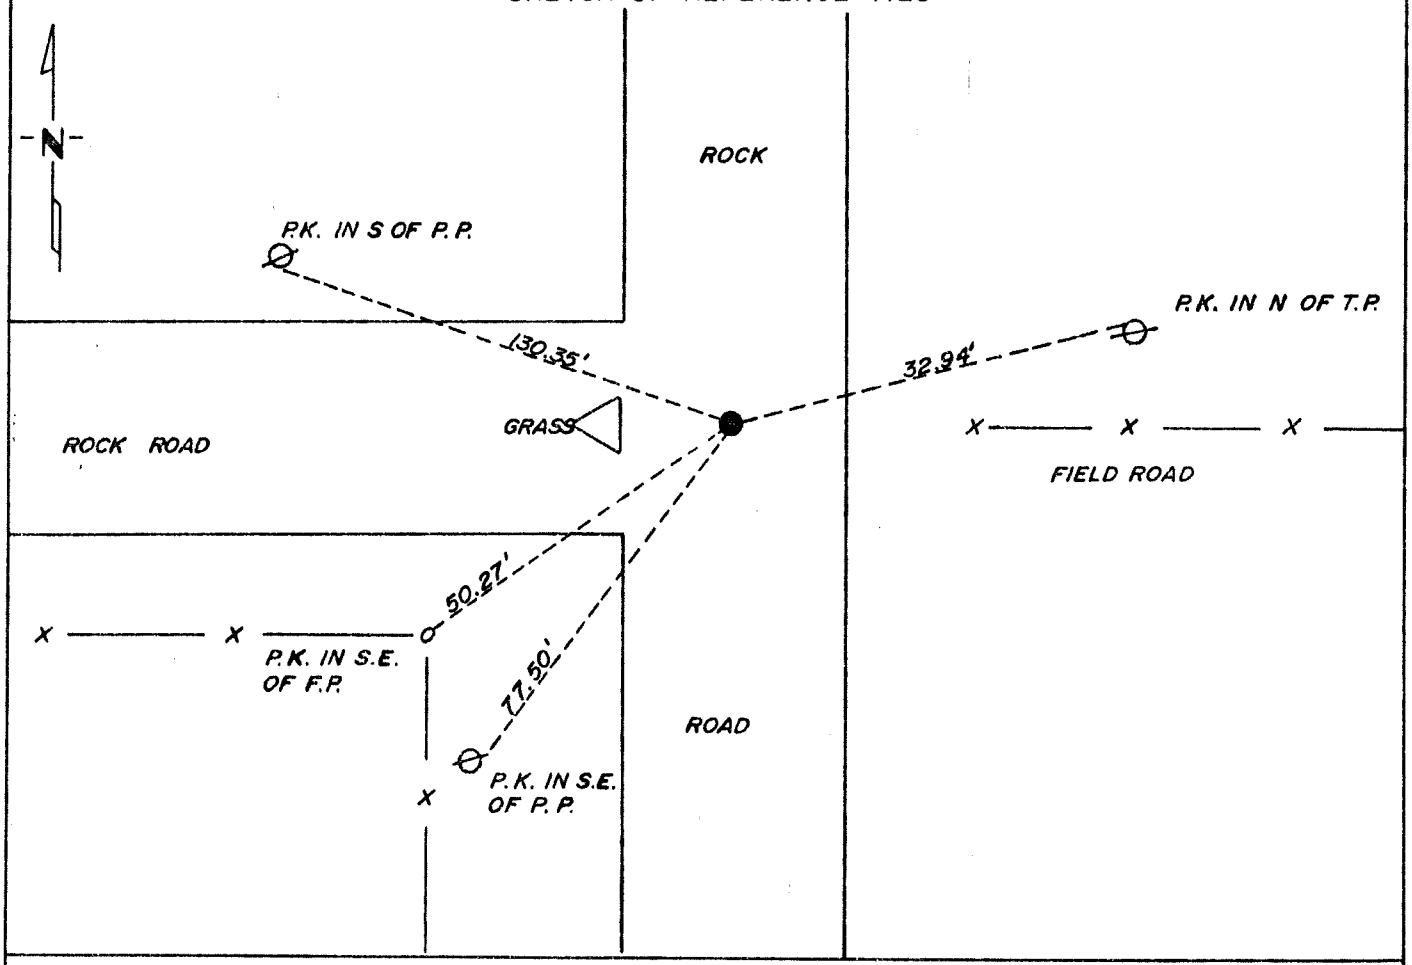

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

David J. Knutson (SIGNATURE) 3/4/77 (DATE)

Registration No. 10937

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE ~~REGISTER OF DEEDS~~ COUNTY RECORDER

County of Fillmore

I hereby certify that this document was filed in the ~~Reg. of Deeds~~ COUNTY RECORDER office at 1:15 A.M. on the 4th day of March A.D., 1977

~~Register of Deeds~~ COUNTY RECORDER O. A. Lindahl

By Pearl A. Murphy, Deputy

DOCUMENT NO. 212350

M.H.D. FORM NO. 2105

DAVE KNUTSON
FILLMORE CO SURVEYOR
NO. 10937
CORRECTED

Section Corner

"S" 1985

Sec. 25-36	T101N-R14W	Mower
Sec. 30-31	T101N-R13W	Fillmore

Inplace large granite stone buried 1.0 feet 1.5 ft. west of ℄ in rock road with 5"x1¼" iron top - left inplace. Added magnetic corner section on top (0.3' below grade surface). August 18, 1982.

Ties:

(Replaced New)	45.73' Westerly to P.K. in old blazed 24" Burr Oak
(Checked)	100.47' N.W. to P.K. in P.P.
(Checked)	32.70' W. to P.K. in N. of F.P.
(Replaced New)	72.30' W.S.W. to P.K. in top of 2nd wood fence post of F.E. (Driveway)
(Checked)	53.55' S.E. to P.K. in top of north wood gate post

Measured 2642.3 N. to ¼ corner on Line.

Section Corner

"U" 1985

Sec. 13-24	T101N-R14W	Mower
Sec. 18-19	T101N-R13W	Fillmore

Found large granite stone down 2.6+ in Centerline and Centerline of Township Roads and C.S.A.H. No. 26 Fillmore. Found lathe -(left in place). Placed magnetic corner (full section) with 1'-3/4" Ø iron on top (0.2' below grade surface). August 19, 1982.

Ties:

(New)	39.40' N.W. to S.E. Face of 3" Diameter Iron Corner Post.
(New)	51.16' N.E. to P.K. in top of F.P. (wood)
(New)	42.80' S.E. to P.K. in N.E. of P.P.
(New)	66.90' S.W. to P.K. in top of F.P. (wood)

Corner

"C" 1985

C.S.A.H. No. 12 - Sta. 106+17.3 - ¼ Sec. Corner P.I.

Sec. 25	T101N-R14W	Mower County
Sec. 30	T101N-R13W	Fillmore

Found 1" Pipe inside 4" clay tile (left in place) Placed magnetic corner over 1" pipe. (o.2' deep). August 18, 1982.

Ties:

(New)	77.99' S.W. to P.K. in P.P.
(Checked)	130.20' W.N.W. to P.K. Nail in P.P.
(New)	29.85' E to S. Edge Rib Section S. Post, Double Arrow Sign.
(New)	75.00' S.W. to 3/4" Ø Iron Rod along Twp. Road East R/W.
(New)	38.75' N.E. to S.E. Corner Tug Box.