Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 36, Township 101N Range 14W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 09/04/04 (DATE) found a CAST IRON MONUMENT

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On – placed a –

SKETCH OF REFERENCE TIES

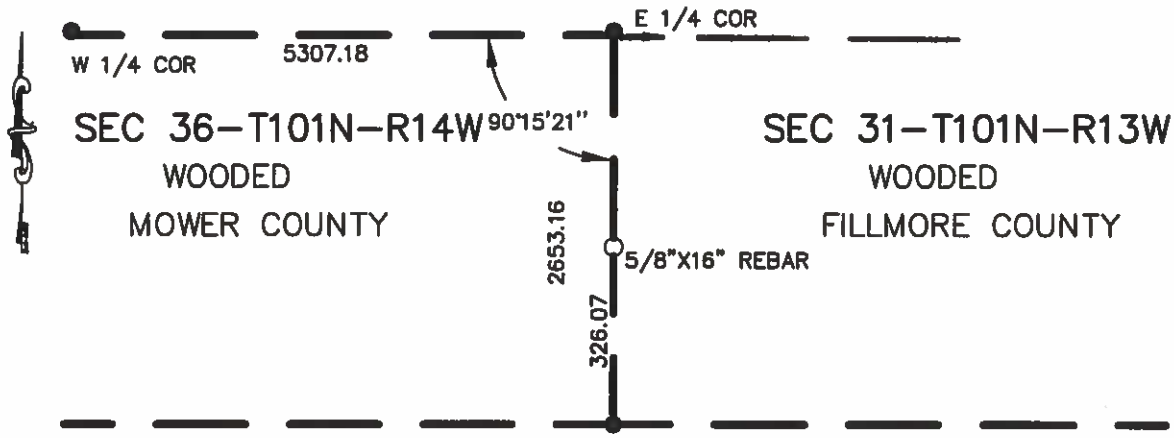

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 1-12-05

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

SE Corner Section 36-T101N-R14W

Deputy Surveyor Andrew Talcott of the U.S. General Land Office originally established this corner in 1849. The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Department
Mower County Recorder
Tucker Land Surveying

1955 Mower County records show 2' concrete monument at this location, 7" deep.

1998 Jones Haugh and Smith crew traversed around the section and found a cast iron monument at this location. David Knutson, Fillmore County Surveyor, set this over concrete monument.

2004 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, found the corner and accepted it as a perpetuation of the original PLS corner. It was in good condition.

The monument set is in agreement with the record and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

Index No. Z-25

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SOUTHEAST Corner of Section 36, Township 101 N, Range 14 W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☒ On 5-15-91 (DATE) found a CONCRETE MONUMENT WITH REBAR, DOWN 0.7'

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 5-15-91 (DATE) placed TOP 6" OF A CAST IRON MONUMENT OVER CONCRETE MONUMENT, FLUSH

SKETCH OF REFERENCE TIES

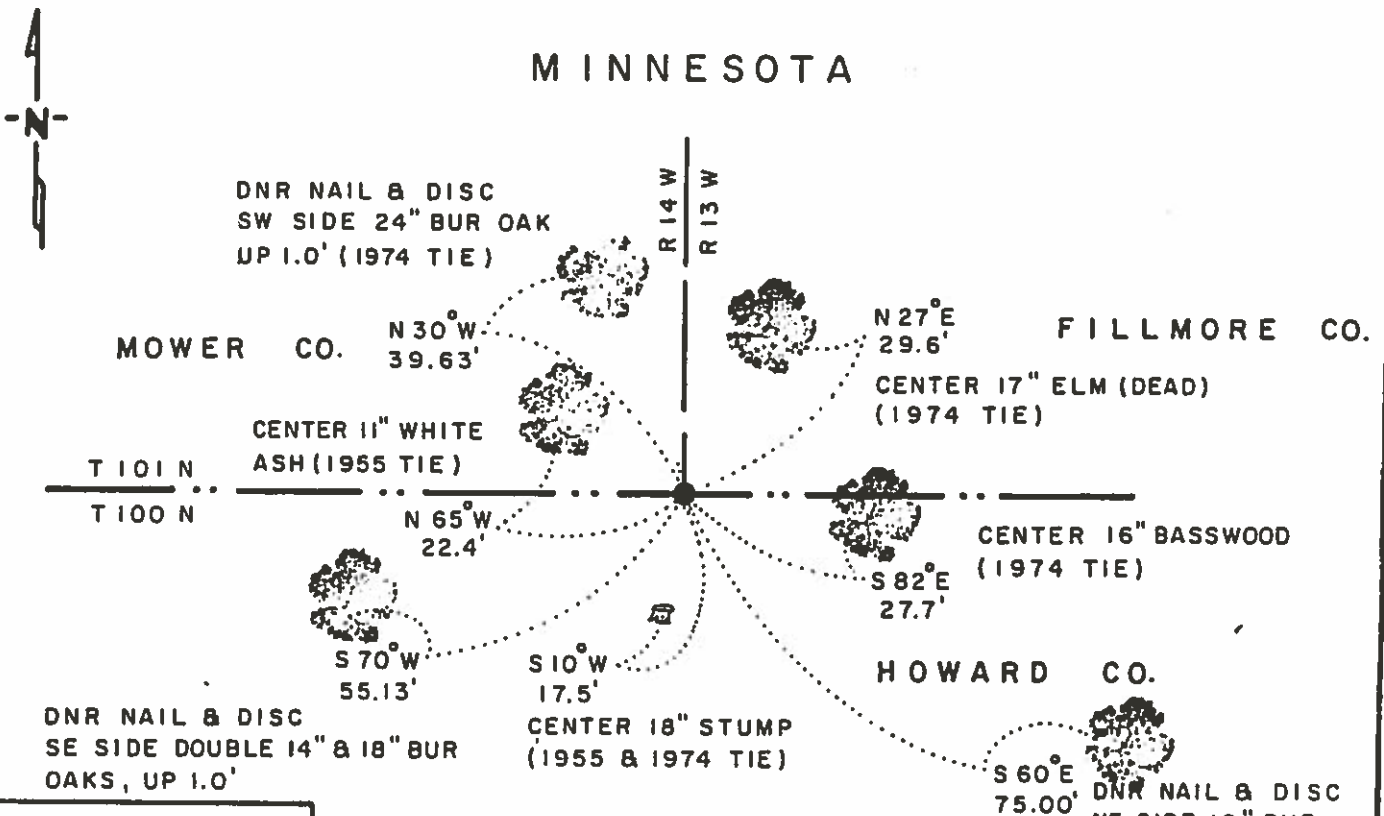

1983 MOWER COUNTY COORDINATE SYSTEM
N = 100,348.889
E = 402,956.439

BEARINGS OBSERVED WITH COMPASS

Statement of evidence relative to this corner location is on back of page

J. B. M. 9-4-91
WNA 01452.00.00.01

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Bruce W. Sheppard (SIGNATURE) 9-13-91 (DATE)

Registration No. 17003

■ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the Co. Recorders office at 11 A M. on the 16 day of Sept. A.D., 19 91

County Recorder Chandler Engen

By Marlene Thurston, Deputy

DOCUMENT NO. 408142

Book 24 Misc Page 423

Book 174 Page 423

SE-NW-36-101-14

Southeast Corner of Section 36, Township 101 North, Range 14 West

The DNR Bureau of Engineering contacted the following for survey information:

Minnesota Secretary of State's Office
Fillmore County Surveyor's Office
Fillmore County Recorder's Office
Beaver Township Clerk
Iowa Secretary of State's Office
Mower County Recorder's Office
Mower County Highway Engineer's Office
Jones, Haugh, and Smith, Inc., of Albert Lea

Consulted with David Knutson, Fillmore County Surveyor, and he said that he has researched the Howard County Offices of the Recorder and Highway Engineer in Iowa for survey information for this corner.

1853 U.S. General Land Office notes obtained from the Iowa Secretary of State's Office show the corner was established by running a straight line called a guide line and setting points every 40 chains on it and then offsetting from these points to the appropriate corner. The notes show corner marked with a wood post with the following bearing trees marked:

14" White Hickory, North 83-1/2° East, 50 links (33.00')
18" Elm, North 24° East, 91 links (60.06')
18" Bur Oak, North 31-1/2° East, 11 links (7.26')
12" White Hickory, North 47-1/2° West, 52 links (34.32')

1955 May, Surveyor's Record Book A, page 24, obtained from the Mower County Recorder's Office shows that a 2 foot concrete monument was found down 7 inches at corner. The following ties are shown to corner:

24" blazed tree, northeast, 28.8 feet
12" blazed tree, south, 16.2 feet
8" blazed tree, northwest, 22.2 feet
107.0 feet north to water line on section line
wooden fence post east of corner

No Date Jones, Haugh, and Smith found a cast iron monument at corner.

1974 November, A Certificate of Location of Government Corner signed by David J. Knutson, Fillmore County Surveyor, obtained from the Fillmore County Recorder's Office shows that a rebar in a concrete monument was found at corner. A cast iron monument was set over the found monument and the following ties were taken:

PK nail in the northwest fence of a 10" tree, north-northeast, 29.53 feet
PK nail in north face of a 13" tree, east-southeast, 27.85 feet
PK nail in east face of 16" Oak, south-southeast, 17.73 feet
PK nail in southwest face of 24" Oak, northwest, 39.58 feet
fence post east of corner

1979 A section subdivision sheet obtained from the Fillmore County Surveyor's Office shows a symbol for a monument at corner but does not indicate what was found or set. The corner is shown:

21141.01 feet from the southeast corner of Section 34

1991 May, The DNR Bureau of Engineering found a Fillmore County cast iron monument lying on its side in area of corner. Further searching revealed the concrete monument with rebar. Cut the cast iron monument to a length of 6 inches and set it over the concrete monument. Searched for and found record ties as shown on sketch of reference ties.

Analysis of the above information led the DNR Bureau of Engineering to conclude that the found concrete monument marks the location of the corner.