"N" Tie Book p 133 Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

North Quarter Corner of Section 15, Township 101N, Range 16W, 5th P.M.

STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☐ On _____ (DATE) found a _____

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 5/7/80 (DATE) placed a Cast Iron Monument

SKETCH OF REFERENCE TIES

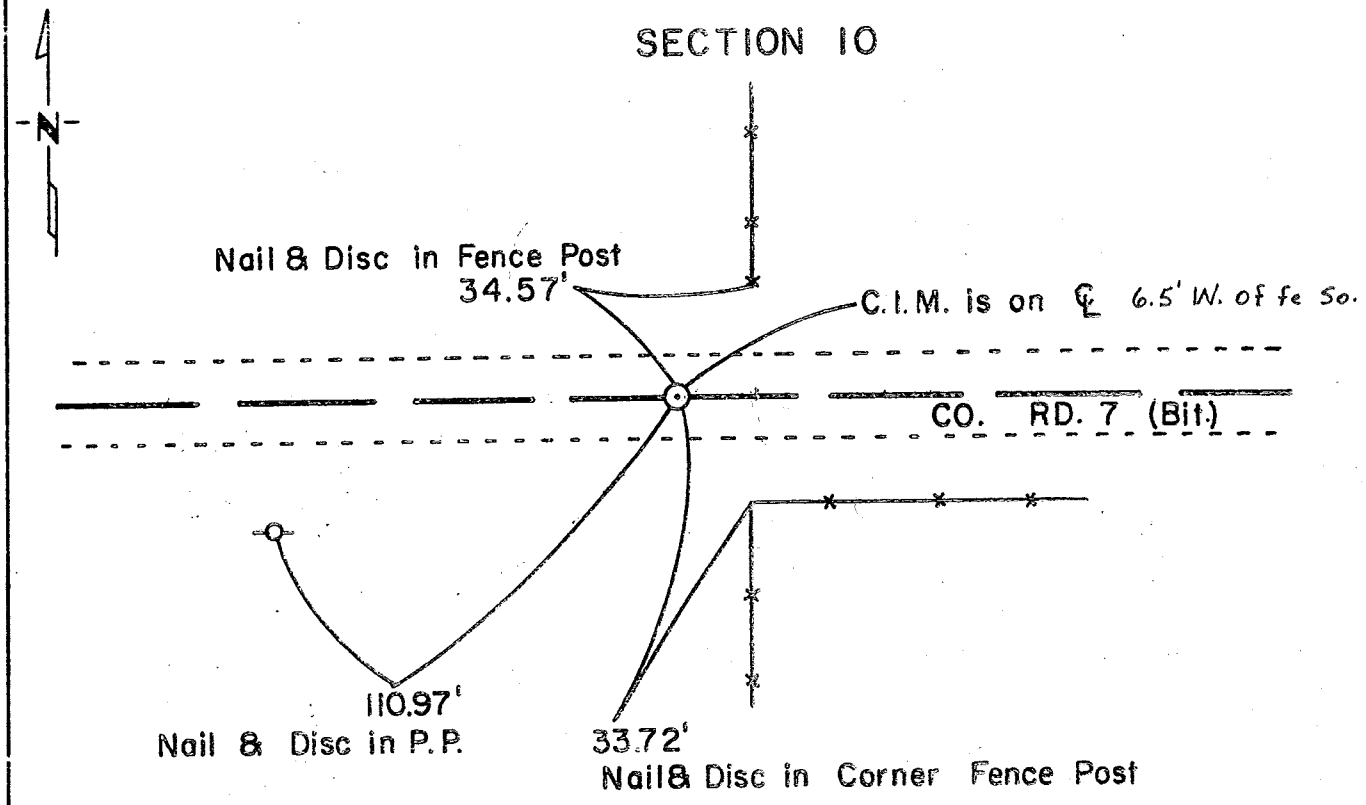

Tie Book - GPNDC 1981

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Ronald J. Olson (SIGNATURE) 5-15-80 (DATE)

Registration No. 11009

☒ Land Surveyor, ☒ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE REGISTER OF DEEDS

County of Mower

I hereby certify that this document was filed in the Reg. of Deeds office at 11 A .M. on the 16 day of May A.D., 19 80

Register of Deeds _____

By _____, Deputy

DOCUMENT NO. 344582

M.H.D. FORM NO. 2105

Statement of Evidence:

NORTH QUARTER CORNER SECTION 15, TOWNSHIP 101 NORTH, RANGE 16 WEST,5 PM

1854 Edward Fitzpatrick, Deputy Surveyor, set a post and mound at the corner in the original Public Land Survey.

1893 M.N. Clausen, County Surveyor, set a stone from the stump of a government bearing tree.

1929 Mower County Engineer improved the road through this area. No monumentation or occupation lines were shown in this area.

1976 Mower County Engineer indicated the corner to be in the centerline of the road at the fence lines North and South.

1980 Ronald J. Olson, Registered Land Surveyor, searched the area with a magnetic locator and found a spike with a plastic washer on the centerline of the road and the fences north and south.
An excavation was made with a backhoe in cooperation with the Mower County Engineer. The excavation was 7 feet North-South by 20 feet East-West by 4 feet deep westerly of a point 3 feet east of the North-South fence and northerly of a point 3 feet southerly of centerline.
No evidence of monumentation was found. An electronic survey was made to analize the section.

An analysis of the record and electronic survey data gives no indication of monument perpetuation at this location. The corner was set on the centerline of the road and at the distance shown from the Southeast corner of Section 10 as measured by the County Surveyor in 1893. This location agrees with the occupied lines in Section 10 and is accepted as the corner of the Public Land Survey.

For additional details concerning the electronic survey and analysis, contact Zenk Engineering, Albert Lea, Minnesota.