Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

S1/4 Corner of Section 27, Township 101N Range 16W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 6-4-93 (DATE) found a 3/4"ø x 18" IRON AND A BARBED WIRE FENCE

■ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 6-4-93 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

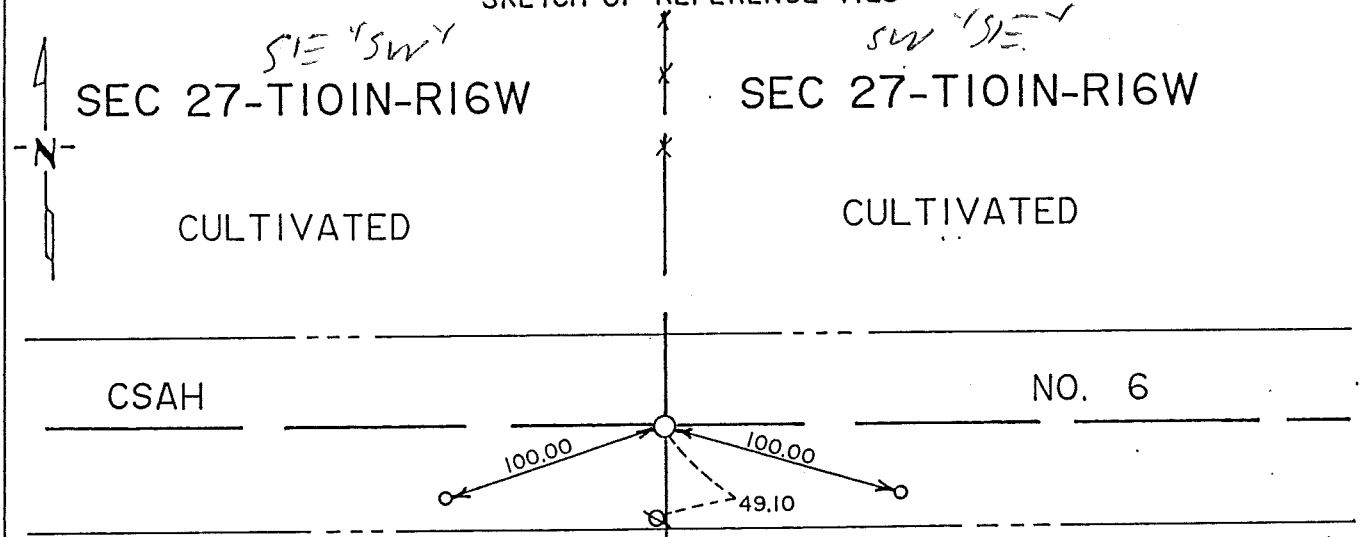

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 6-10-93

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 8 P.M. on the 25 day of June A.D., 1993

COUNTY RECORDER Charles Evans

By Marlene Martin, Deputy

DOCUMENT NO. 421945 Bk 80 Pg. 133

M.H.D. FORM NO. 2105

BOOK 80 PAGE 133

STATEMENT OF EVIDENCE

S 1/4 cor Sec 27-101-16

This corner was originally established by Deputy Surveyors Charles Phipps and Edward Fitzpatrick of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

9" Burr Oak	N 54° West	246 links (162.36 ft)
14" Burr Oak	N 50 1/2° E	210 links (128.60 ft)

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of the perpetuation of the original public land survey corner.

1891 Clausen, Mower County Surveyor, notes indicate a stone at this corner.

1956 Mower County Highway Department Book 1 notes indicate a concrete monument inplace.

Mower County Highway County Road Plans indicate a 3/4" diameter iron at this corner.

1993 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, RLS 13807, dug a 3'x5'x8' hole on the centerline of County State Aid Highway No. 6 and in line with the line fence running north and corner fence post to the south. We found a 3/4" diameter x 18" iron two feet down and an old barbed wire fence which ran north-south under roadbed. Barbed wire fence found was at original ground level and also was .6 feet to 2.5 feet west of iron found. Therefore we accepted 3/4" diameter x 16" iron found as the perpetuation of the public land survey corner and reset as found and place a cast iron monument near road surface above monument found.

The monument found and cast iron monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.