Index No. N-11

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 21, Township 101 N, Range 18 W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On _____ (DATE) found a _____

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 7-28-92 (DATE) Placed a 3/4" x 24" REBAR WITH ALUMINUM CAP STAMPED "DNR SURVEY MARKER", DOWN 0.3'

SKETCH OF REFERENCE TIES

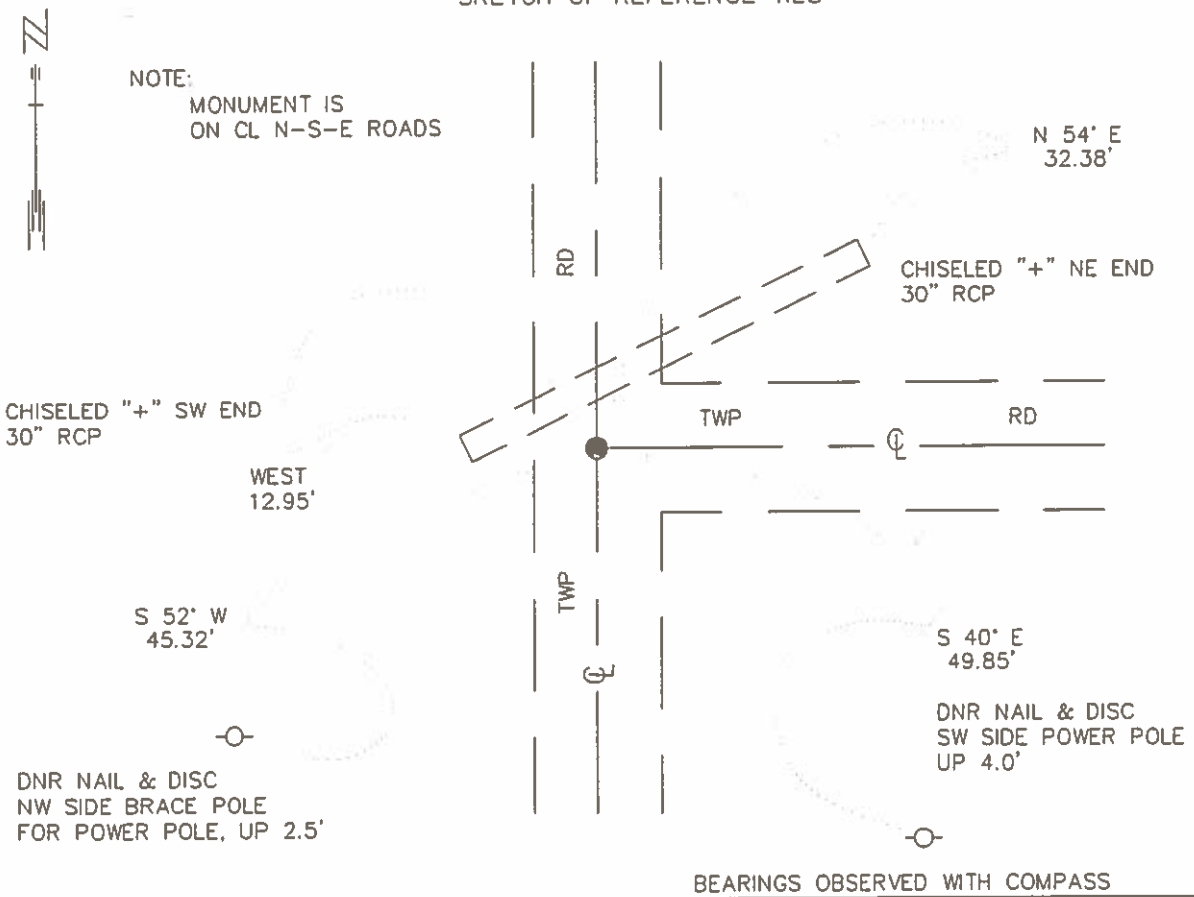

BEARINGS OBSERVED WITH COMPASS

Statement of evidence relative to this corner location is on back of page.

J.B.M. OCT 92
WMA00548.00.00.01

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Lowell R. Pomerening Jr. (SIGNATURE) 11-2-92 (DATE)

Registration No. 17005

■ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER 416853

County of Mower

I hereby certify that this document was filed in the Co. recorders office at 11 A.M. on the 3 day of Nov A.D., 1992

County Recorder Charles Enger

By Susan M. Davis, Deputy

~~DOCUMENT NO.~~ Book 78 Misc Pg 105

BOOK 78 PAGE 105

North Quarter Corner Section 21, Township 101 North, Range 18 West

The DNR Bureau of Engineering Contacted the following offices for information on this corner:

Mn Secretary of State
Mower County Recorder and Highway Engineer
Jones, Haugh & Smith Inc. at Albert Lea
Zenk-Read-Trygstad & Assoc. at Albert Lea
Tucker Land Surveying at Dexter

1854 U.S. General Land Office survey notes in the Secretary of State's Office show this corner marked with a post and marked the following bearing trees:

Br. Oak 14 N 77 1/4 W 250 lks
Br. Oak 12 S 86 1/4 W 600 lks

1884 Field notes of Clausen, County Surveyor, obtained from Jones, Haugh, & Smith, shows a post at this corner which measures 40.16 chains from adjoining section corners.

1964 The DNR Bureau of Engineering conducted a search for this corner, but found no evidence of a monument. Assumed the corner at the intersection of roads east, west and north. This intersection was found to measure:

2657.20 ft. from the northwest corner Section 21
2649.19 ft. from the northeast corner Section 21

1992 July 28, the DNR Bureau of Engineering conducted a search for this corner, but found no evidence of a monument. Location of Government bearing trees are now cultivated fields. Occupation at this corner is the intersection of roads north, south and east. Did not excavate for a monument due to a 30" RCP 9 ft. north of the road intersection. Road intersection was found to measure:

2656.72 ft. from the northwest corner Section 21
5264.50 ft. from the north quarter corner Section 16

Analysis of the available information led the DNR Bureau of Engineering to conclude that the intersection of roads north-south and east marks the location of the corner.