Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

N1/4 Corner of Section 3, Township 102N, Range 16W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-10-91 (DATE) found a 1/2"Ø pipe over a 10"Øx18" concrete monument with 1"Ø iron cast in center 4' below road surface.

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-10-91 (DATE) placed a cast iron monument over concrete monument found.

SKETCH OF REFERENCE TIES

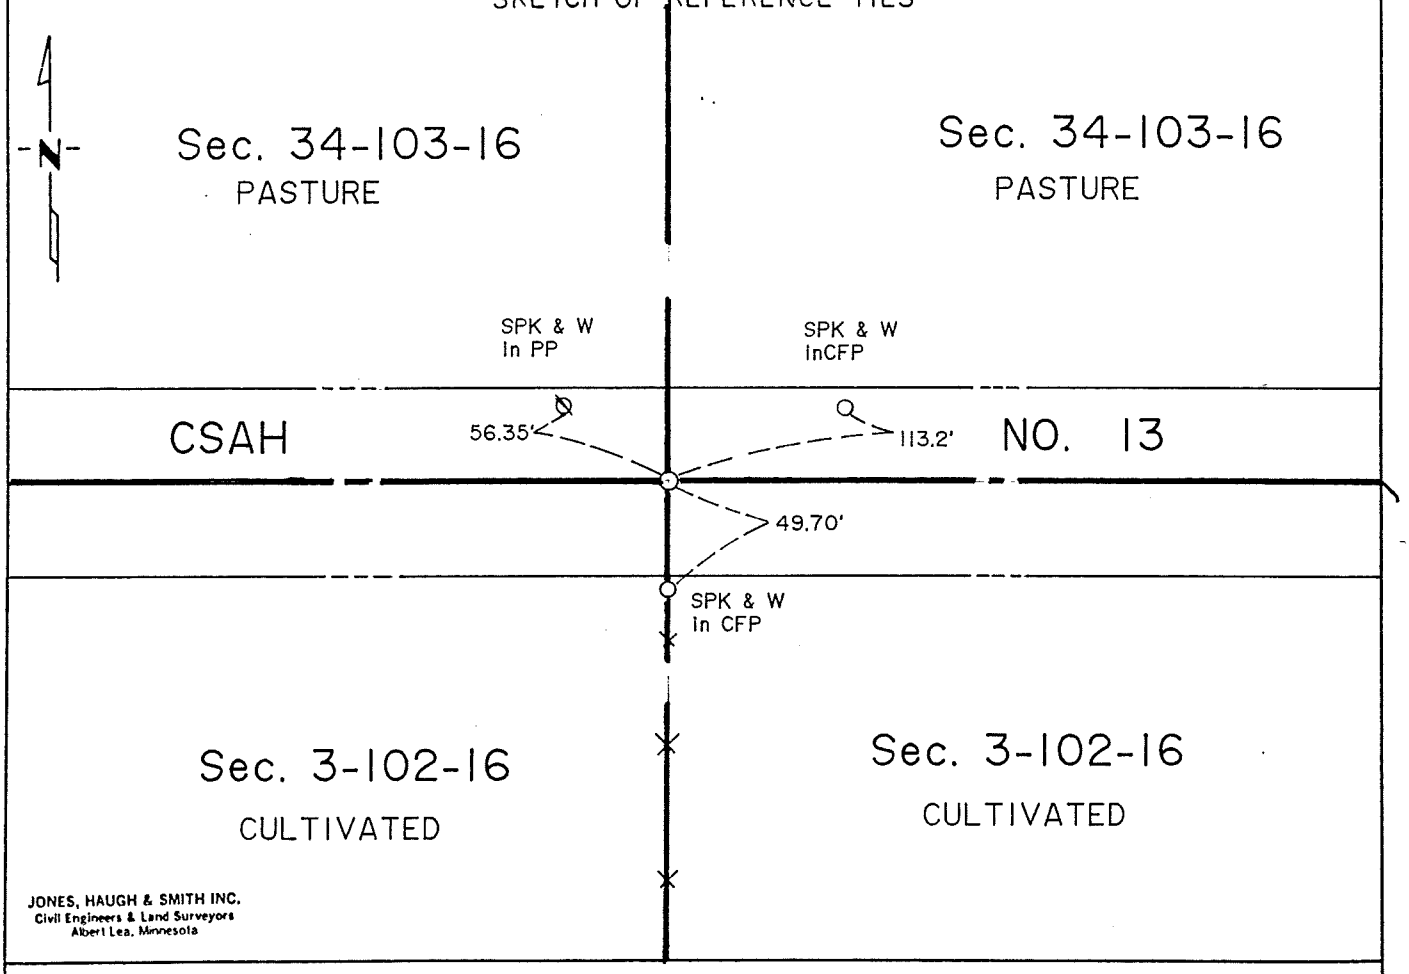

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 5-16-91

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

N 1/4 corner Section 3-102-16

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post and a handful of small stones were set with a mound of earth and trench.

The following were contacted for section corner information:

Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner:

1980 Jones, Haugh and Smith Inc notes show corner located during survey in Section 34-103-16 and Section 2-102-16.

1991 Jones, Haugh & Smith Inc crew, under the direction of John H. Schulte dug with the County backhoe on centerline of E-W road and fence line south for bituminous overlay project SAP 50-613-08. Dug a 4' x 7' x 6' deep hole and uncovered a 1/2" diameter pipe 0.5' deep over a 10" diameter x 18" concrete monument with a 1" diameter iron cast in center 4' below road surface in virgin soil. Continued digging and found no further evidence of PLS corner. Pipe found was 0.3' west and 0.55' south in concrete monument. Reset concrete monument found and set a cast iron monument over at road surface.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.