Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 9, Township 103N Range 16W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 10-26-94 (DATE) found a Pointed rock 1.5 S RCP pipe

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 10-26-94 (DATE) placed a Capped 5/8 iron over rock 4" below road surface

SKETCH OF REFERENCE TIES

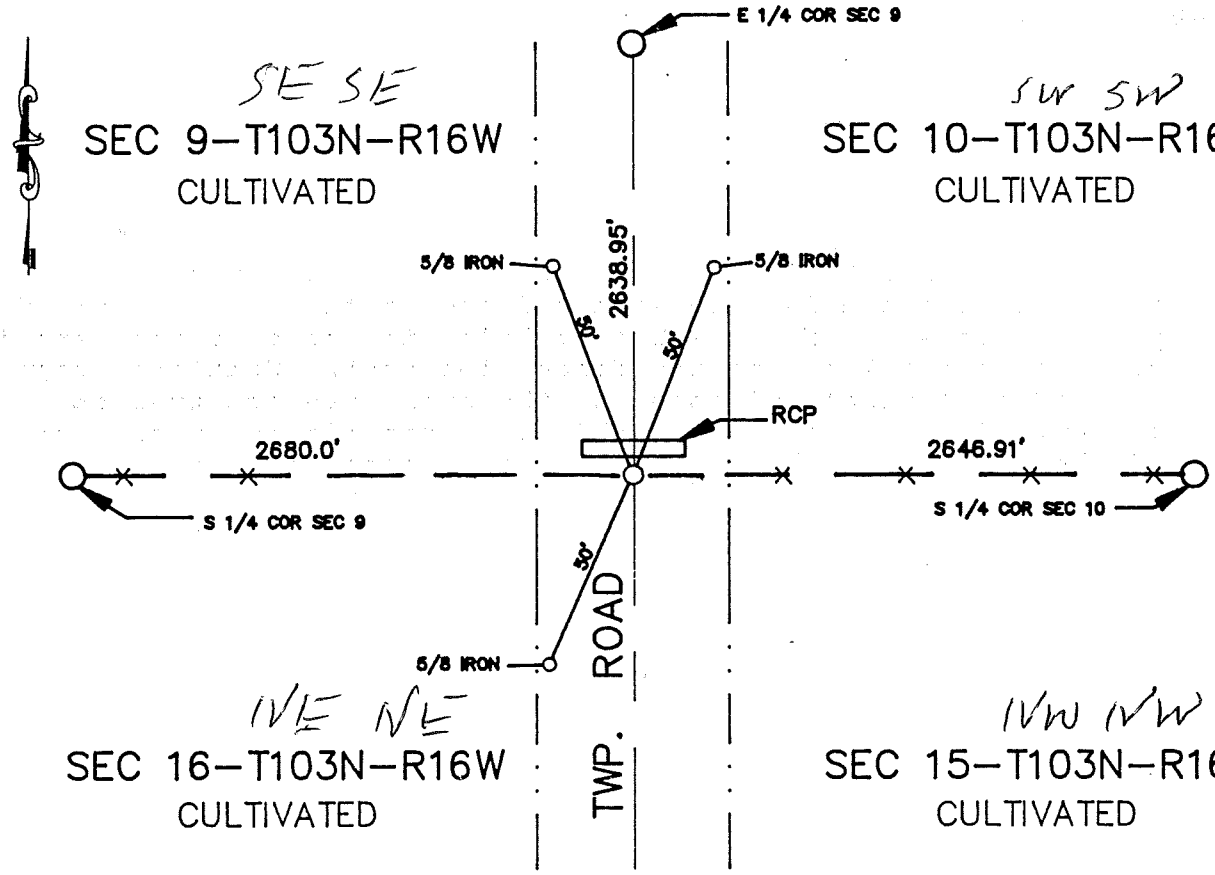

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page. BOOK 86 PAGE 346

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

[signature] 3-395
SIGNATURE DATE

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 11 A.M. on the 6 day of May A.D., 1995

COUNTY RECORDER Charles Engen
By Susan M. Davis, Deputy
DOCUMENT NO. 435276

M.H.D. FORM NO. 2105

BK 86 Misc Pg 346

STATEMENT OF EVIDENCE

SE cor Sec 9-103-16

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

No information was available from the above sources.

1994 Jones, Haugh & Smith Inc personnel under the direction of John H. Schulte IV, RLS 13807, dug with county backhoe on centerline of township road and in line with a fence to the east and with a fence/field division to the west. A pointed stone was found 2.4 feet below the road surface. The stone was found 1.5 feet south of an apparently abandoned RCP pipe. Pieces of wood were also found on the west side of the stone. The stone was accepted as the true corner and a 5/8" iron capped RLS 13807 was placed on the north side. Another 5/8" iron was placed above the stone four inches below the road surface. Electronic surveying equipment was used to measure the distance to the S 1/4 and the E 1/4 Section 9 and to the S 1/4 Section 10. The distances are as follows:

2680.0 W to the S 1/4 cor Sec 9
2638.95 N to the E 1/4 cor Sec 9
2646.91 E to the S 1/4 cor Sec 10

For electronic survey data and analysis contact the firm of Jones, Haugh & Smith Inc.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.