Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 17, Township 103N Range 18W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-18-93 (DATE) found a NOTHING

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-27-93 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

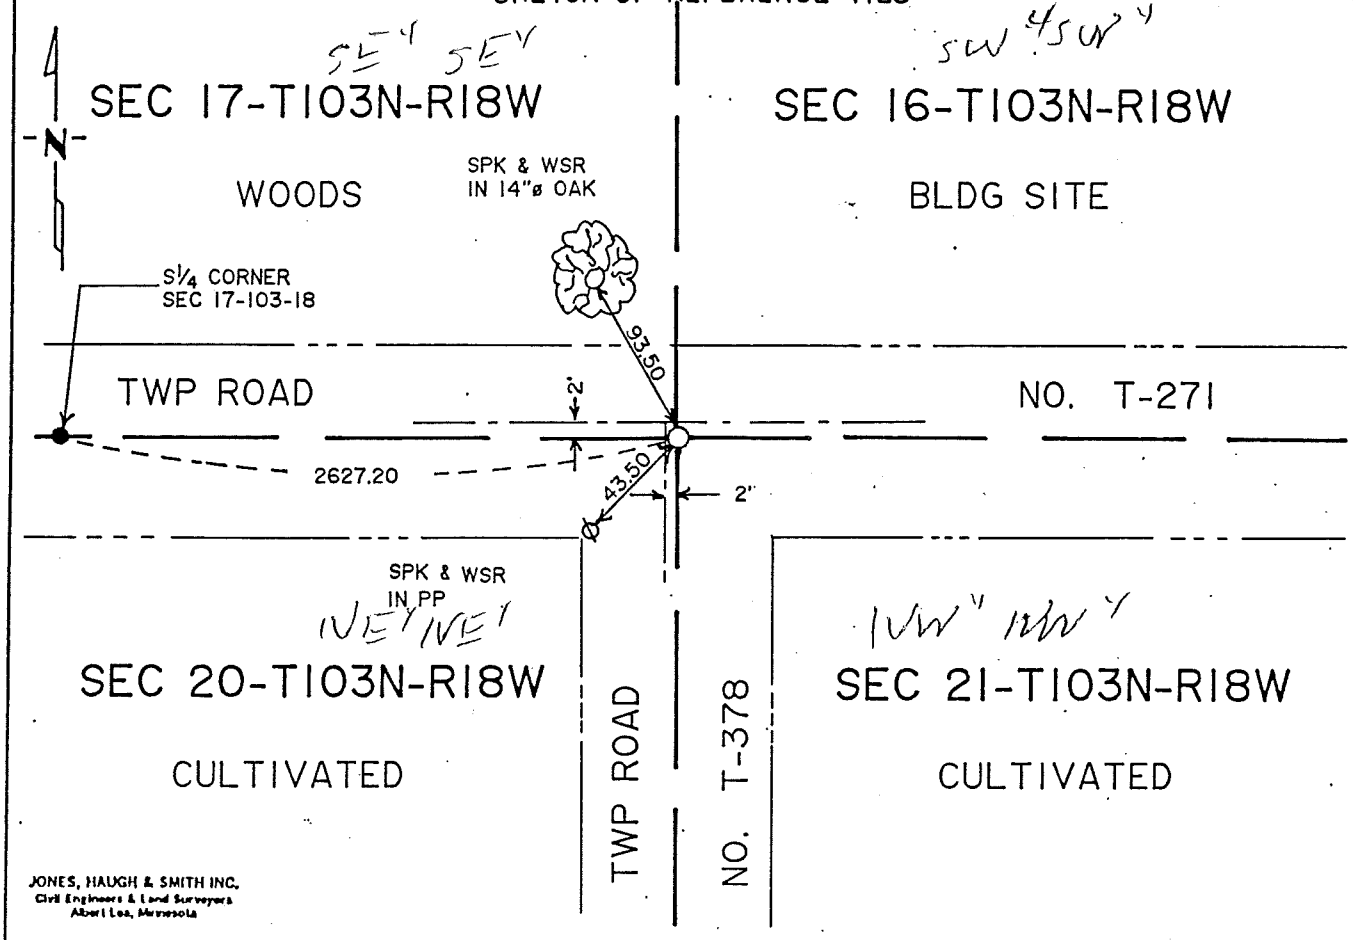

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 6-9-93

Registration No. 13007

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 11 A.M. on the 17 day of June A.D., 19 93

COUNTY RECORDER Edwardo Zamora

By Marlene Martin, Deputy

DOCUMENT NO. 421536

Bk 79 Misc. Pg. 584

M.H.D. FORM NO. 2105

BOOK 79 PAGE 584

STATEMENT OF EVIDENCE

SE cor Sec 17-103-18

This corner was originally established by Deputy Surveyor William Anderson of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench. The following ties were taken:

10" Burr Oak	S 69° W	70 links (46.20 ft)
8" Burr Oak	N 43° W	185 links (122.10 ft)
8" Burr Oak	N 41° E	140 links (92.40 ft)
7" Burr Oak	S 18° E	265 links (174.90 ft)

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1885 Clausen, Mower County Surveyor, notes indicate a government post at this corner.

1950 Mower County Highway Dept Book 1, indicates an iron stake inplace, south 254.4 feet east of the southwest corner of this section or 2627.20 feet east of the S 1/4 corner of said section. The following ties were taken:

124.0' East to 6" Burr Oak
87.0' NW to blaze in Burr Oak
107.5' NW to blaze in Burr Oak

1979 Jones, Haugh & Smith Inc crew did not find ties to corner.

1993 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, RLS 13807, dug a 4'x4'x20' hole on the centerline centerline of township road and found no evidence of iron stake noted in Book 1 of the Mower County Highway Dept. We also dug to virgin soil and found no evidence of the original public land survey corner. Therefore we set section corner using a distance of 2627.20 feet from the S 1/4 corner of Section 17 noted in Book 1 of Mower County Highway Dept which fits location of existing centerlines of east-west and south township roads.

The monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

BOOK 79 PAGE 585