Revised

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 13, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-28-93 (DATE) found a 3/4"ø x 16" IRON AND A 6"ø x 18" CONC MONUMENT

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 9-25-96 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

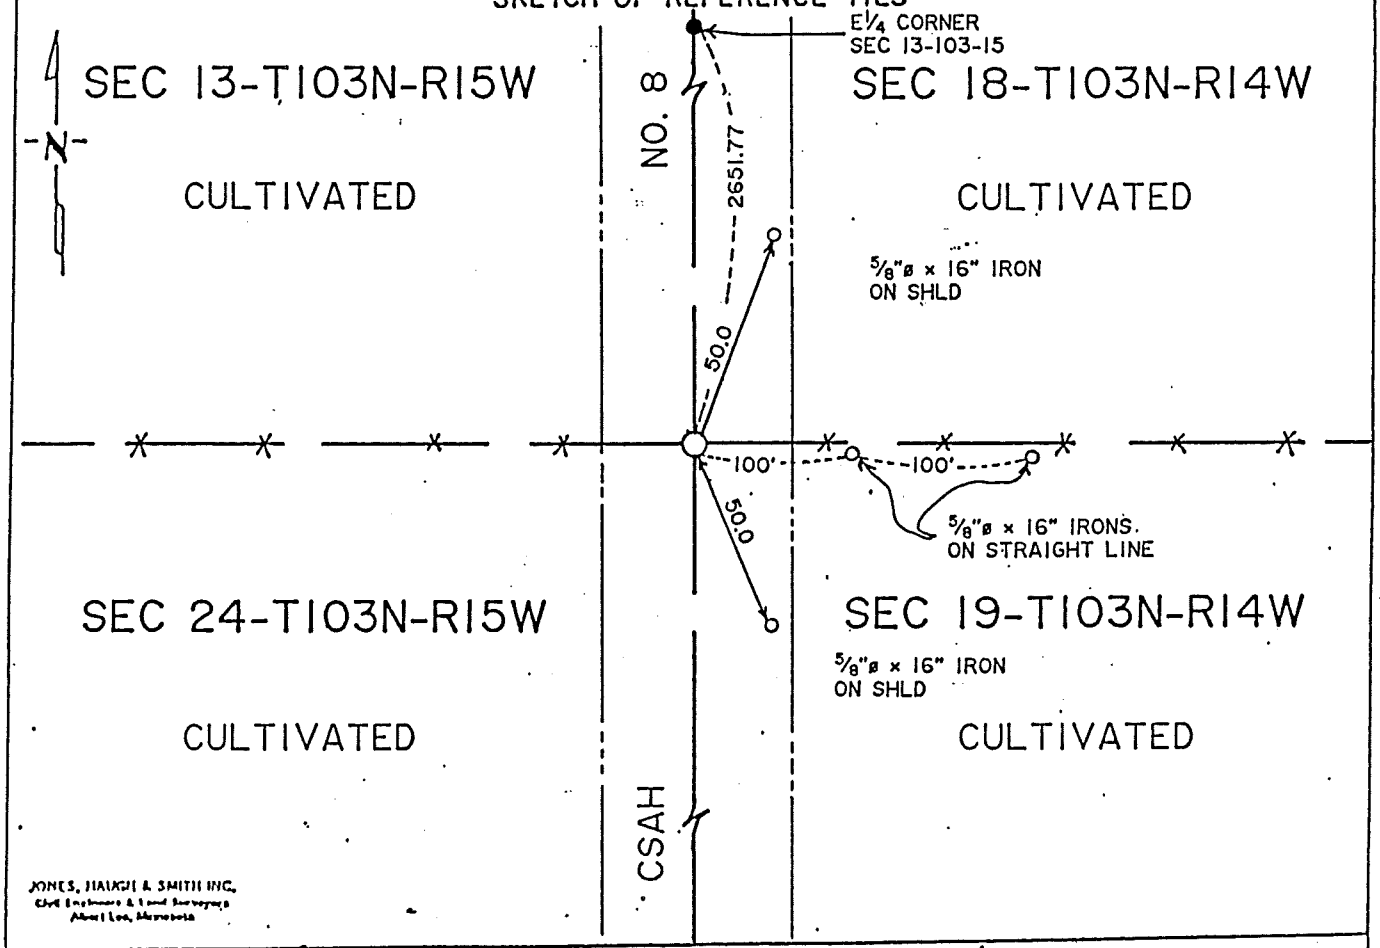

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ SIGNATURE _____ DATE

Registration No. _____

☐ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

SE corner Section 13-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1885 Clausen, Mower County Surveyor, notes indicate a stone at this location.

1945 Mower County Highway Department, Book 1, indicates a 6" diameter concrete monument with iron in center and a one inch diameter pipe above concrete monument.

1979 Jones, Haugh & Smith Inc crew found a 3/4" diameter pipe at this location.

1993 Jones, Haugh & Smith Inc crew under the direction of John Schulte, RLS 13807, dug a 3'x4'x5' long hole with county backhoe on the centerline of County State Aid Highway No. 8 and inline with east-west line fences. We found a 3/4" diameter x 16" pipe four inches below road surface and a 6" diameter x 18" clay tile filled with concrete and a 3/8" diameter iron in center which was at a depth of four feet and inline with east-west line fences. Therefore we accepted concrete monument noted in above said information as the perpetuation of this corner and set a cast iron monument near road surface above concrete monument found.

1996 Jones, Haugh & Smith Inc crew re-set corner from ties.

The monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.