Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

W 1/4 Corner of Section 36, Township 103N, Range 17W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-29-91 (DATE) found a 1/2"Ø x 24" re-bar 0.5' below road surface.

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-29-91 (DATE) placed a cast iron monument

SKETCH OF REFERENCE TIES

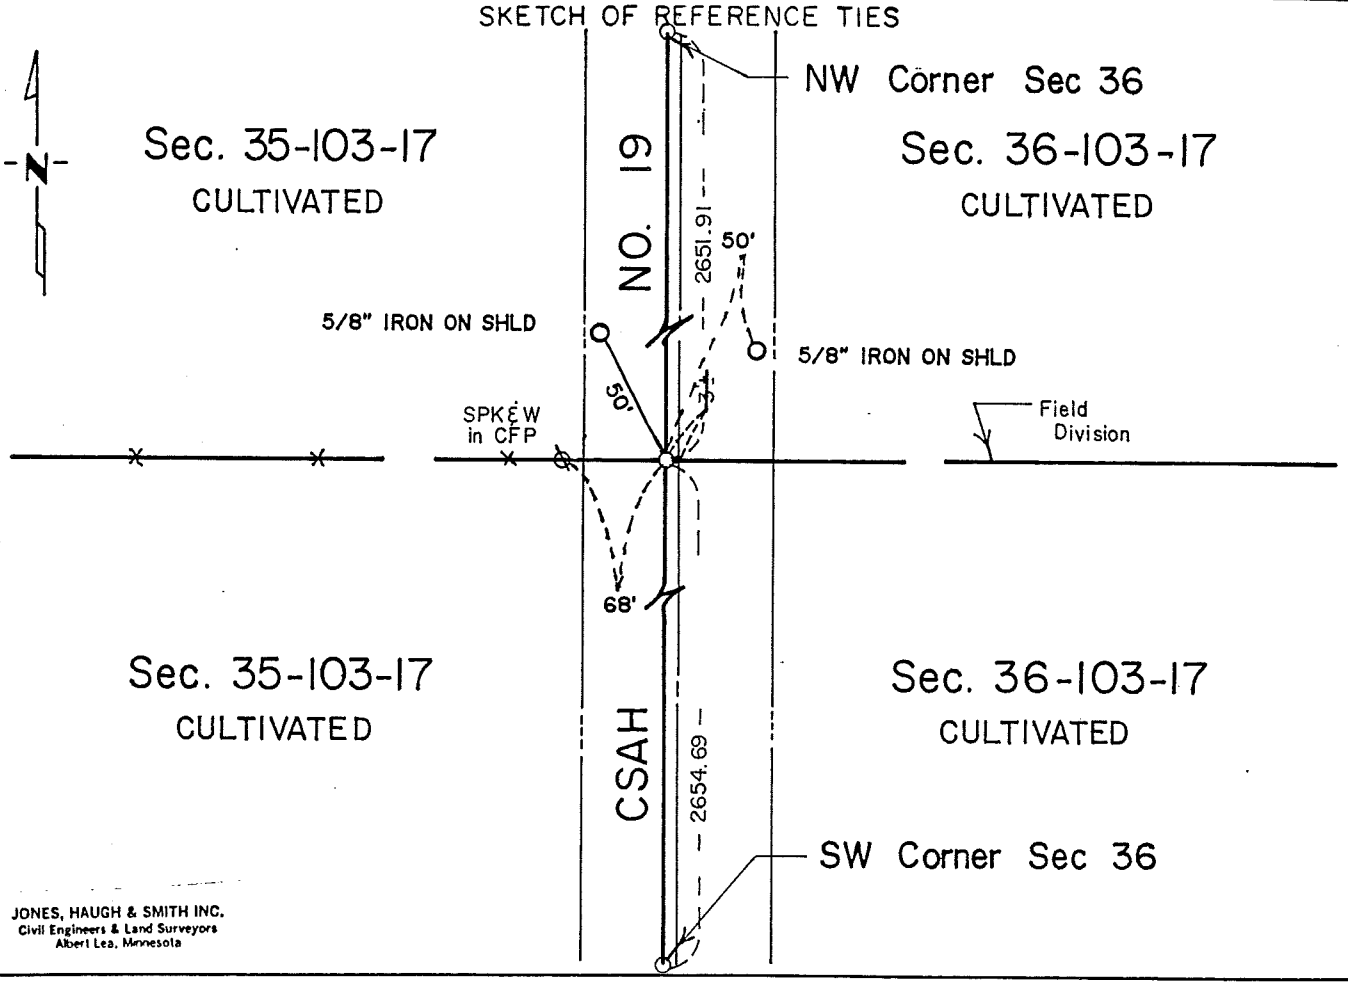

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

[signature] 6-7-91
SIGNATURE DATE

Registration No. 13807

☑ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the ____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

W 1/4 corner Section 36-103-17

This corner was originally established by Deputy Surveyor William I. Anderson of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1985 Ray Tucker, RLS 15471, uncovered a 3/4 inch diameter iron 4 feet, more or less, west of centerline of N-S road and reset 1/2" diameter x 24" iron capped RLS 15471 and the following ties were taken and recorded in Book "A" in the office of the County Engineer:
28.25' West to spk in fence post
75.0' West to 3/4" diameter iron
33.0' East to 3/4" diameter iron

1991 Jones, Haugh & Smith Inc dug with the County backhoe for grading project SAP 50-619-15 and uncovered a 3/4 inch diameter iron over a 1/2" X 24" iron re-bar, continued digging and found no further evidence of a public land survey corner. Assumed any perpetuation of corner would have been destroyed in 1985 by Tuckers excavation. Therefore accepted 1/2" diameter iron and set a cast iron monument at the same location.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

1997 Re-set