Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NE Corner of Section 23, Township 101N Range 16W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 6-3-93 (DATE) found a 3/4"ø x 16" IRON AND A 6"ø x 18 CONC MON. WITH IRON IN CNT

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 6-3-93 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

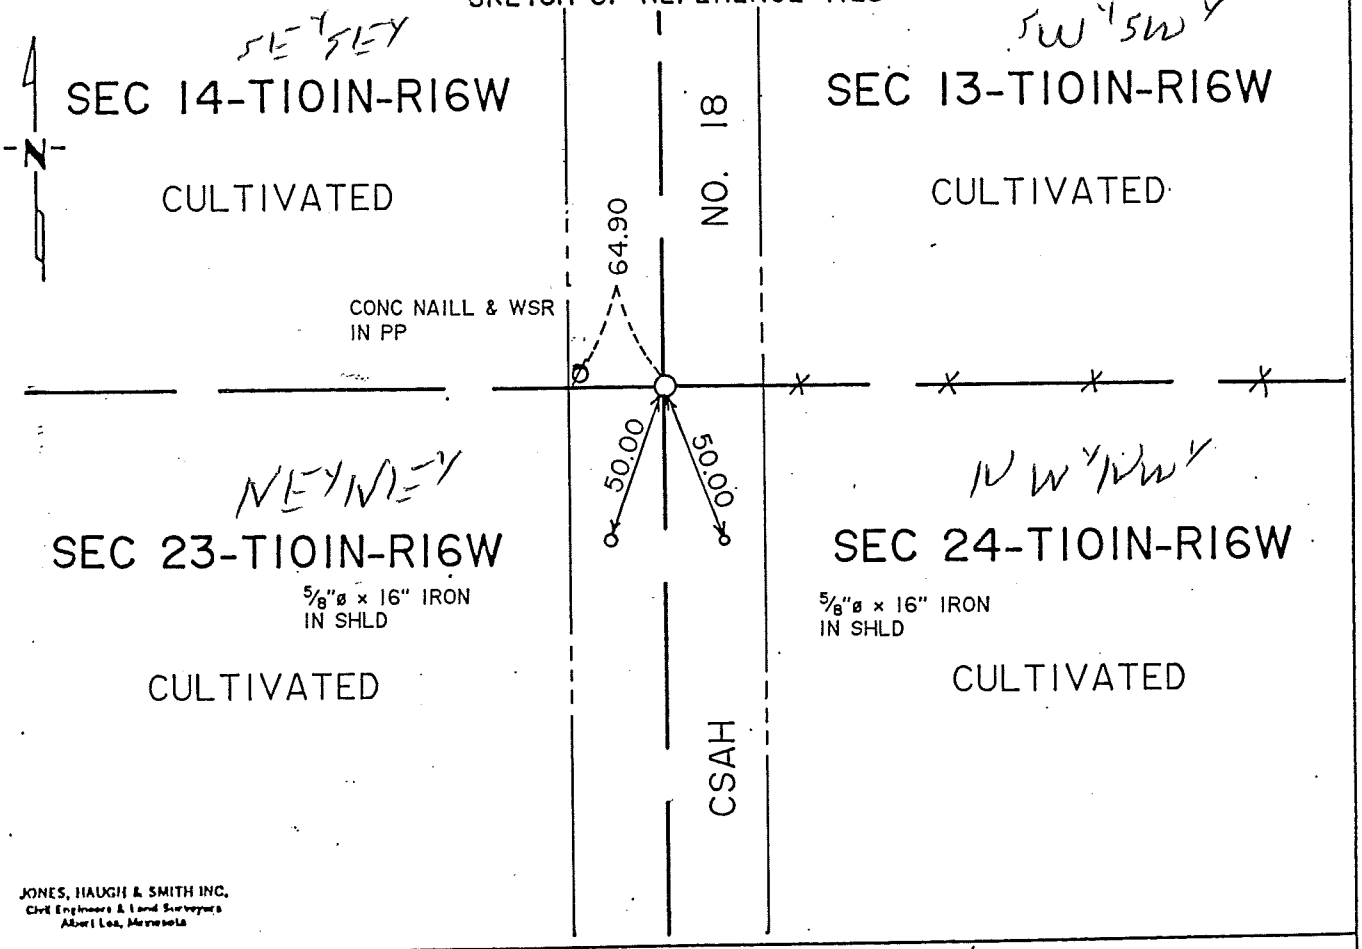

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 6-14-93

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 2 P.M. on the 23 day of June A.D., 1993

COUNTY RECORDER Edward Conger

By Marlene Martin, Deputy

DOCUMENT NO. 421628

Bk 80 Misc Pg. 8

BOOK PAGE

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NE cor Sec 23-101-16

This corner was originally established by Deputy Surveyors Charles Phipps and Edward Fitzpatrick of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of the perpetuation of the original public land survey corner.

1889 Clausen, Mower County Surveyor, notes indicate a government post at this corner which was 40.34 chains south of the W 1/4 of Section 14-101-16.

1958 Mower County Highway Department Book 1 indicates a large pointed rock between two others and also a concrete monument inplace at this corner.

1993 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, RLS 13807, dug a 3'x3'x8' hole on centerline of County State Aid Highway No. 18 and also in line with line fence running east. We found a 3/4" diameter x 16" iron one foot deep and a 6" diameter x 12" concrete monument one foot below iron found. Monuments found were in line with the fence line running east and also the centerline of County Road. Therefore we accepted monuments found as the perpetuation of the original public land survey and pulled 3/4" diameter iron found and set a cast iron monument near road surface above concrete monument left inplace.

The monuments found and cast iron monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.