Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E1/4 Corner of Section 26, Township 101N, Range 16W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 6-3-93 (DATE) found a STRAND OF BARBED WIRE AND A NEST OF LARGE STONES

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 6-3-93 (DATE) placed a 5/8"ø x 16" IRON CAPPED RLS NO. 13807 IN CNT OF STONES AND A CAST IRON MONUMENT ABOVE STONES

SKETCH OF REFERENCE TIES

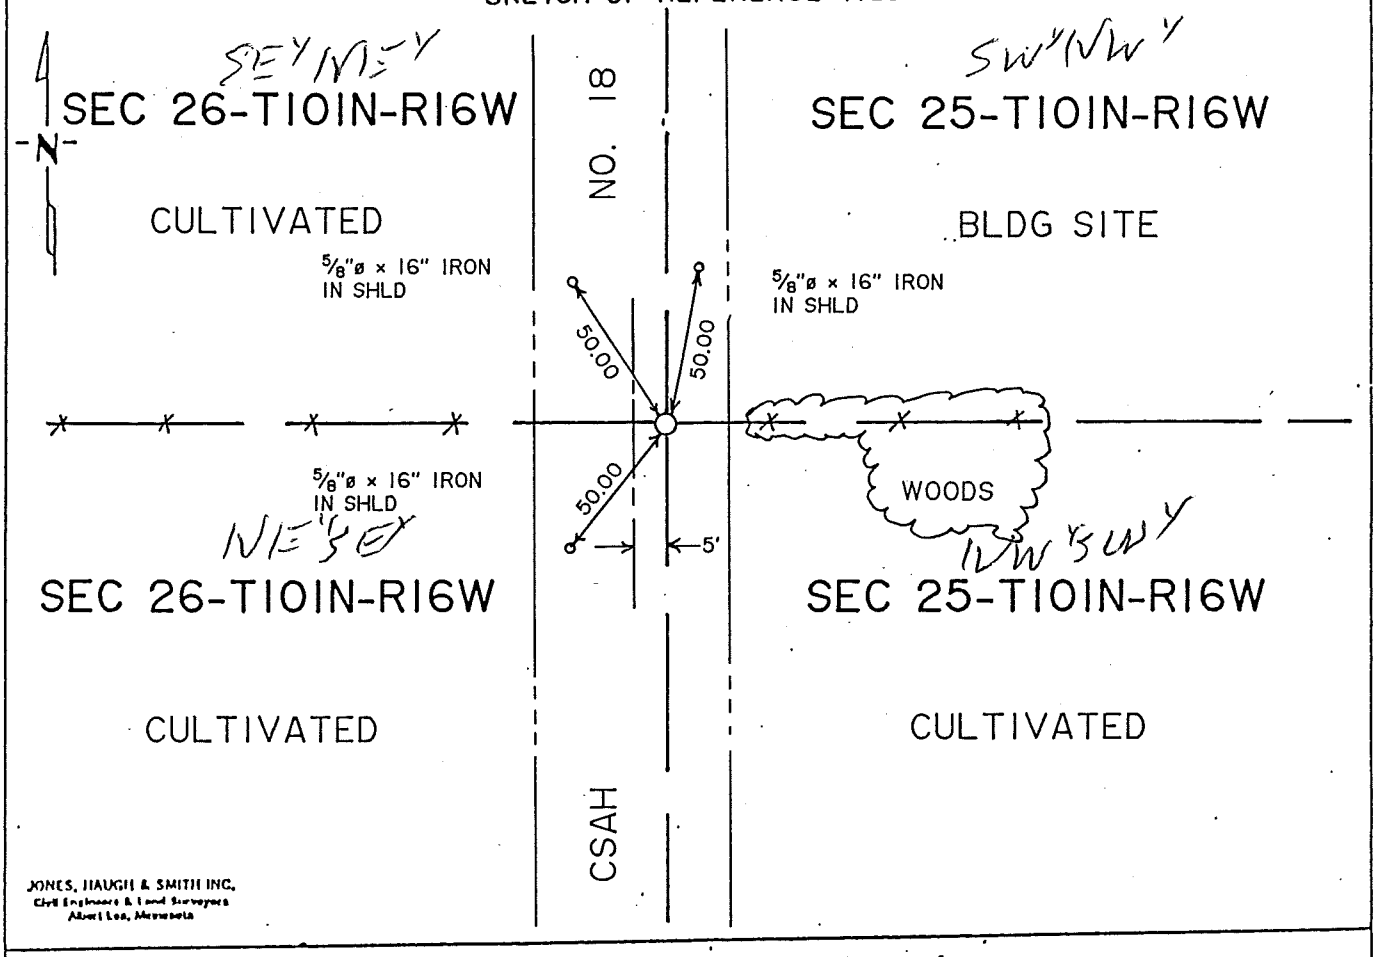

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 6-14-93

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 3 P.M. on the 23 day of June A.D., 1993

COUNTY RECORDER Charles Engen

By Marlene Martin, Deputy

DOCUMENT NO. 121682

M.H.D. FORM NO. 2105 BOOK 80 PAGE 16

STATEMENT OF EVIDENCE

E 1/4 cor Sec 26-101-16

This corner was originally established by Deputy Surveyors Charles Phipps and Edward Fitzpatrick of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of the perpetuation of the original public land survey corner.

1889 Clausen, Mower County Surveyor, notes indicate a government post at this corner.

1993 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, RLS 13807, dug a 4'x3'x10' hole five feet east of the centerline County State Aid Highway No. 18 and also in line with the east-west line fences. We dug to a depth of three feet which was into virgin soil and found a strand of barbed wire with a loop at end which ran west to line fence running west. Also there was a nest of large stones around and under barbed wire. County Road Plans show that section line would run five feet east of centerline of road. Therefore we accepted barbed wire and stones found as the perpetuation of the original public land survey and set a 5/8" diameter x 16" iron in center of stones and barbed wire and set a cast iron monument near road surface above barbed wire and stones.

The monument found and cast iron monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.