Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 26, Township 101N Range 16W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 6-3-93 (DATE) found a 3" ALUM. DISC AND A HARRISON CIM

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 6-3-93 (DATE) placed a LEFT MONUMENTS AS FOUND

SKETCH OF REFERENCE TIES

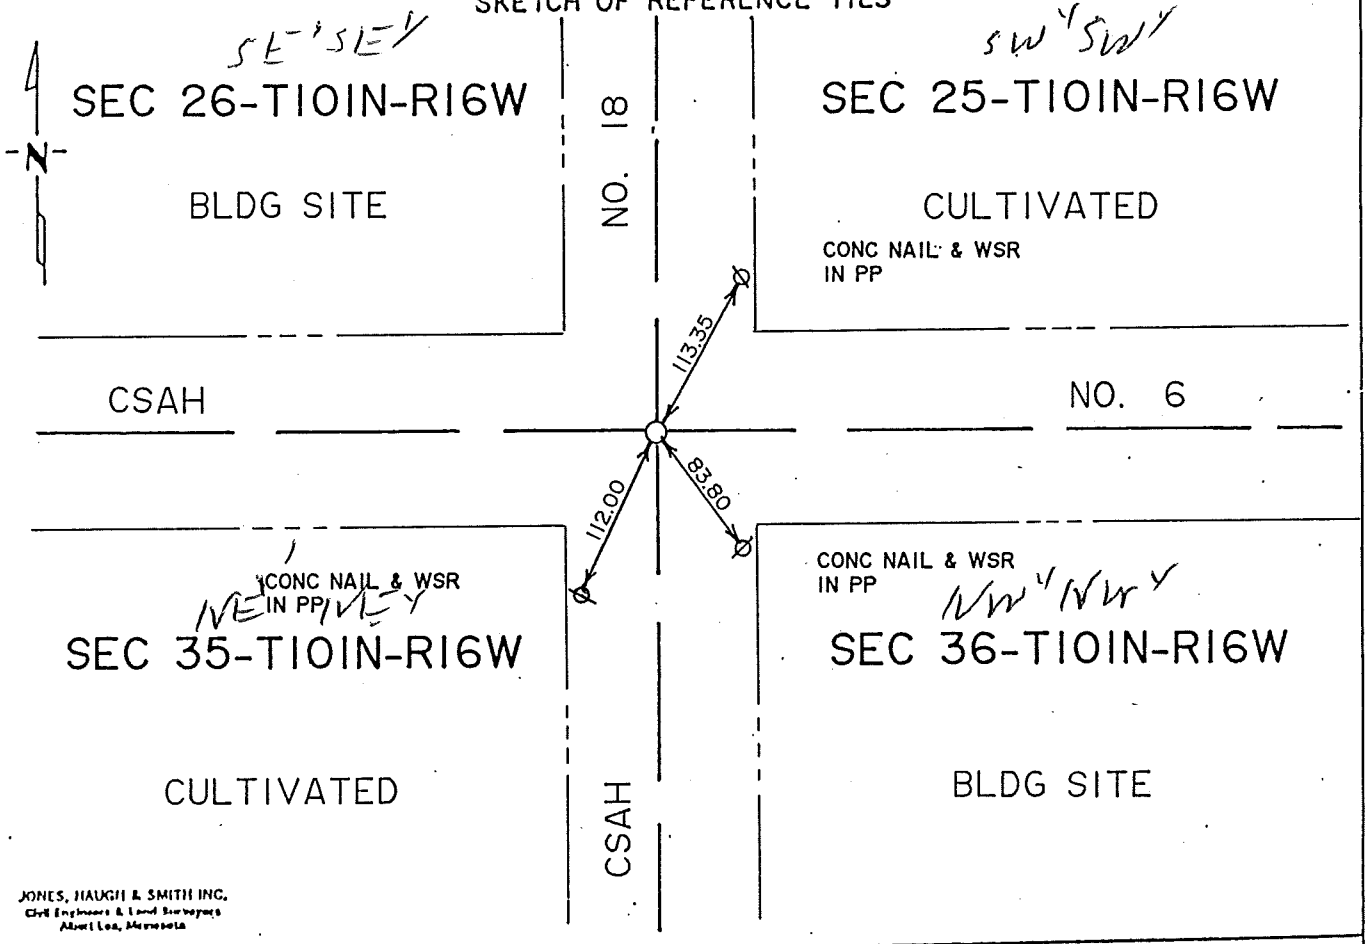

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 6-14-93

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 2 P.M. on the 23 day of June A.D. 1993

COUNTY RECORDER Arnold Enger

By Marlene Martin, Deputy

DOCUMENT NO. 421681

BOOK 80 PAGE 14 Bk 80 Misc Pg. 14

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

SE cor Sec 26-101-16

This corner was originally established by Deputy Surveyors Charles Phipps and Edward Fitzpatrick of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of the perpetuation of the original public land survey corner.

1889 Clausen, Mower County Surveyor, notes indicate a government post at this corner.

1931 Mower County Highway Department Book 1 indicates a granite rock inplace.

1958 Mower County Highway Department Book 1 and County State Aid Highway No. 18 Road Plans indicate a concrete monument inplace.

1993 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, RLS 13807, dug a 3'x3'x5' hole on the centerline centerline intersection of County State Aid Highway No. 18 and County State Aid Highway No. 5. We found a 3" aluminum disc on a 3/4" diameter x 16" iron at the road surface. We continued digging to a depth of two feet and found a Harrison cast iron monument which was directly under aluminum disc found at surface. No evidence was found of the concrete monument noted in 1958. However the cast iron monument is in agreement with location of corner on 1931 and 1958 Road Grading Plans. Therefore we accepted monuments found as the perpetuation of the original public land survey corner and reset monuments as found.

The monuments found fit occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.