Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NW Corner of Section 15, Township 101N, Range 18W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On _____ (DATE) found a _____

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 4-17-91 (DATE) placed a cast iron monument on ℄ of E-W roads in line with fences N-S.

SKETCH OF REFERENCE TIES

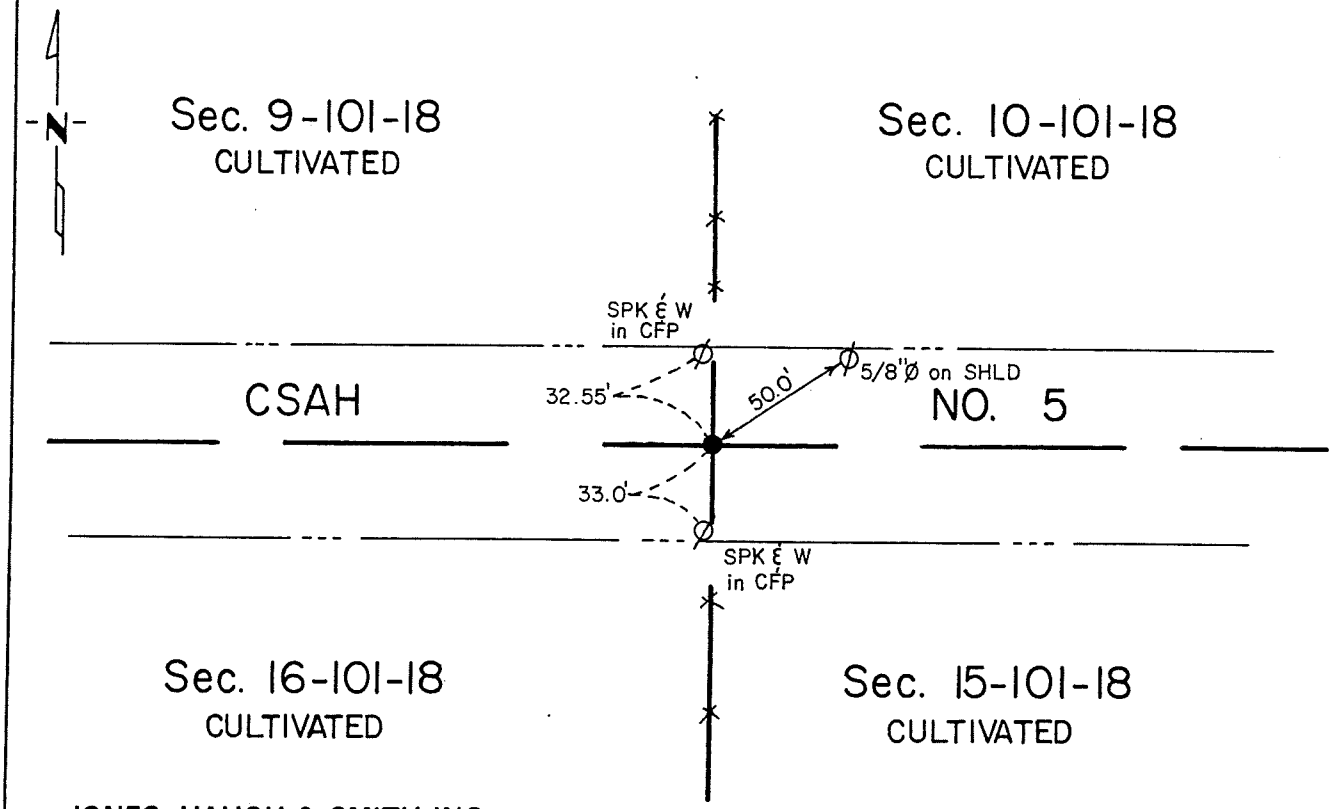

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ (SIGNATURE) 5-9-91 (DATE)

Registration No. 13807

☑ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the ____ day of _____ A.D., 19 ___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NW corner Section 15-101-18

This corner was originally established by Deputy Surveyor William I. Anderson of the U.S. General Land Office in 1853. The government notes show a wood post and a charred stake were set with a mound of earth and trench. The following ties were taken:

6" Burr Oak	S 7°E	185 links (122.10 ft)
6" Burr Oak	N 85 1/2 °E	55 links (36.30 ft)

The following were contacted for section corner information:

Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following evidence was obtained to support evidence of a perpetuation of the original public land survey corner.

1941 Book "A" in the office of Mower County Engineers indicates a corner was in place at Sta. 158 + 71.8 PI on centerline road in line with fence N-S. The following ties were taken:

50.5' N55°30'W to F.P.
35.9' S22°30'E to Oak tree
90.0' S76°00'E to Oak tree
46.9' N3°00'W to Oak tree

1991 Jones, Haugh & Smith Inc. crew under the direction of John Schulte dug with the County backhoe for 1991 Grading Project on County State Aid Highway #5 SAP #50-605-10. Dug a 4'x12'x5' deep hole on centerline of E-W road in line with fences North and South and found no evidence of the public land survey corner. Placed a cast iron monument on centerline of E-W road in line with fence lines N-S using the obliterated method.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.