Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

CTR. Corner of Section 12, Township 102N, Range 18W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 8-22-91 (DATE) found a NO EVIDENCE OF PLS CORNER

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 8-22-91 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

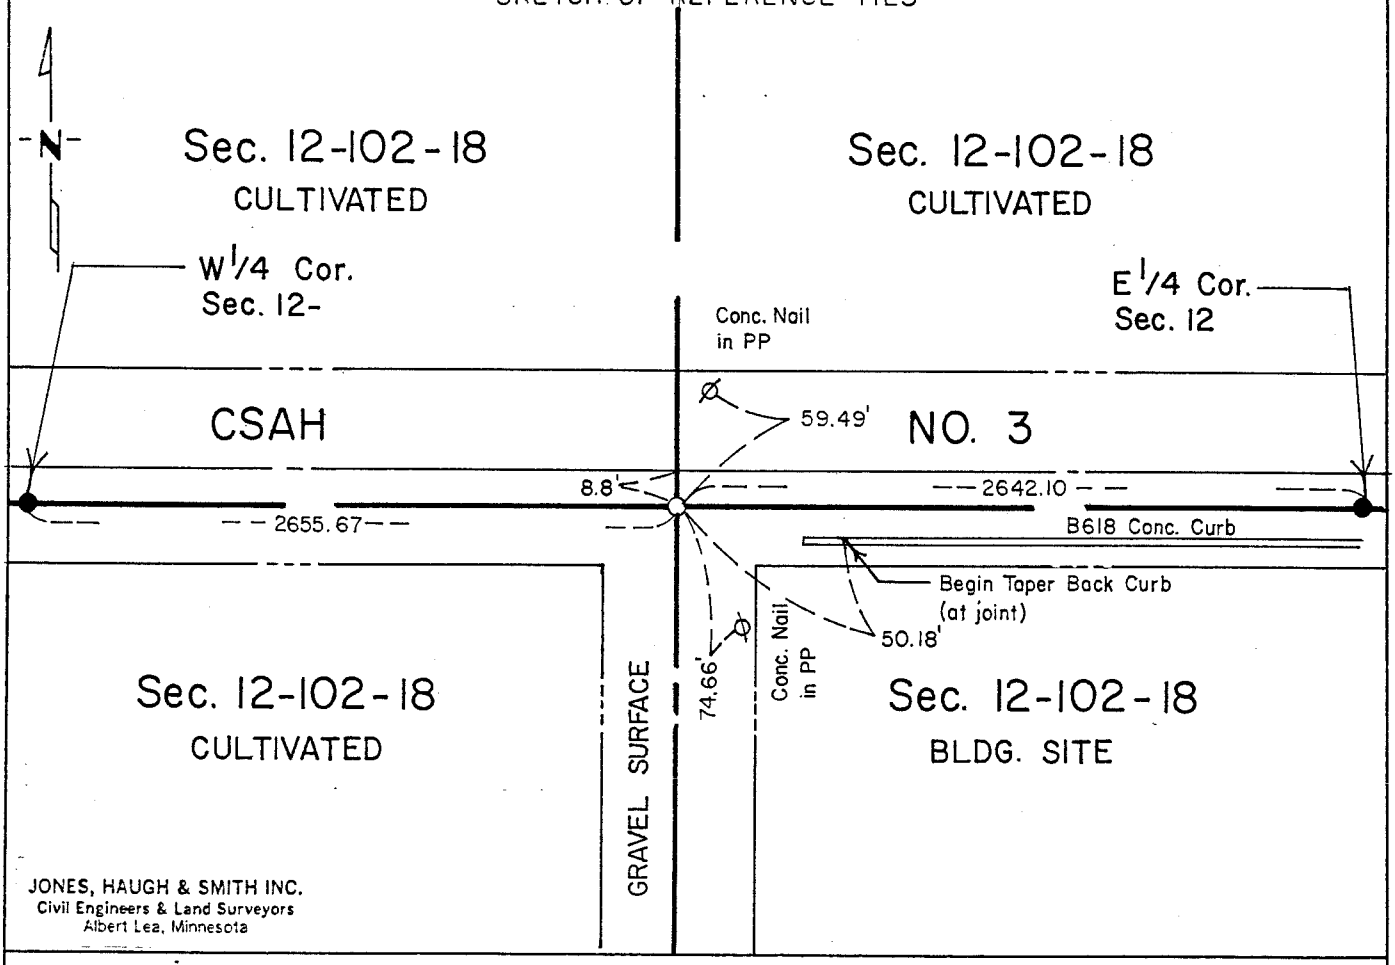

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ 9-5-91
SIGNATURE DATE

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the ____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

Ctr corner Sec 12-102-18

The following were contacted for section corner information:
Mower County Engineering Dept.
Mower County Recorder's Office

1960 C.V. Jones Engineering notes show center of section on centerline centerline of east-west-south roads.

1975 Jones & Haugh crew placed a 5/8" diameter iron at intersection of straight line between north-south and east-west quarter corners. Taped south to fence on south line of Burrwood Addition and found 654 feet versus plat 664.19 feet and taped east to E 1/4 corner and found a distance of 2641.85 feet versus plat 2645.0 feet. It appears that L.H. Edison used centerline of road intersection for center of section position.

1985 Jones, Haugh & Smith Inc crew uncovered and used a 5/8" diameter iron during a survey for the City of Austin.

1987 Jones, Haugh & Smith Inc crew located corner during a survey of the abandoned Milwaukee, St. Paul & Pacific Railroad.

1989 Jones, Haugh & Smith Inc crew found a 5/8" diameter iron capped 13807.

1989 Corner was destroyed during road construction.

1991 Jones, Haugh & Smith Inc crew under the direction of John Schulte, County Surveyor, reset a cast iron monument at this location using measurements taken in past surveys.

The monument fits occupation and road centerlines within the section and existing subdivision plats and is accepted as best evidence of a perpetuation of the original public land survey corner.