Index No. _____ P128

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 5, Township 104N Range 17W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 6-7-93 (DATE) found a 6"ø CONC MONUMENT WITH IRON IN CNT

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 6-7-93 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

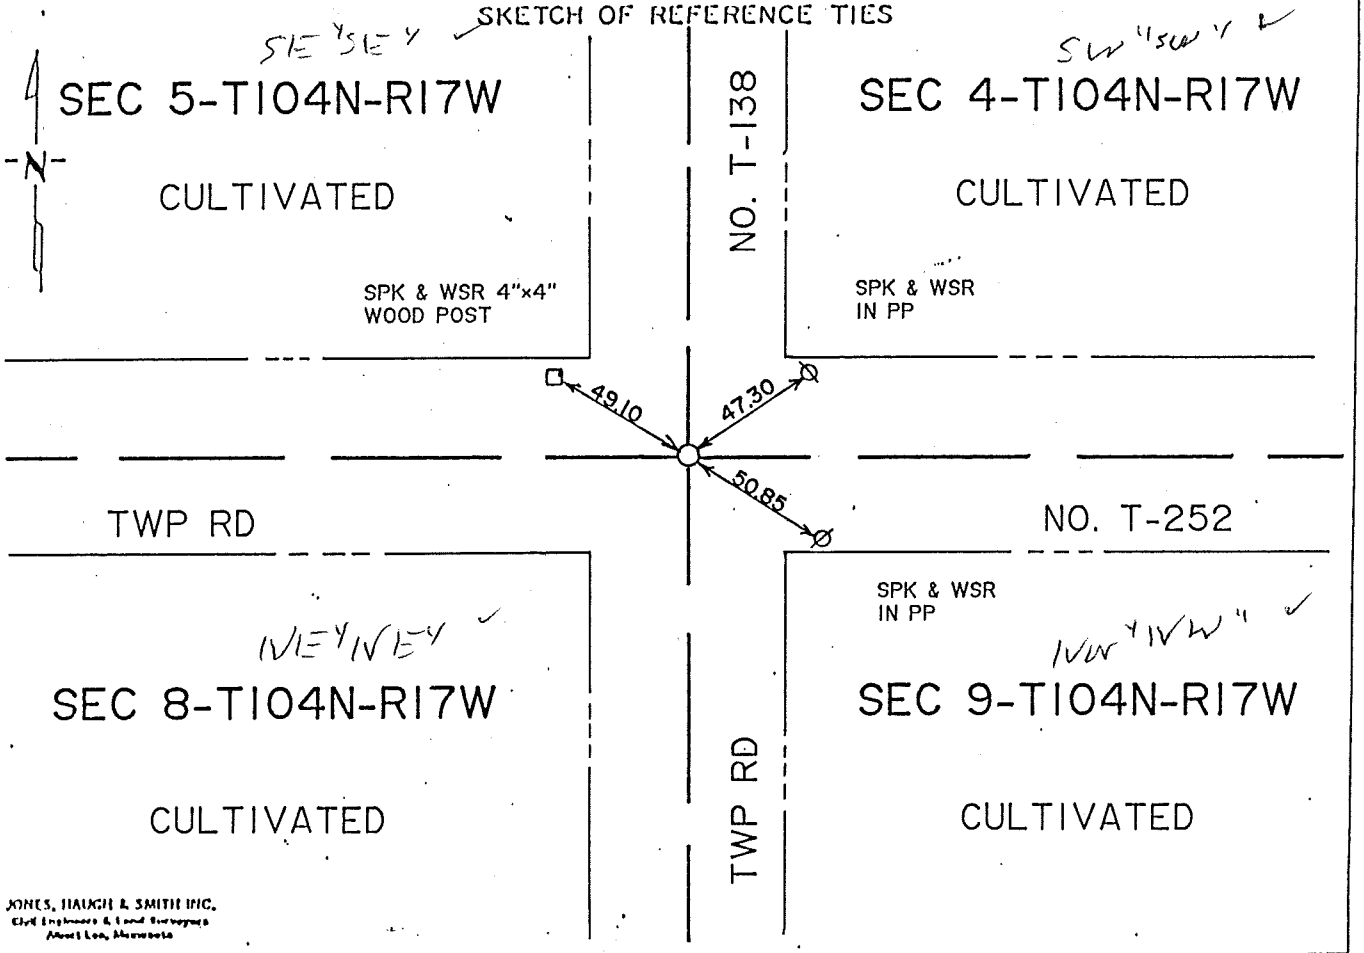

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 7-26-93

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 2 P.M. on the 28 day of July A.D., 1993

COUNTY RECORDER Thanda Enger

By Marlene Martin, Deputy

DOCUMENT NO. 422592

Bk 80 Misc P. 396

MLD FORM NO. 2105 BOOK 80 PAGE 396

STATEMENT OF EVIDENCE

SE cor Sec 5-104-17

This corner was originally established by Deputy Surveyor John Fitzpatrick of the U.S. General Land Office in 1853. The government notes show a wood post and stone were set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1890 Clausen, Mower County Surveyor, notes indicate a government post at this corner.

1948 Mower County Highway Department Book 1, indicates a concrete monument 18" below road surface. The following ties were taken:
58.6' NW to 2nd fence post west - north side of road
70.7' NW to 3rd fence post west - north side of road
69.3' SW to 3rd fence post west - south side of road
34.7' SW to south end of culvert
58.7' SW to 2nd fence post south - west side of road
53.0' SE to 3rd fence post south - east side of road
59.8' SE to 3rd fence post east - south side of road

1993 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, RLS 13807, dug with the county backhoe a 5'x4'x12' long hole on the centerline centerline of the east-west and north-south township roads using only tie left from 1948 County notes. We found a 6" diameter concrete monument with an iron in center at a depth of four feet. Therefore we accepted concrete monument found as perpetuation of the original public land survey corner and set a cast iron monument near road surface above concrete monument found.

The monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

BOOK 80 PAGE 397