Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NW Corner of Section 30, Township 104N, Range 18W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 9-17-90 (DATE) found a 3/4"Ø pipe 1.0' below road surface continued digging and found no further evidence.

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 9-17-90 (DATE) placed a cast iron monument over 5/8"Ø iron at place of pipe on road surface.

SKETCH OF REFERENCE TIES

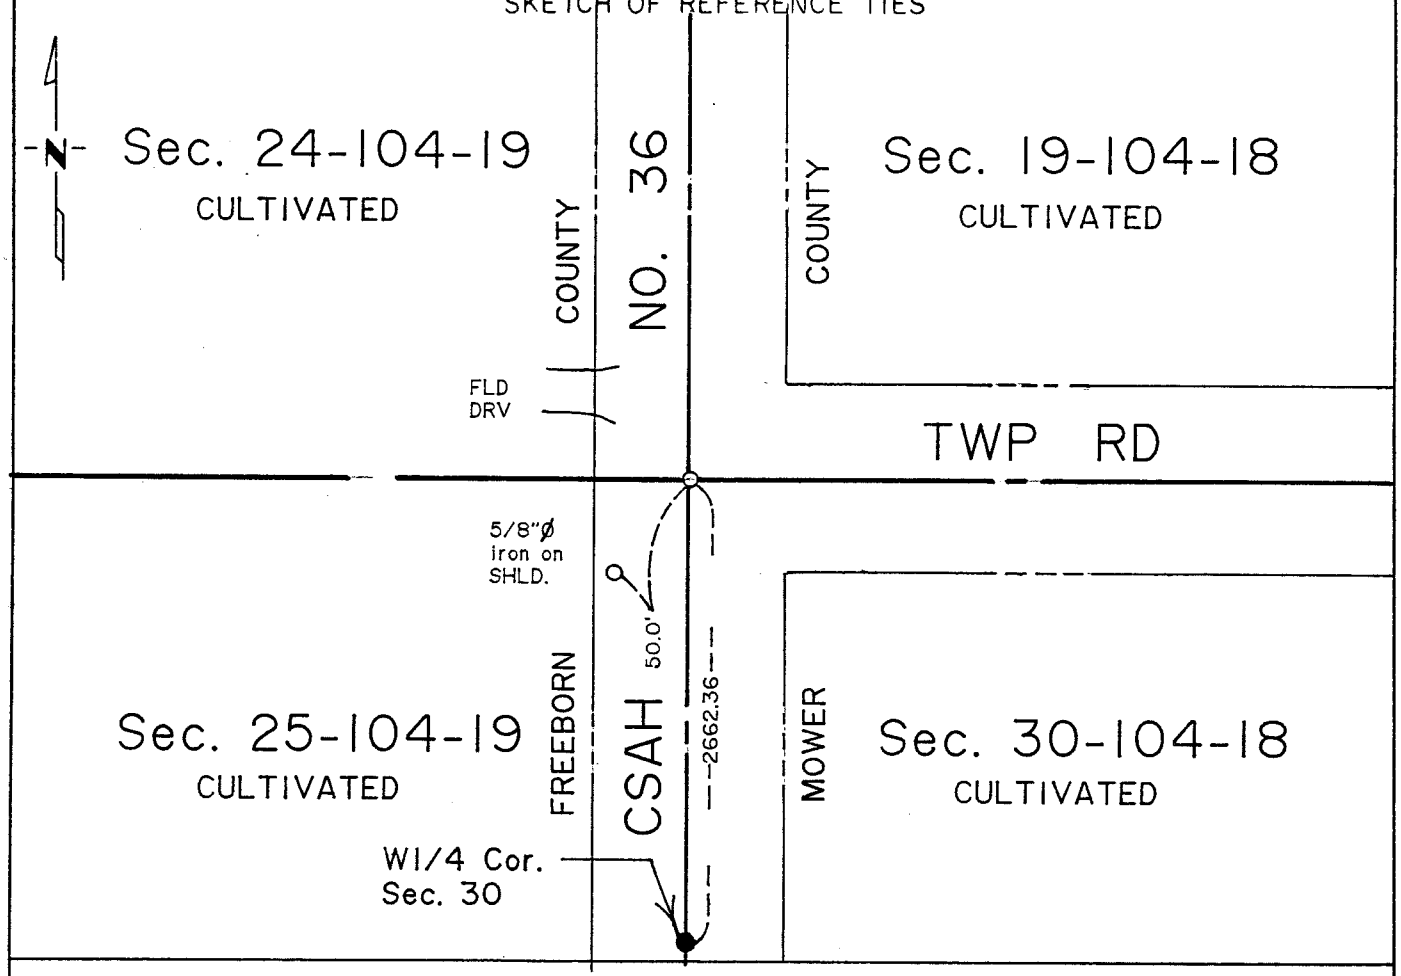

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 7-30-91

Registration No. 13807

☒ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NW corner Sec. 30-104-18

This corner was originally established by Deputy Surveyor J.B. Reymen of the U.S. General Land Survey Office in 1854. The government notes show this corner was marked with a charred stake and a mound of earth with a trench.

The following were contacted for section corner information:

Freeborn & Mower County Engineering Department
Freeborn & Mower County Recorders Office

1952 Book 'A' of the Mower County Engineering Department show a concrete monument inplace and the following ties were taken:
35.5' W to PP
59.4' W to 4th FP on FL west
32.6' E to top center S end culvert
52.0' NE to SW cor hdwl culvert

1990 Jones, Haugh & Smith crew along with the Freeborn County backhoe dug on centerline centerline of north-south-east road a hole 20'x4'x6' deep. Found a 3/4" diameter pipe 1.0' below road surface. Continued digging and found no further evidence of public land survey corner. A cast iron monument was placed over monument found.

Monument found fits occupation and road centerlines and is accepted as best evidence of a perpetuation of the public land survey corner.

For electronic survey data and analysis contact the firm of Jones, Haugh & Smith Inc.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NW Corner of Section 30, Township 104N, Range 18W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 9-17-90 (DATE) found a 3/4"Ø pipe 1.0' below road surface on ℄ ℄ of N-S-E road.

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 9-17-90 (DATE) placed a cast iron monument over a 5/8"Ø iron at location of monument found.

SKETCH OF REFERENCE TIES

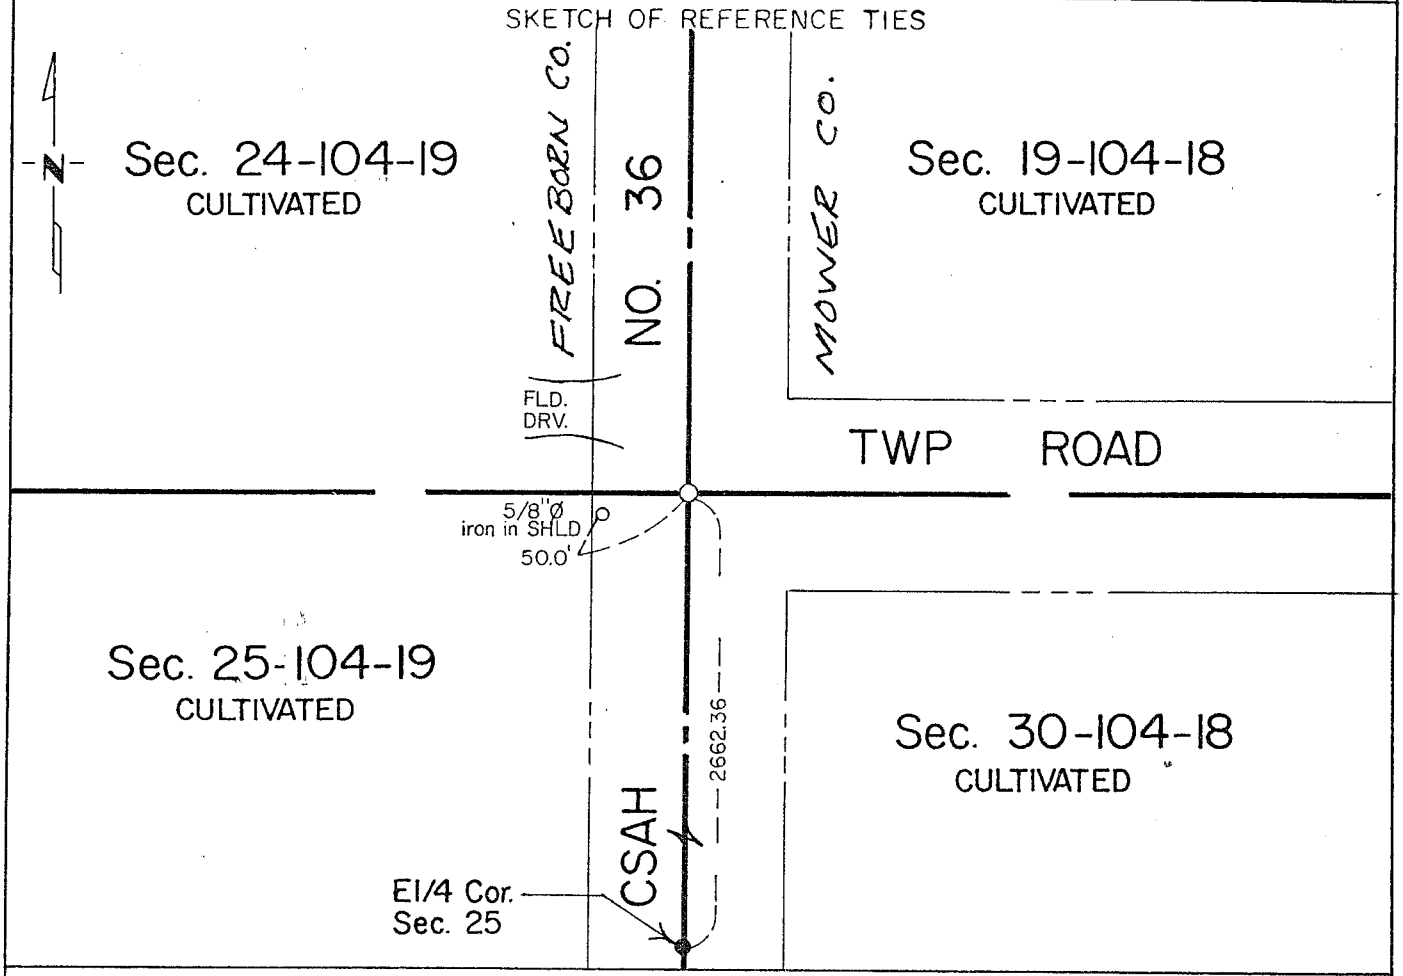

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 1-23-91

Registration No. 13807

☒ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the ____ day of _____ A.D., 19 ___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NW corner Sec 30-104-18

This corner was originally established by Deputy Surveyor J.B. Reynen of the U.S. General Land Office in 1854. The government notes show this corner was marked with a charred stake and a mound of earth with a trench.

The following were contacted for section corner information:
Mower & Freeborn County Engineering Department
Mower & Freeborn County Recorder's Office

1952 Book "A" of the Mower County Engineering Department shows a concrete monument inplace and the following ties were taken:
35.5' W to PP
59.4' W to 4th F.P. on F.L. west
32.6' E to top center south end culvert
52.0' NE to SW corner Hdwl. culvert

1990 Jones, Haugh & Smith crew along with the Freeborn County backhoe dug a hole 20'x4'x6' deep on centerline centerline of north-south-east road. Found a 3/4" diameter pipe 1.0' below road surface. Continued digging and found no further evidence of public land survey. Removed pipe and placed a cast iron monument over a 5/8" diameter iron at road surface.

Monument found fits occupation and road centerlines and is accepted as best evidence of a perpetuation of the public land survey corner.

For electronic survey data and analysis contact firm of Jones, Haugh & Smith Inc.