Index No. "G" p 63

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 2, Township 101N Range 14W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 7-16-93 (DATE) found a 6" × 12" × 16" CONC MONUMENT

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 7-16-93 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

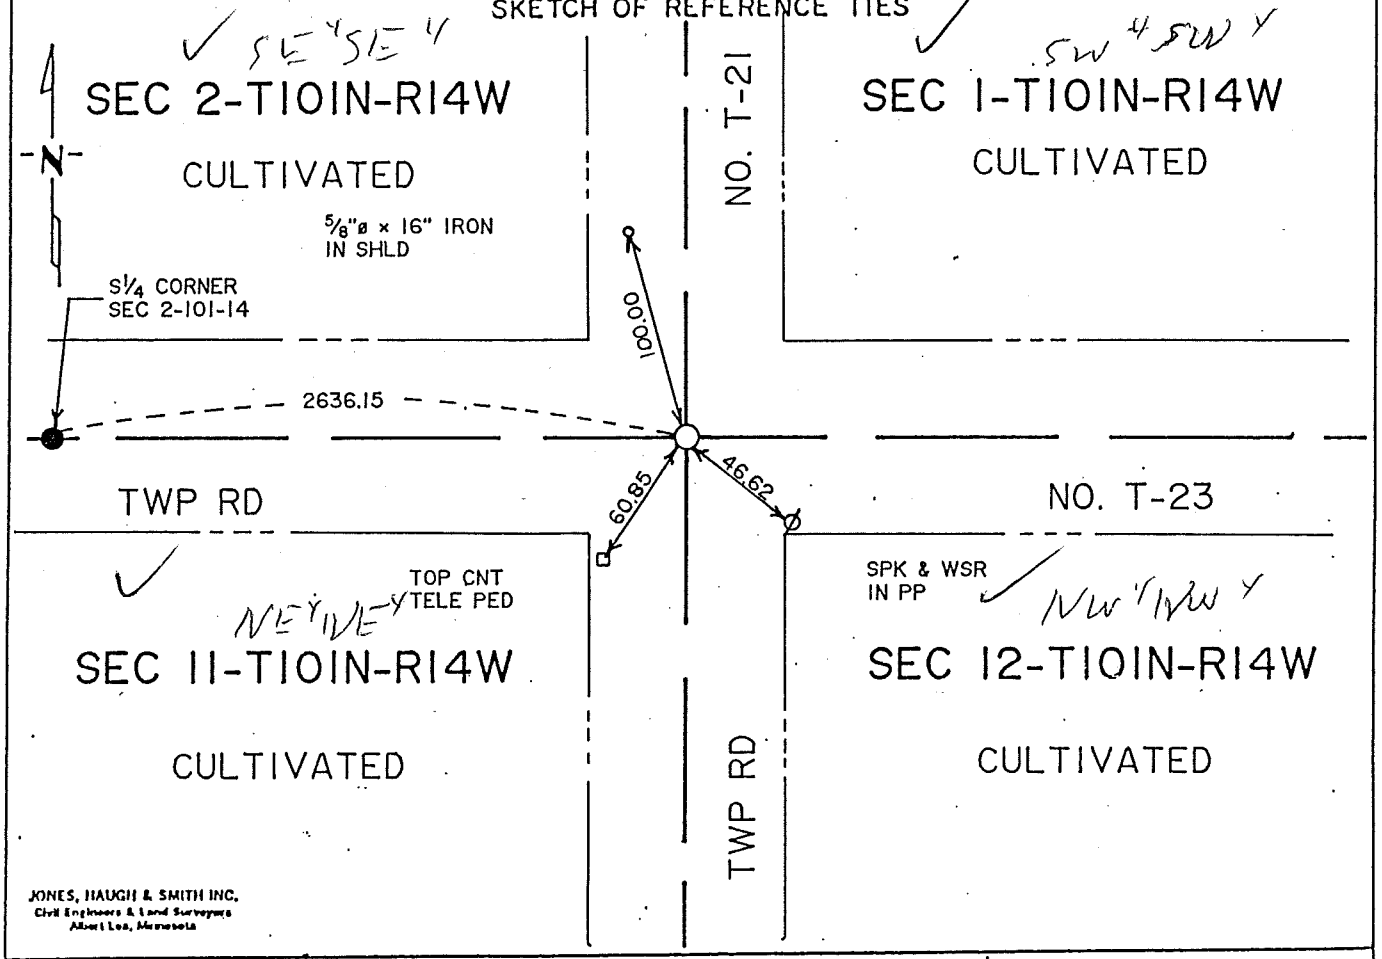

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE 7-23-93 DATE

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 11 A.M. on the 26 day of July A.D., 1993

COUNTY RECORDER Amanda Engan

By Marlene Martin, Deputy

DOCUMENT NO. 420195

Bk 80 Misc Pg 397

M.H.D. FORM NO. 2105 BOOK 81 PAGE 377

STATEMENT OF EVIDENCE

SE corner Section 2-101-14

This corner was originally established by Deputy Surveyor John Taylor of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

No information was obtained to support evidence of a perpetuation of the original public land survey corner.

1993 Jones, Haugh & Smith Inc crew under the direction of John Schulte, RLS 13807, dug with the County backhoe a 5'x12'x5' deep hole on the centerline centerline intersection of Township Road T-23 and T-21. We found a 6"x12'x16" deep concrete monument which rested at virgin soil depth and was on centerline centerline of said intersection. We continued digging to clay soil and found no other evidence. Therefore we reset concrete monument as found and set a 5/8" diameter x 16" iron capped RLS 13807 on the north side of monument and a cast iron monument near road surface above monument found.

The monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

BOOK 89 PAGE 378