Index No. "2" P24

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

W1/4 Corner of Section 34, Township 101N Range 14W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 2-4-93 (DATE) found a 5/8"ø IRON

■ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 2-4-93 (DATE) placed a LEFT MONUMENT AS FOUND

SKETCH OF REFERENCE TIES

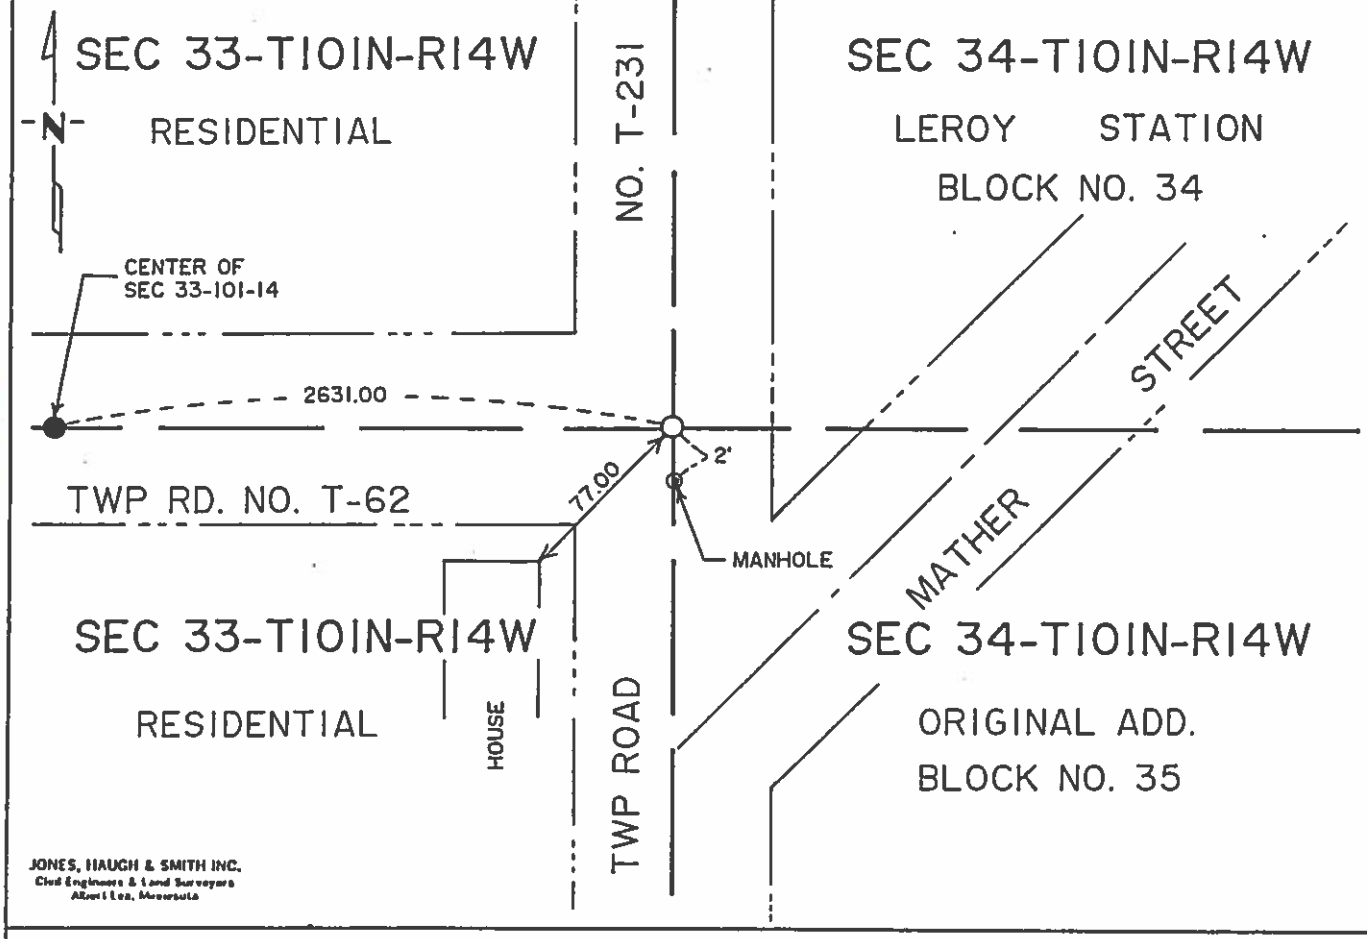

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE 2-22-93 DATE

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

W 1/4 corner Sec. 34-101-14

This corner was originally established by Deputy Surveyor John Taylor of the U.S. General Land Survey Office in 1854. The government notes show this corner was marked with a wood post, charred stake and a trench with a mound of earth. The following ties were taken:

6" Burr Oak	S 73 3/4° E	43 links	(28.38 feet)
6" Burr Oak	N 16 3/4° W	253 links	(166.98 feet)

The following were contacted for section corner information:
Mower County Engineering Department
Minnesota Department of Transportation

The following information was obtained to support evidence of a perpetuation of the original public land survey corner:
Plat of Original Town of LeRoy shows 1/4 corner inplace
Plat of Outlots in SE 1/4 NE 1/4 Sec 33-101-14 show 1/4 corner
Minnesota Department of Transportation Map Trunk Highway No. 56 shows monument inplace at 1/4 corner.

1980 Jones, Haugh & Smith crew found no evidence of public land survey corner or a perpetuation thereof. Dug with a backhoe on centerline centerline and uncovered a sanitary sewer manhole which would have destroyed any perpetuation of corner. Therefore used plat distances and Minnesota Department of Transportation measurements to establish position of 1/4 corner and set a 5/8" diameter iron.

1993 Jones, Haugh & Smith crew uncovered a 5/8" diameter iron two feet north of sanitary sewer manhole as set in 1980 and further measurements were taken to verify location of corner.

This monument fits occupation and road centerlines within the section and is accepted as best evidence of the original public land survey corner.

For electronic survey data and analysis contact the firm of Jones, Haugh & Smith Inc.