Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NW Corner of Section 3, Township 101 N, Range 15 W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☒ On 4-24-1991 (DATE) found a 8"ø x 16" LONG POINTED FIELD STONE WITH 2"ø WOOD POST ON SOUTH SIDE.

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 4-24-1991 (DATE) placed a CAST IRON MONUMENT OVER STONE.

SKETCH OF REFERENCE TIES

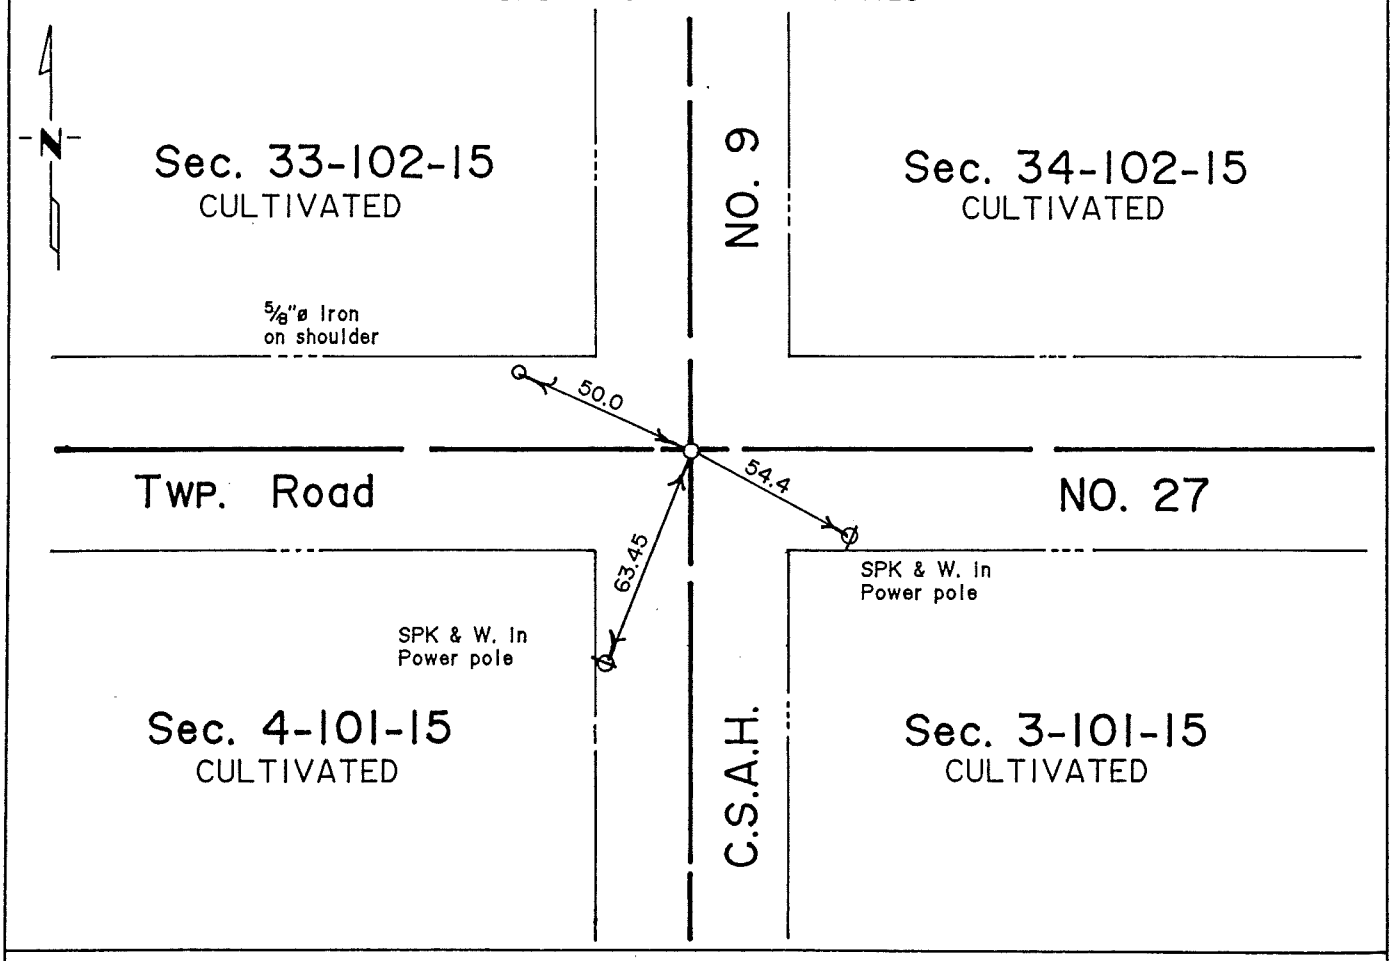

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ 5-16-91
SIGNATURE DATE

Registration No. 13807

☒ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19 ___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NW corner Sec 3-101-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Dept.
Mower County Recorder's Office
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1941 Book "A" of the Mower County Engineer's Office indicate a stone in place and the following ties were recorded:
41.0' NW to tele pole
37.5' NE to cor fence post
34.5' SE to cor fence post

1991 Jones, Haugh & Smith crew, under the direction of John H. Schulte IV, dug with County backhoe on centerline centerline of north-south-east-west roads for County State Aid Highway No. 9 grading project SAP 50-609-07. Uncovered a Harrison cast iron monument one foot below road surface. Continued digging and uncovered an 8"x16" pointed field stone 3 feet deep in virgin soil with a 2" square wood post on south side. Cast iron monument found was 1.0 feet north and 1.5 feet west of field stone. Placed a 5/8" diameter iron on south side of stone and set a cast iron monument over stone at road surface.

The monument found is in agreement with the record and fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.