Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NW Corner of Section 10, Township 101 N, Range 15 W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☒ On 4-24-1991 (DATE) found a 4"ø CHARRED POST ON SOUTH SIDE OF POINTED FIELD STONE.

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 4-24-1991 (DATE) placed a CAST IRON MONUMENT OVER POST ON ROAD SURFACE.

SKETCH OF REFERENCE TIES

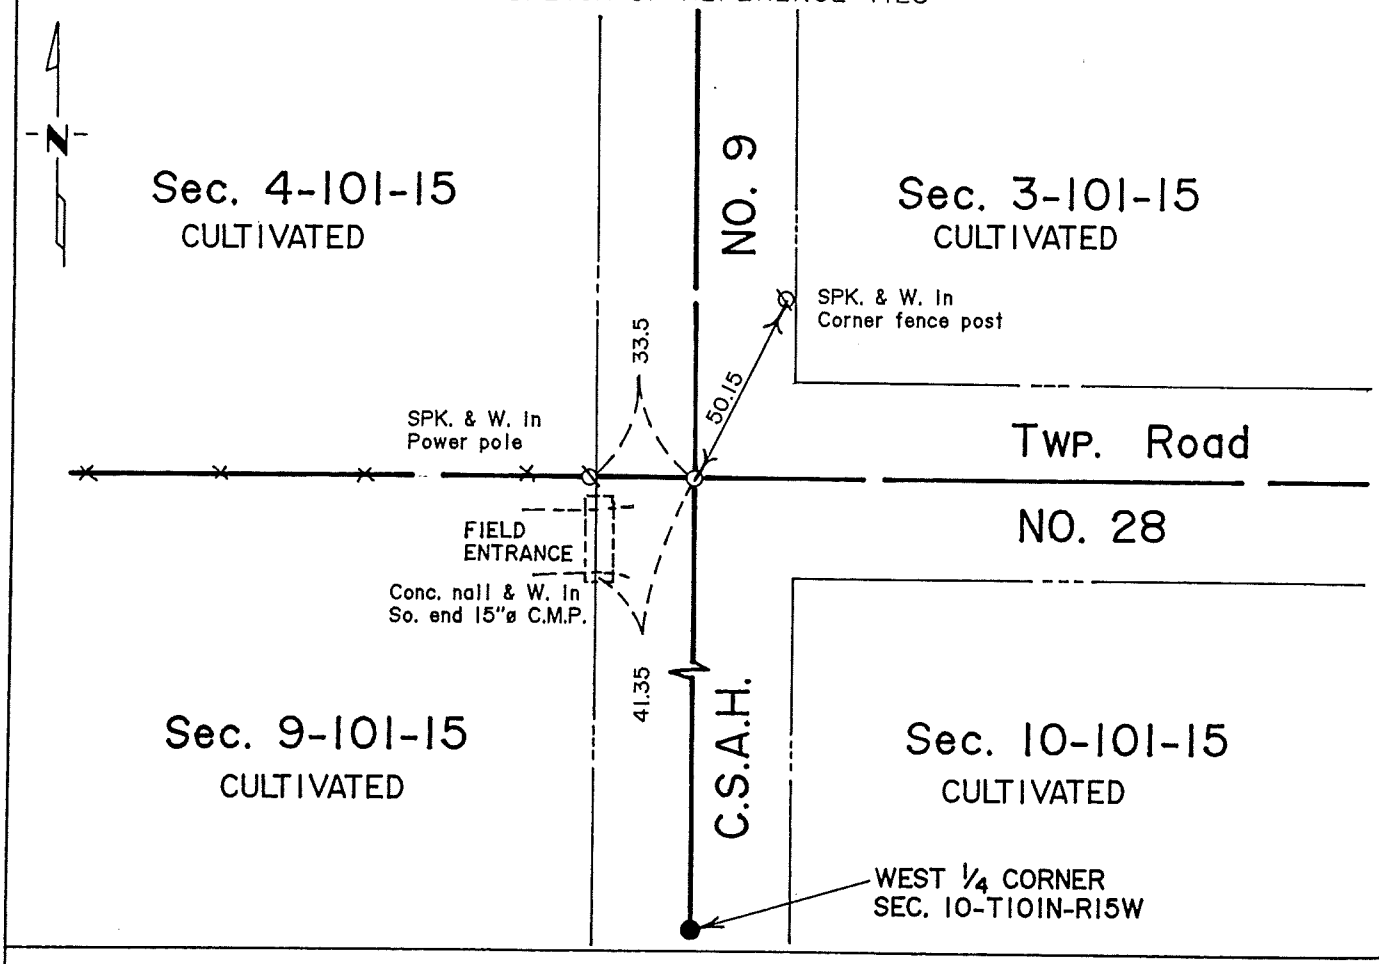

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 5-16-91

Registration No. 13807

☒ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NW corner Sec 10-101-15

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Dept.
Mower County Recorder's Office
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1941 Book "A" in the office of the Mower County Engineer's indicate a stone monument inplace and the following ties were recorded:
38.8' NE to cor fence post
48.0' SE to cor fence post
35.0' W to cor fence post

1991 Jones, Haugh & Smith crew, under the direction of John H. Schulte IV, dug with County backhoe on centerline centerline of north-south-east roads for County State Aid Highway No. 9 grading project SAP 50-609-07. Uncovered a Harrison cast iron monument lying flat 1.0 feet below road surface. Continued digging and found a 4" diameter charred post on south side of field stone 2 feet deep in virgin soil. Accepted post found as original public land survey corner. Placed a cast iron monument over post on south side of stone 1.0 feet below road surface.

The monument found is in agreement with past records and fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.