Index No. P106 "D" ✓

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

S1/4 Corner of Section 36, Township 102N Range 16W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 10-13-92 (DATE) found a NO EVIDENCE

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 10-13-92 (DATE) placed a CAST IRON MOUNUMENT

SKETCH OF REFERENCE TIES

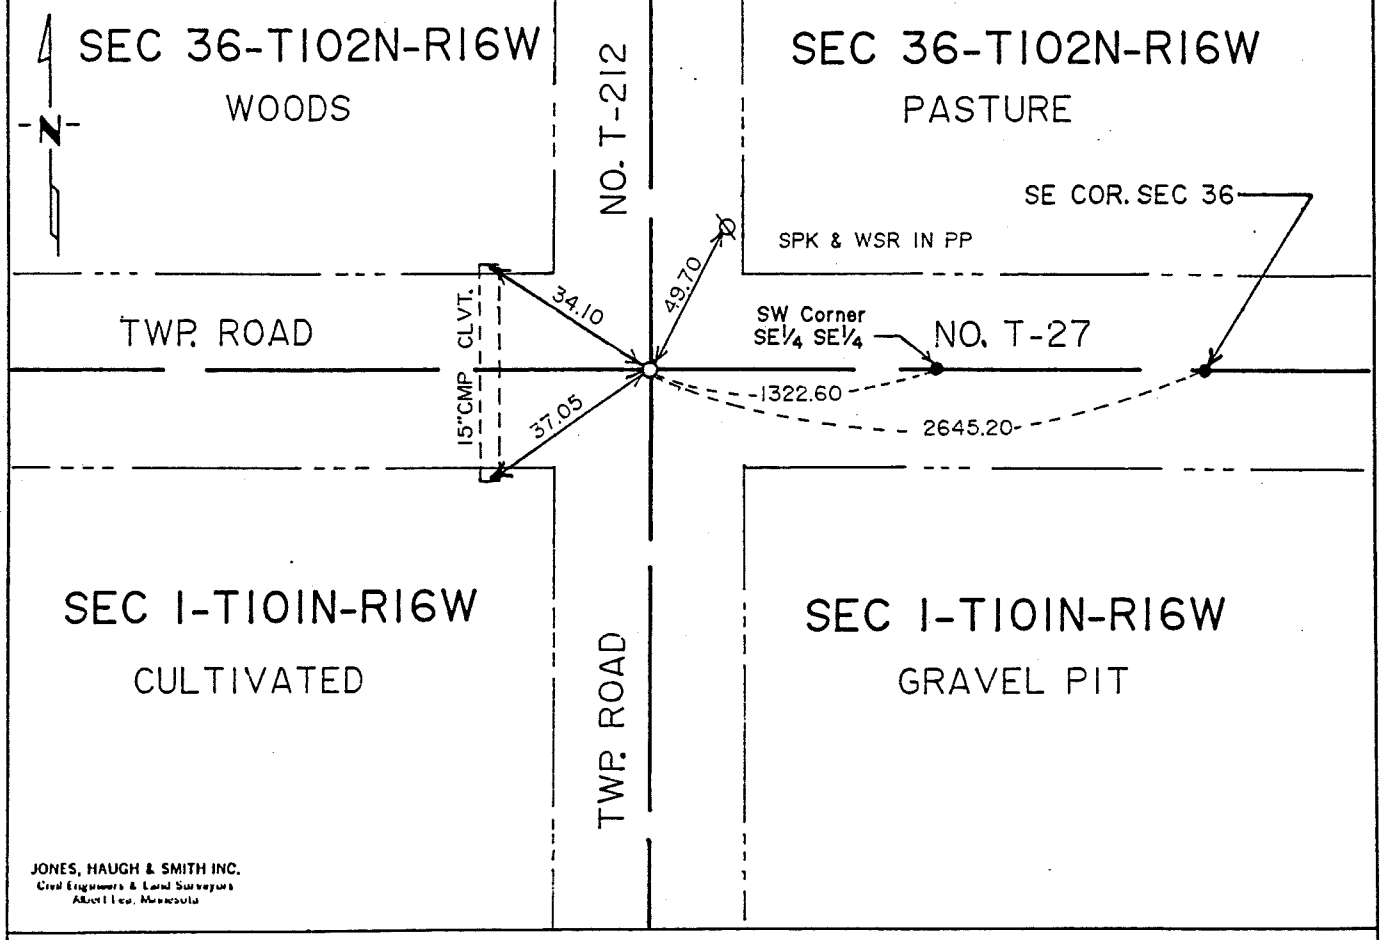

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE 12-16-92 DATE

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

S 1/4 corner Sec 36-102-16

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench. The following ties were taken:

10" Burr Oak	W 75° E	387 links (255.42 ft)
10" Burr Oak	S 70° E	550 links (363.00 ft)

The following were contacted for section corner information:
Mower County Highway Dept
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following evidence was obtained to support a perpetuation of the original public land survey corner.

1954 Book A in the Office of Mower County Highway Department indicates a concrete monument inplace and uncovered during a survey of the County Pit. The following ties were taken:
NW 76.8' to blazed 10" cottonwood
SW 32.0' to corner fence post
SE 62.0' to blazed 10" Oak

1992 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, dug with County backhoe on the centerline centerline of township roads and no evidence was found of a concrete monument or original public land survey corner. Therefore using information recorded from E.V. Carlson, Mower County Engineer, in Book A, the southwest corner of the SE 1/4 SE 1/4 of Section 36 was re-established using ties from 1954 records and upon digging the southeast corner of the section and the southwest corner of the SE 1/4 SE 1/4. The 1/4 corner was established at the doubled over distance on an extension of the south line of the SE 1/4 SE 1/4 of said Section 36.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.