Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

S1/4 Corner of Section 36, Township 101N Range 16W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 6-4-93 (DATE) found a 1/2"ø x 12" IRON 3/8"ø x 18" IRON 3/4"ø x 24" IRON 10"ø STONE AND A 5/8"ø x 18" IRON

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 6-4-93 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

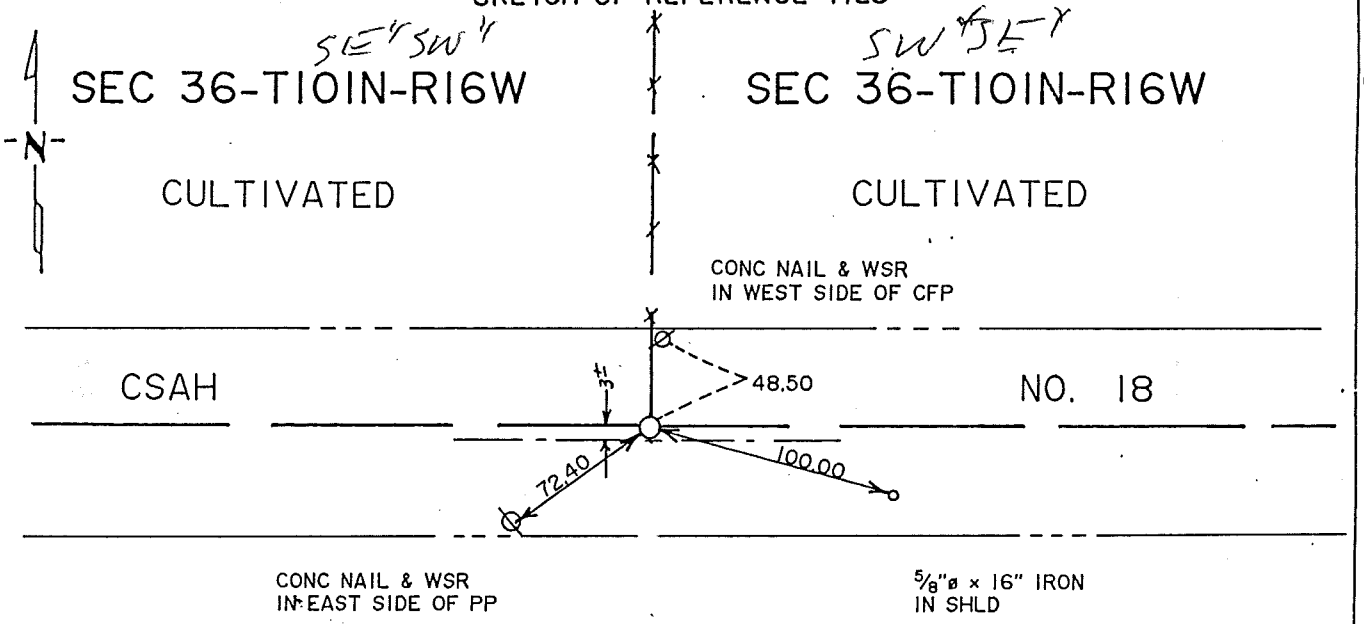

STATE OF IOWA

CULTIVATED

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 6-10-93

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 4 P.M. on the 24 day of June A.D., 19 93

COUNTY RECORDER Cynthia Enger

By Marlene Marten, Deputy

DOCUMENT NO. 421723

Pb 80 Mea Pg. 125

M.H.D. FORM NO. 2105 BOOK 80 PAGE 125

STATEMENT OF EVIDENCE

S 1/4 cor Sec 36-101-16

This corner was originally established by Deputy Surveyor Andrew Talcott of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of the perpetuation of the original public land survey corner.

1958 Mower County Highway Department Book 1 and the County Road Plans indicate a concrete monument inplace at this corner.

1993 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, RLS 13807, dug a 3'x5'x10' hole two feet north of the centerline of County State Aid Highway No. 18 and in line with fence running north. We found a 1/2" diameter x 12" iron at a depth of one foot and a 3/8" diameter x 18" iron two feet below. We continued digging and found a 3/4" diameter x 28" iron three feet down and a 10" diameter stone with a 5/8" diameter x 18" iron on north side of stone which rested at a depth of five feet which was into virgin soil. Pipes found above stone were one foot to 1.2 feet east or south of stone found. Therefore we accepted stone found and 5/8" diameter x 18" iron resting next to stone as the best perpetuation of the public land survey corner and left stone and iron inplace and set a cast iron monument near road surface above stone found.

The monument found and cast iron monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

BOOK 80 PAGE 126