Index No. _____

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SW Corner of Section 24, Township 101N, Range 17W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-13-91 (DATE) found a broken harrison monument over a large bridge spike over a 8"x14" pointed field stone.

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-13-91 (DATE) placed a 5/8"ø iron on West side of stone, cast iron monument over stone on road surface.

SKETCH OF REFERENCE TIES

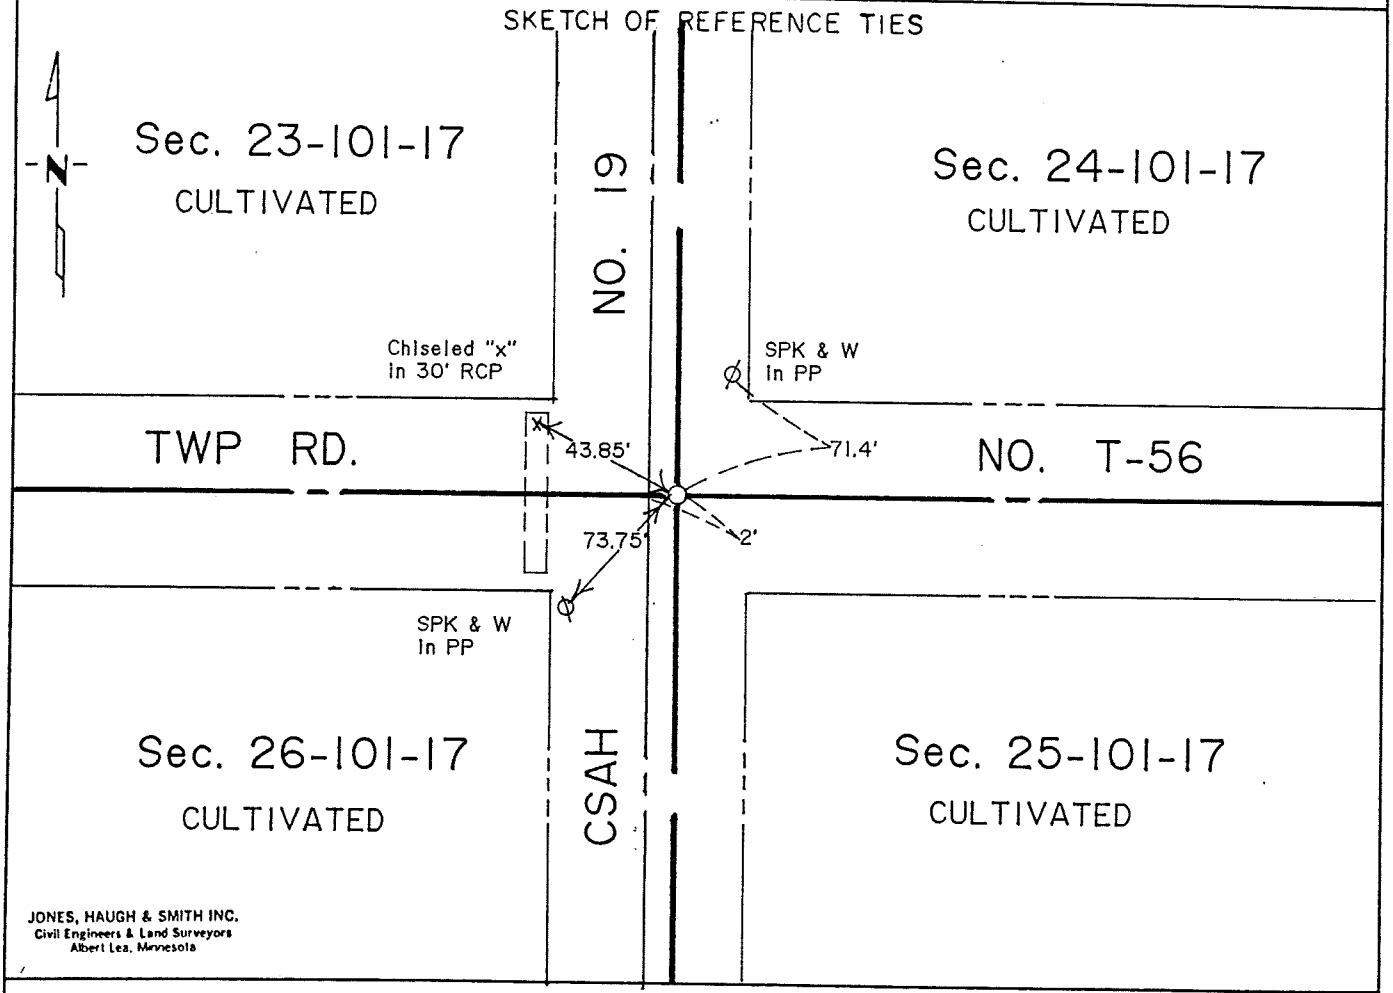


Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ SIGNATURE  5-16-91 DATE

Registration No. 13807

☑ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the ____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

SW corner Section 24-101-17

This corner was originally established by Deputy Surveyor Edward Fitzpatrick of the U.S. General Land Office in 1854. The government notes show a wood post and a charred stake were set with a mound of earth and trench.

The following were contacted for section corner information:

Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

1888 Clausen, Mower County Surveyor 1880-1892, notes show a government corner inplace.

Book "A" in the Mower County Engineers Office shows the corner located. The following ties were taken:

63.2' SE to T.P.
53.6' NE to P.P.
63.2' SW to West gate post
77.0' NE to SE corner school barn

1991 Jones, Haugh and Smith Inc crew, under the direction of John H. Schulte, dug with the county backhoe on centerline centerline of N-S-E-W roads for bituminous overlay project SAP 50-619-14. Excavated a 4' x 8' x 5' deep hole and uncovered a broken harrison monument 2.0' deep. Continued digging and uncovered a large bridge spike over a 8" x 14" pointed field stone 4.0' below road surface in virgin soil. Placed a 5/8" diameter iron on West side of the stone and a cast iron monument on the road surface over the stone found.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.