Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NE Corner of Section 13, Township 102 N Range 14 W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☒ On 4-25-1991 (DATE) found a 5"ø ROTTED WOOD POST.

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 4-25-1991 (DATE) placed a 5/8"ø x 18" IRON IN WOOD POST, PLACED CAST IRON MONUMENT OVER WOOD POST AT ROAD SURFACE.

SKETCH OF REFERENCE TIES

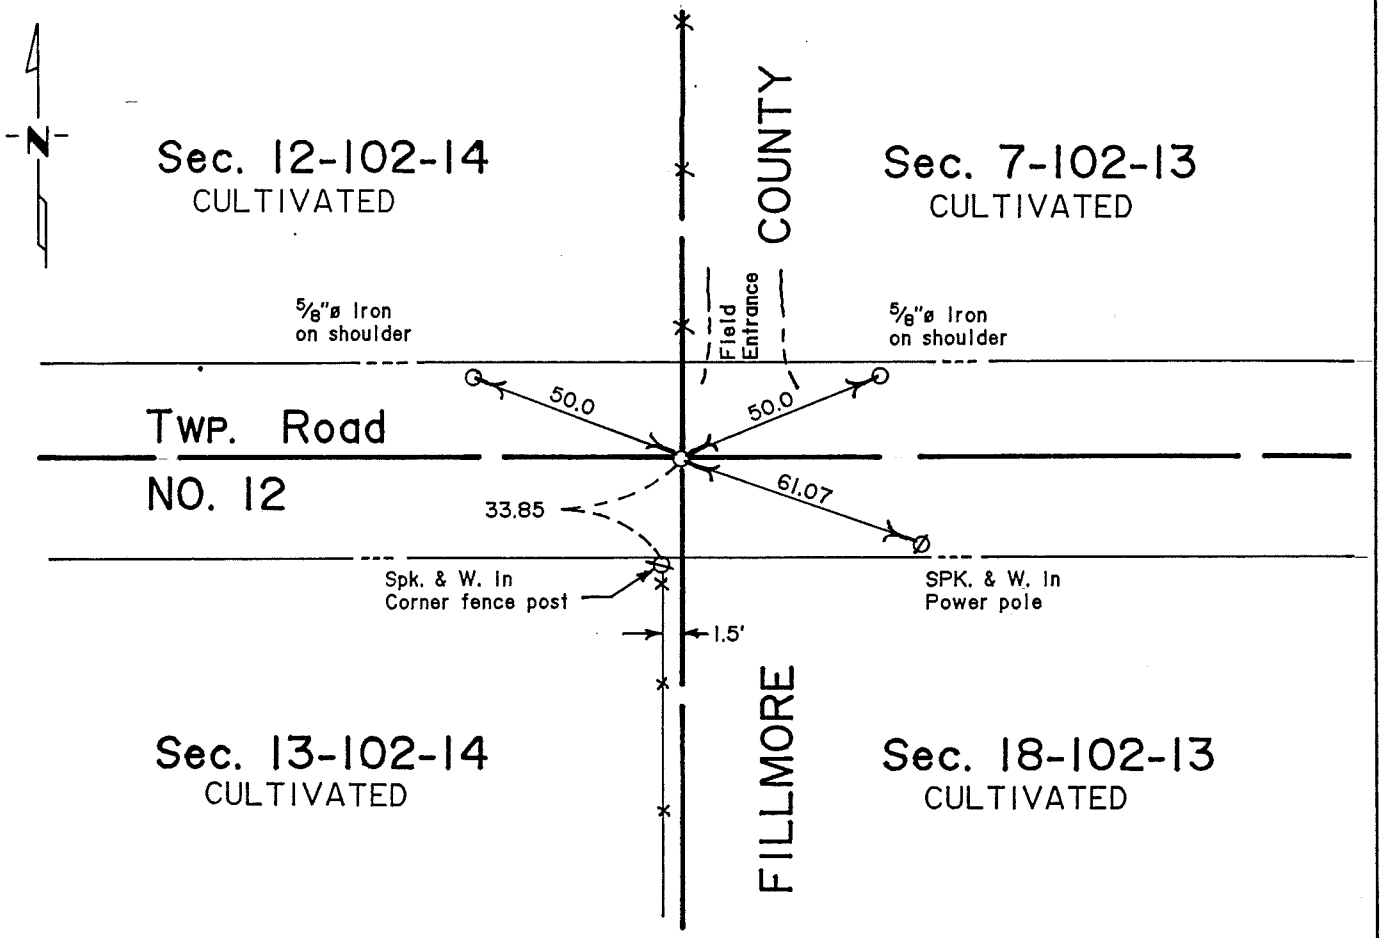

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 5-6-91

Registration No. 13807

☒ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NE corner Sec 13-102-14

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set and a handful of small stones with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Dept.
Mower County Recorder's Office
Zenk Engineering
Tucker Land Surveying

No information was obtained to support evidence of a perpetuation of the public land survey corner.

1991 Jones, Haugh & Smith crew, under the direction of John H. Schulte IV, dug with County backhoe on centerline of east-west road and fence line north for Bridge Survey #L4983. Dug a 6'x5'x3' deep hole and uncovered a 5" diameter rotted wood post 3 feet below road surface in virgin soil. Accepted post as original public land survey corner or perpetuation thereof. Placed a 5/8" diameter iron in remains of post and set cast iron monument over post on road surface 0.5 feet deep.

The monument found fits occupation lines, fence lines and road centerlines within the section and is accepted as best evidence of the original public land survey corner.