Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 6, Township 102N Range 16W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 9-17-92 (DATE) found a 6"Ø CONCRETE MOUNUMENT WITH ½"ø IRON CAST IN CENTER

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 9-17-92 (DATE) placed a CAST IRON MOUNUMENT

SKETCH OF REFERENCE TIES

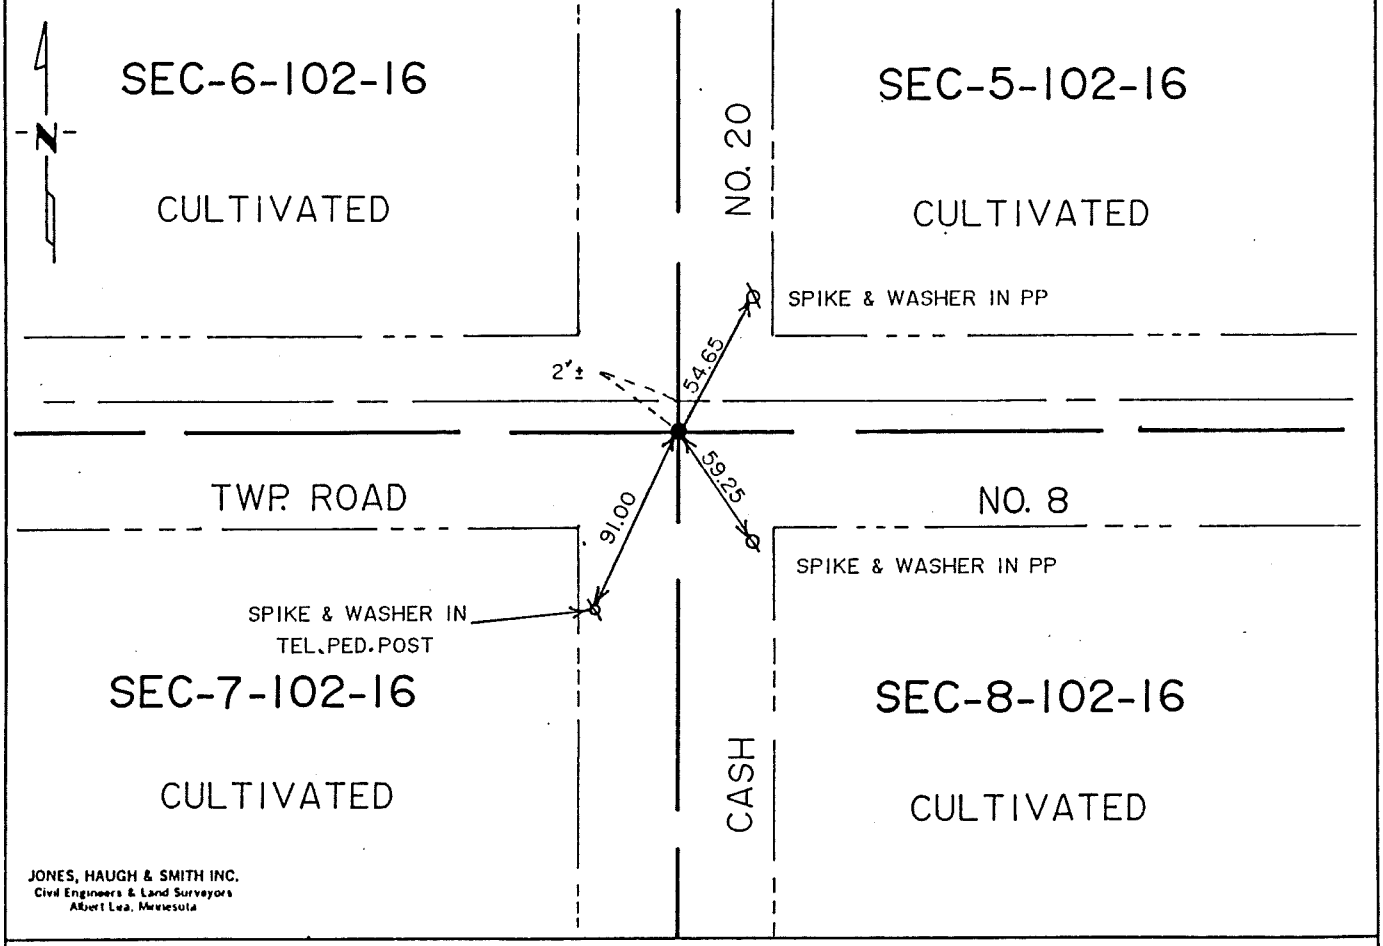

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

[signature] 12-16-92
SIGNATURE DATE

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

SE corner Sec 6-102-16

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Dept
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following evidence was obtained to support a perpetuation of the original public land survey corner.

1891 Clausen notes indicate a stone monument inplace at the southwest corner of Section 5-102-16.

1956 Book A in the office of Mower County Highway Department indicates a concrete monument inplace at the intersection of CSAH No. 20 and Township Road No. 8. The following ties were taken:
38.4' SE to PP
39.8' NE to PP
37.3' NW to PP
45.7' SW to CFP

1992 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, dug with County backhoe on centerline centerline of CSAH No. 20 and Township Road No. 8 and uncovered a 6" diameter concrete monument with 1/2" diameter iron cast in center, two feet below road surface in virgin soil. Set cast iron monument over concrete monument one inch under road surface. The monument found was two feet more or less, south of the centerline of the traveled way of Township Road No. 8.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.