Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

W1/4 Corner of Section 30, Township 102N, Range 17W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-9-91 (DATE) found a 3/4"Øx30" long rebar with a 2"sq. wood post on West side of iron in a nest of 5 small stones 3' deep in old road grade.

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-9-91 (DATE) placed a cast iron monument on road surface at location of iron found.

SKETCH OF REFERENCE TIES

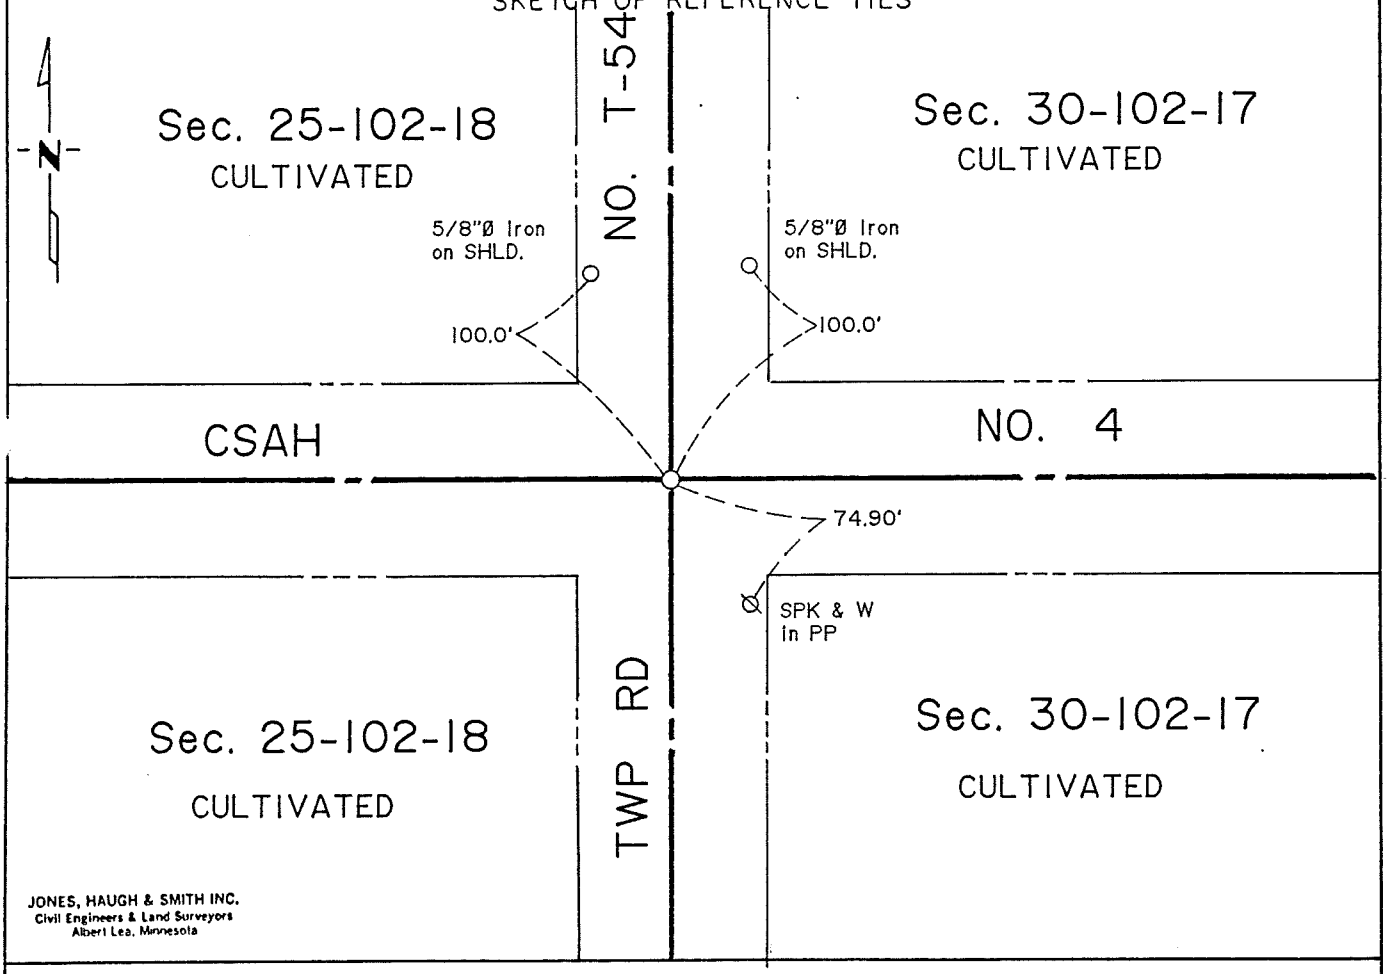

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 5-16-91

Registration No. 13807

☑ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

W 1/4 corner Section 30-102-17

This corner was originally established by Deputy Surveyor William I. Anderson of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench. The following ties were taken:

12" Burr Oak S 1° E 46 links (30.36 ft)
10" Burr Oak N 75° W 14 links (9.24 ft)

The following were contacted for section information:

Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner:

1888 Clausen, Mower County Surveyor from 1880-1892, field notes show government post inplace and chaining notes are given.

1930 Book "A" in the Mower County Engineering Office shows a stone inplace at Sta. 53+10.5. The following ties were taken:

55.6' SW to blaze in 3rd fence post
31.3' SE to "X" in West end concrete headwall
57.0' NE to brace pole
59.1' NW to highline pole

1972 Jones, Haugh & Smith Inc crew placed a 5/8" diameter iron on centerline centerline of N-S-E-W roads and the following ties were taken:

Concrete nail & W FCP NE 63.85'
Concrete nail & W PP NW 63.9'
Concrete nail & W PP SE 47.0'
Concrete nail & W PP SW 45.05'

1973 Book "A" shows inplace a 5/8" diameter rod 0.2' deep on centerline centerline of N-S-E-W roads. Ties were checked and remain intact.

1991 Jones, Haugh & Smith Inc crew, under the direction of John H. Schulte, dug with the County backhoe on centerline centerline of N-S-E-W roads for bituminous overlay project SAP 50-604-18. Dug a 5' x 12' x 6' deep hole and uncovered a 3/4" diameter x 30" long rebar with a 2" square wood post on the West side of iron in a nest of 5 small stones 3' deep in old road grade. Continued digging and found no further evidence of PLS corner or a perpetuation thereof. Placed a cast iron monument on road surface at the same location of the iron found.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.