Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 12, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-27-93 (DATE) found a 1"ø x 16" PIPE AND A 6"ø x 18" CONC MONUMENT WITH IRON IN CENTER

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-27-93 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

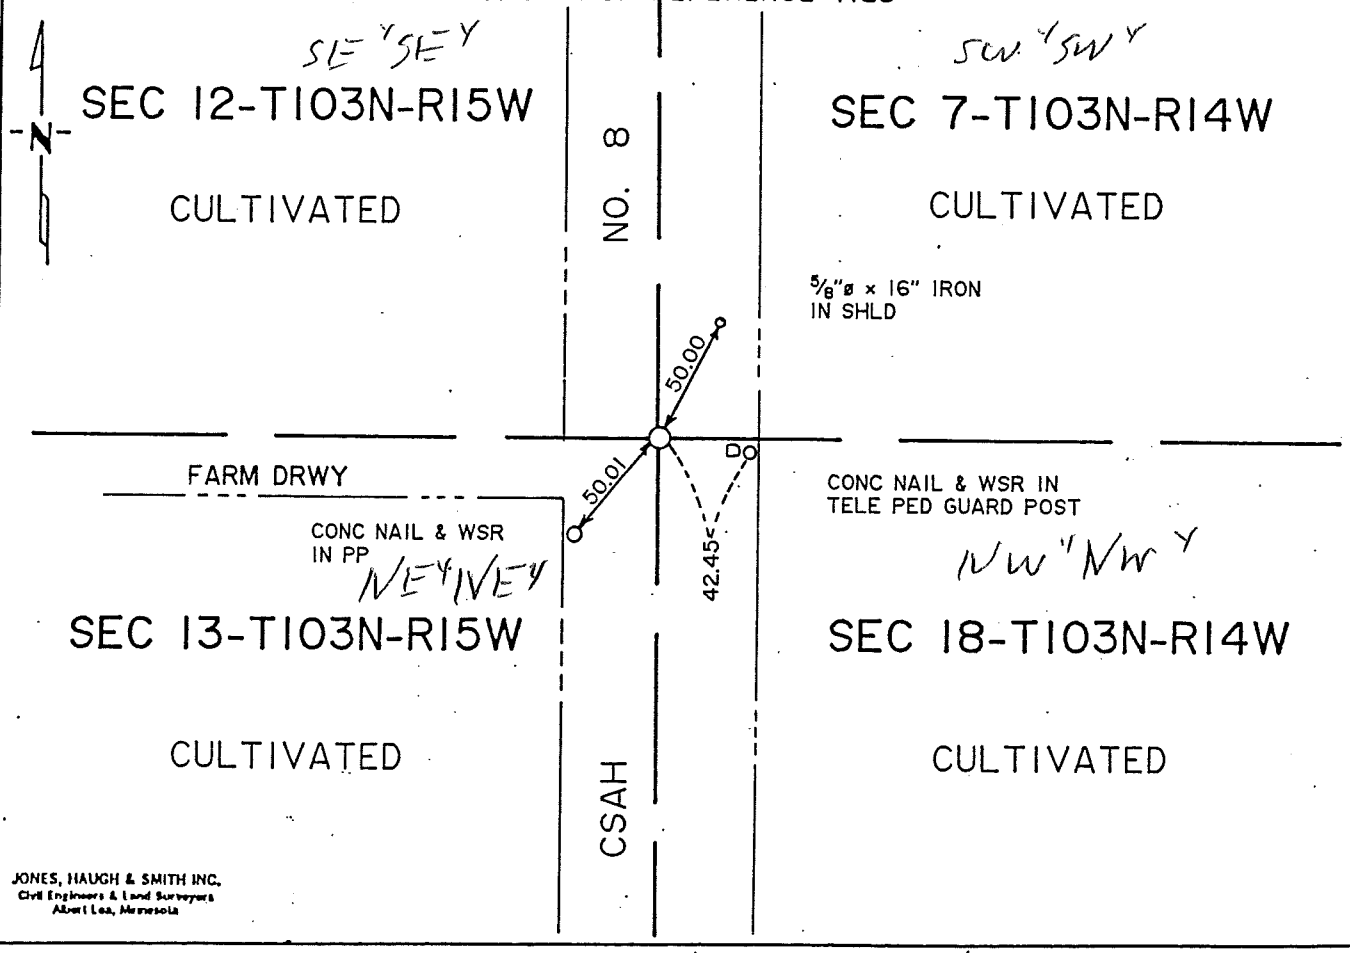

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 6-11-93

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 10 A.M. on the 21 day of June A.D., 19 93

COUNTY RECORDER Chandra Conger

By Marlene Martin, Deputy

DOCUMENT NO. 421593

Bk 79 Misc Pg. 590

M.H.D. FORM NO. 2105

BOOK 79 PAGE 590

STATEMENT OF EVIDENCE

SE cor Sec 12-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of the perpetuation of the original public land survey corner.

1887 Clausen, Mower County Surveyor, notes indicate that there was a government post at this corner.

1938 Mower County Road Plans for County State Aid Highway No. 8 indicate a concrete monument inplace at this corner.

1945 Mower County Highway Dept Book 1 indicates a concrete monument inplace at this corner.

1993 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, RLS 13807, dug a 3'x3'x6' hole on centerline of County State Aid Highway No. 8 and in line with fence going east. We found a 1" diameter x 16" pipe 1.5 feet below road surface. Continued digging to a depth of three feet and found a 6" diameter x 18" concrete monument with an iron in center. The monuments found are in agreement with the records. Therefore we accepted monuments found as the perpetuation of the original public land survey corner and set a cast iron monument near road surface above concrete monument found.

The monument found and cast iron monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

BOOK 79 PAGE 591

Revised

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 12, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-27-93 (DATE) found a 1"ø x 16" PIPE AND A 6"ø x 18" CONC MONUMENT WITH IRON IN CENTER

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-27-93 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

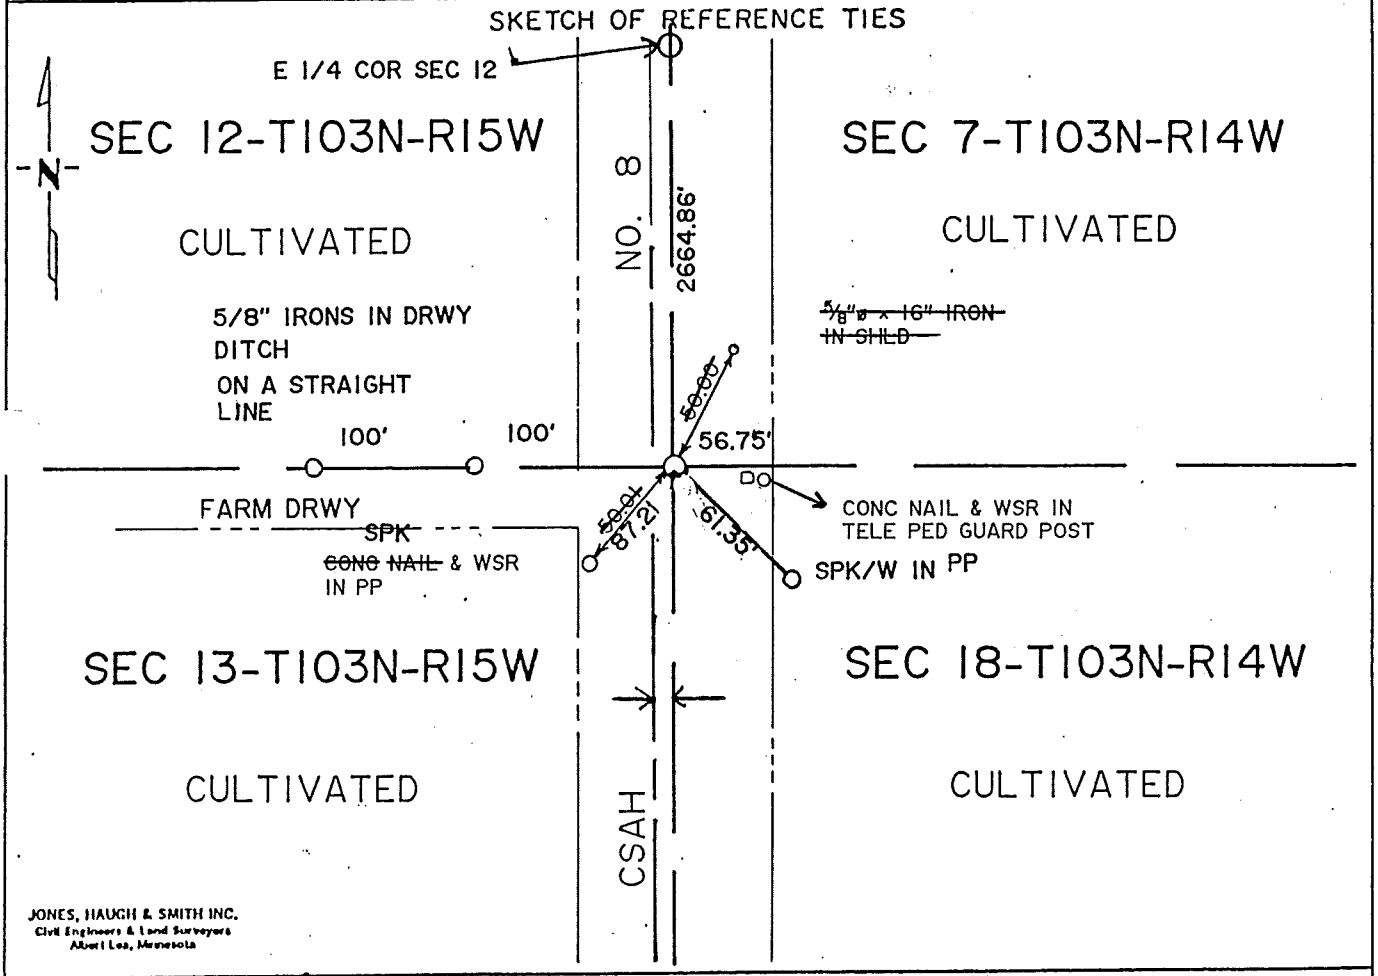

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ SIGNATURE _____ DATE

Registration No. _____

☐ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

MLD FORM NO. 2105

STATEMENT OF EVIDENCE

SE cor Sec 12-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of the perpetuation of the original public land survey corner.

1887 Clausen, Mower County Surveyor, notes indicate that there was a government post at this corner.

1938 Mower County Road Plans for County State Aid Highway No. 8 indicate a concrete monument inplace at this corner.

1945 Mower County Highway Dept Book 1 indicates a concrete monument inplace at this corner.

1993 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, RLS 13807, dug a 3'x3'x6' hole on centerline of County State Aid Highway No. 8 and in line with fence going east. We found a 1" diameter x 16" pipe 1.5 feet below road surface. Continued digging to a depth of three feet and found a 6" diameter x 18" concrete monument with an iron in center. The monuments found are in agreement with the records. Therefore we accepted monuments found as the perpetuation of the original public land survey corner and set a cast iron monument near road surface above concrete monument found.

The monument found and cast iron monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.