Revised

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E1/4 Corner of Section 1, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-27-93 (DATE) found a NOTHING!

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 6-30-93 (DATE) placed a 5/8"ø x 16" IRON

SKETCH OF REFERENCE TIES

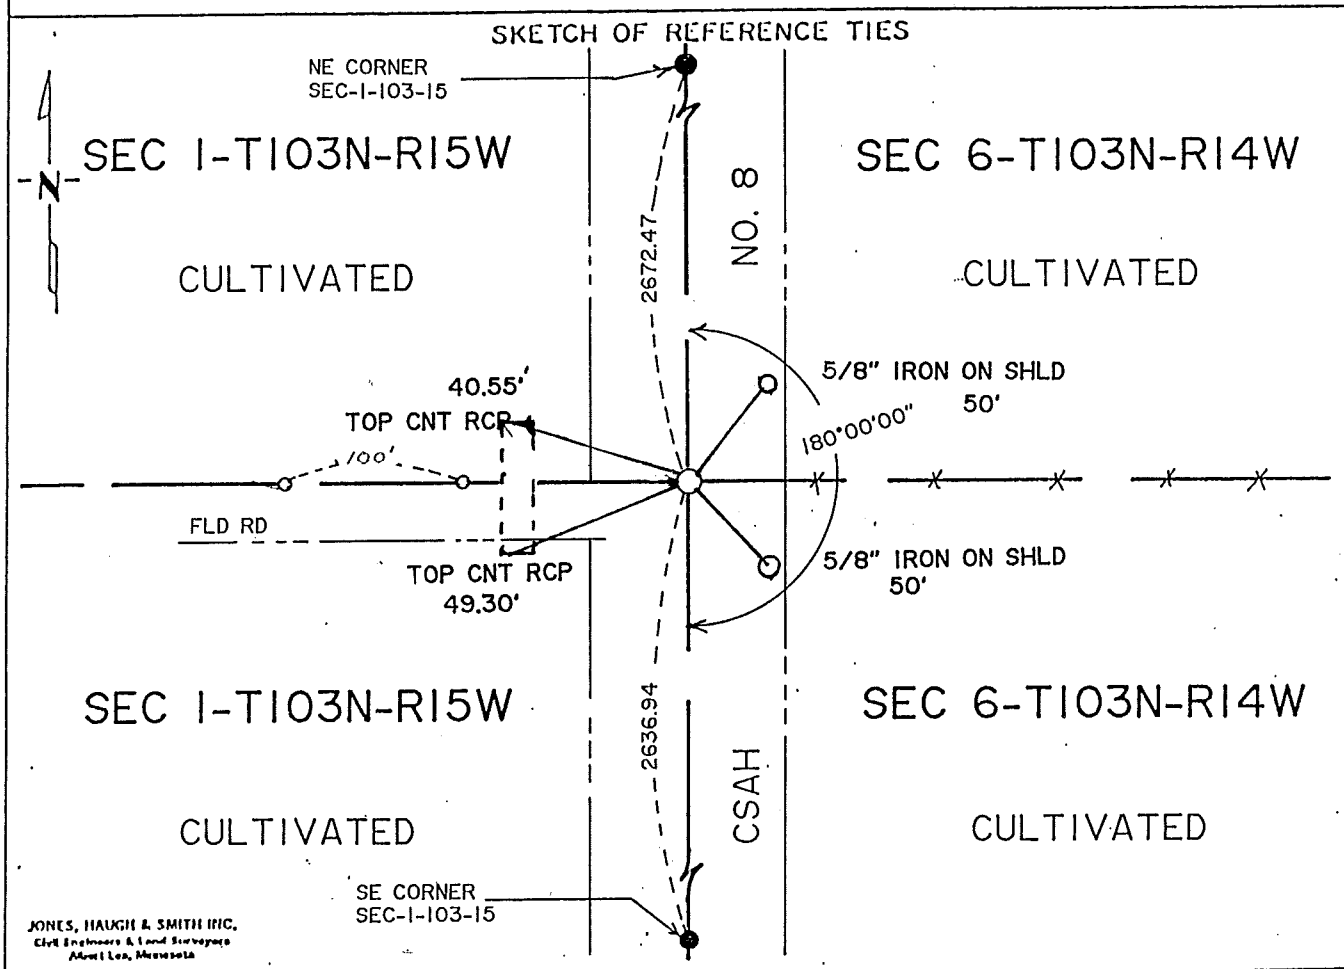

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ _____
SIGNATURE DATE

Registration No. _____

☐ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

E 1/4 corner Section 1-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1889 Clausen, Mower County Surveyor, notes indicate a government post at this corner.

1993 Jones, Haugh & Smith Inc crew under the direction of John Schulte, RLS 13807, dug a 3'x5'x6' long hole with county backhoe on centerline of County State Aid Highway No. 8 and inline with fence running east and field road running west. We found no evidence of a perpetuation of the original public land survey corner or original corner. Therefore we set a 5/8" diameter x 16" iron on a straight line between the northeast corner and southeast corner of Section 1 and inline with fence running east and field road running west, as shown on 1945 Grading Plans.

The monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

N 1/4 Corner of Section 1, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 07/26/2004 (DATE) found a TWO 12"X3/4" SQUARE IRONS

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On – (DATE) placed a 5/8"X16" REBAR WITH CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

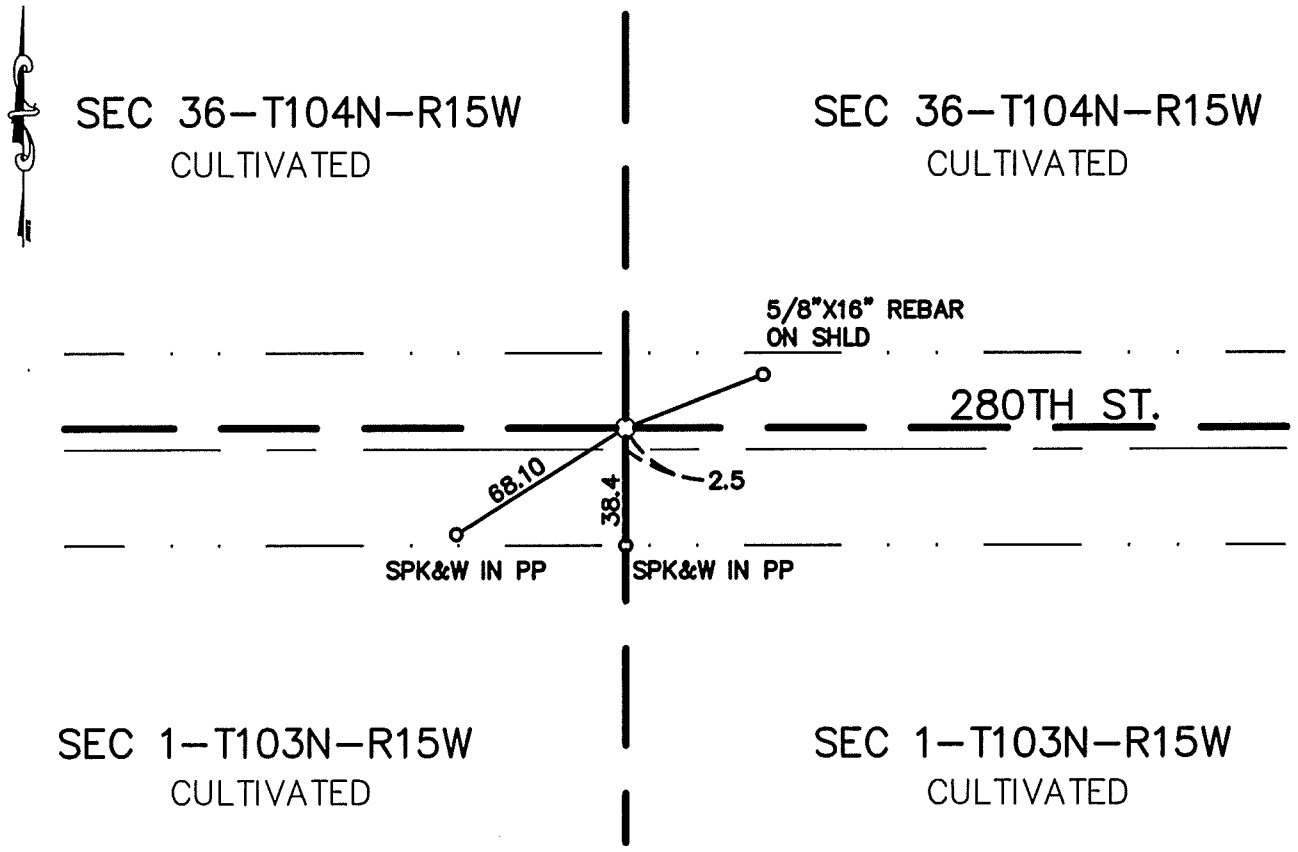

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

_____ 8-30-04
SIGNATURE DATE

Registration No. 13807

☒ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 20___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

N 1/4 Corner Section 1-T103N-R15W

Deputy Surveyor John Ball of the U.S. General Land Office originally established this corner in 1853 . The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Department
Mower County Recorder
Tucker Land Surveying

2004 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug with Boe Brothers backhoe at centerline of township road east-west and in line with line fence south, and uncovered a long square iron 1.5' below old road bed. Continued digging and found another long square iron 2.5' below old road bed. Placed a 5/8"x16" rebar capped #13807 on the north side of irons found. Placed a 5/8"x16" rebar with cast iron monument above 0.6' below road surface.

The monument is in agreement with the record and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E 1/4 Corner of Section 1, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-27-93 (DATE) found a NOTHING

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 6-30-93 (DATE) placed a 5/8"ø x 16" IRON

SKETCH OF REFERENCE TIES

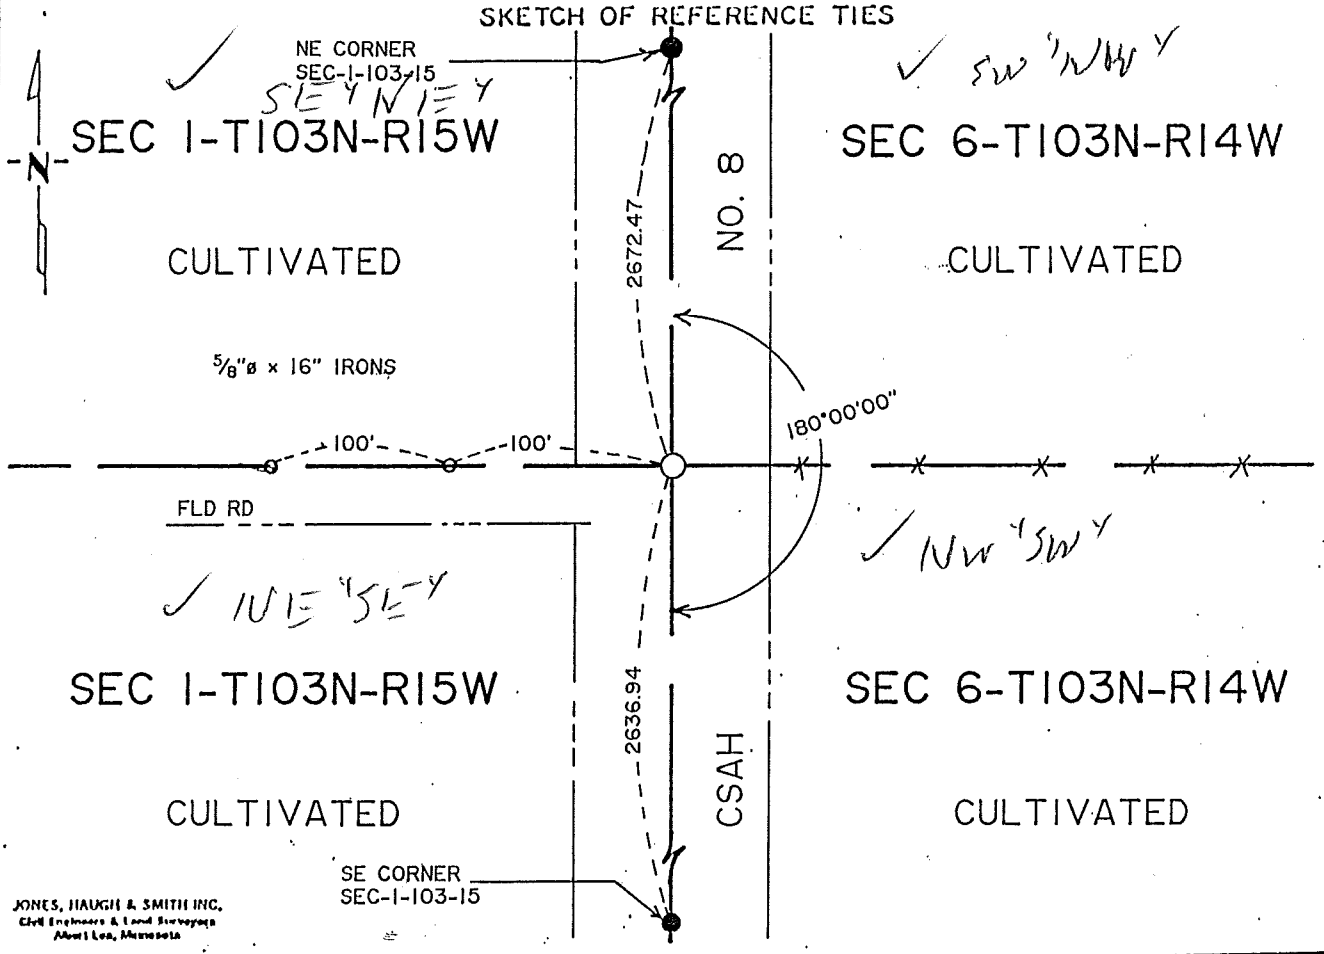

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 7-13-93

Registration No. 13907

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 2:10 P.M. on the 14 day of July A.D., 1993

COUNTY RECORDER Chandler Engan

By Marlene Martin, Deputy

DOCUMENT NO. 422833

By 80 Misc Pg. 309

M.H.D. FORM NO. 2105

BOOK 80 PAGE 309

STATEMENT OF EVIDENCE

E 1/4 corner Section 1-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1889 Clausen, Mower County Surveyor, notes indicate a government post at this corner.

1993 Jones, Haugh & Smith Inc crew under the direction of John Schulte, RLS 13807, dug a 3'x5'x6' long hole with county backhoe on centerline of County State Aid Highway No. 8 and inline with fence running east and field road running west. We found no evidence of a perpetuation of the original public land survey corner or original corner. Therefore we set a 5/8" diameter x 16" iron on a straight line between the northeast corner and southeast corner of Section 1 and inline with fence running east and field road running west, as shown on 1945 Grading Plans.

The monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

BOOK 80 PAGE 310

Revised

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NE Corner of Section 1, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-27-93 (DATE) found a 6"ø x 18" CONC MONUMENT WITH IRON IN CNT

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-27-93 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

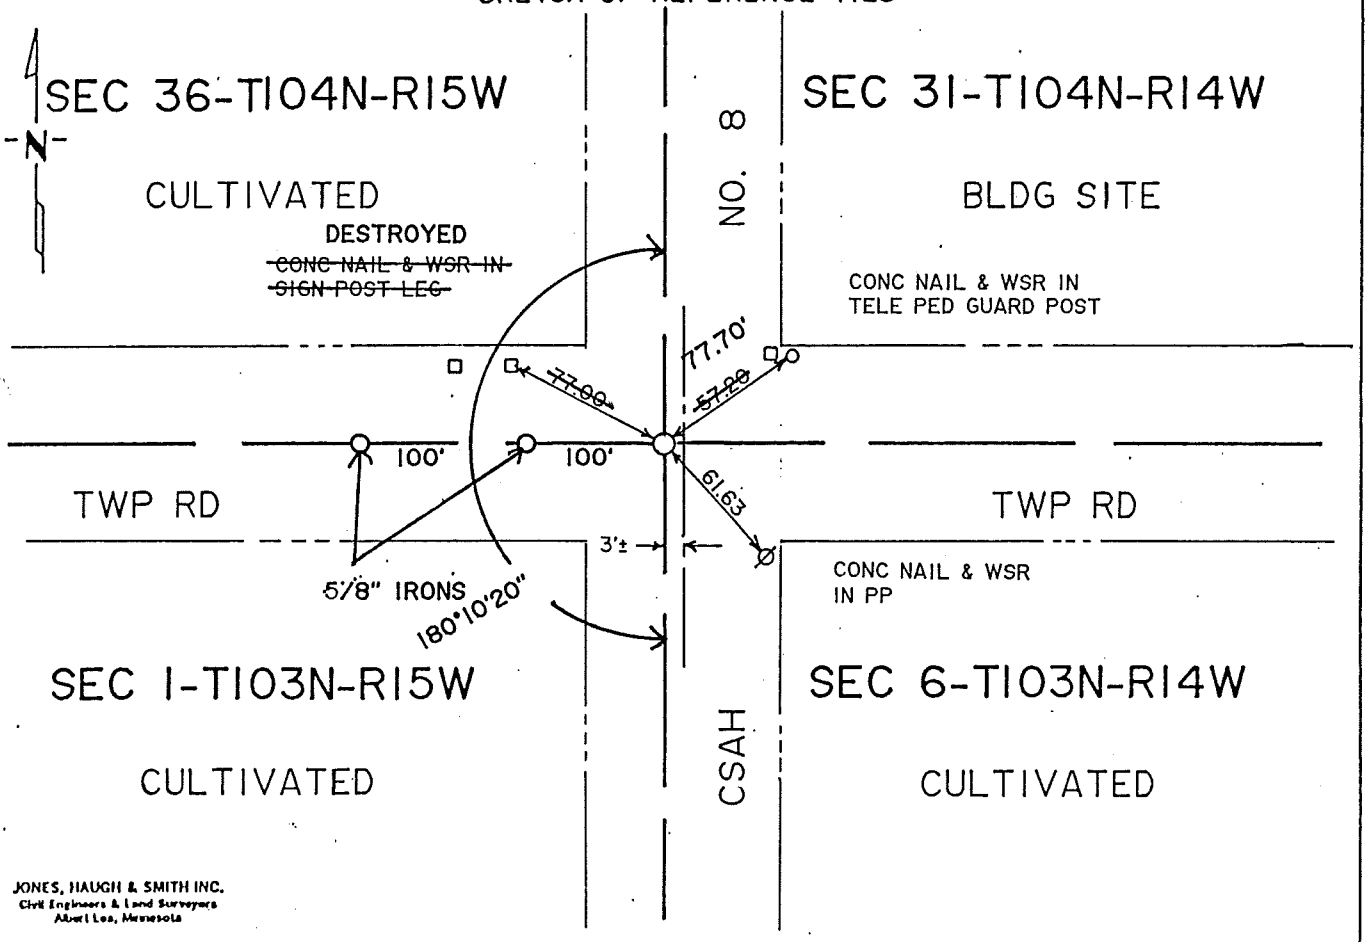

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ SIGNATURE _____ DATE

Registration No. _____

☐ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19 ___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

STATEMENT OF EVIDENCE

NE cor Sec 1-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of the perpetuation of the original public land survey corner.

1938 Mower County Road Plans for County State Aid Highway No. 8 indicate a concrete monument inplace at this corner.

1993 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, RLS 13807, dug a 4'x3'x6' hole on centerline of east-west township road and three feet west of centerline of County State Aid Highway No. 8. We found a 6" diameter x 18" concrete monument with an iron in center at a depth of one foot, which is in agreement with the records. Therefore we accepted the concrete monument found as the perpetuation of the original public land survey corner and set a cast iron monument near road surface above the monument found.

The monument found and cast iron monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NE Corner of Section 1, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-27-93 (DATE) found a 6"ø x 18" CONC MONUMENT WITH IRON IN CNT

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-27-93 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

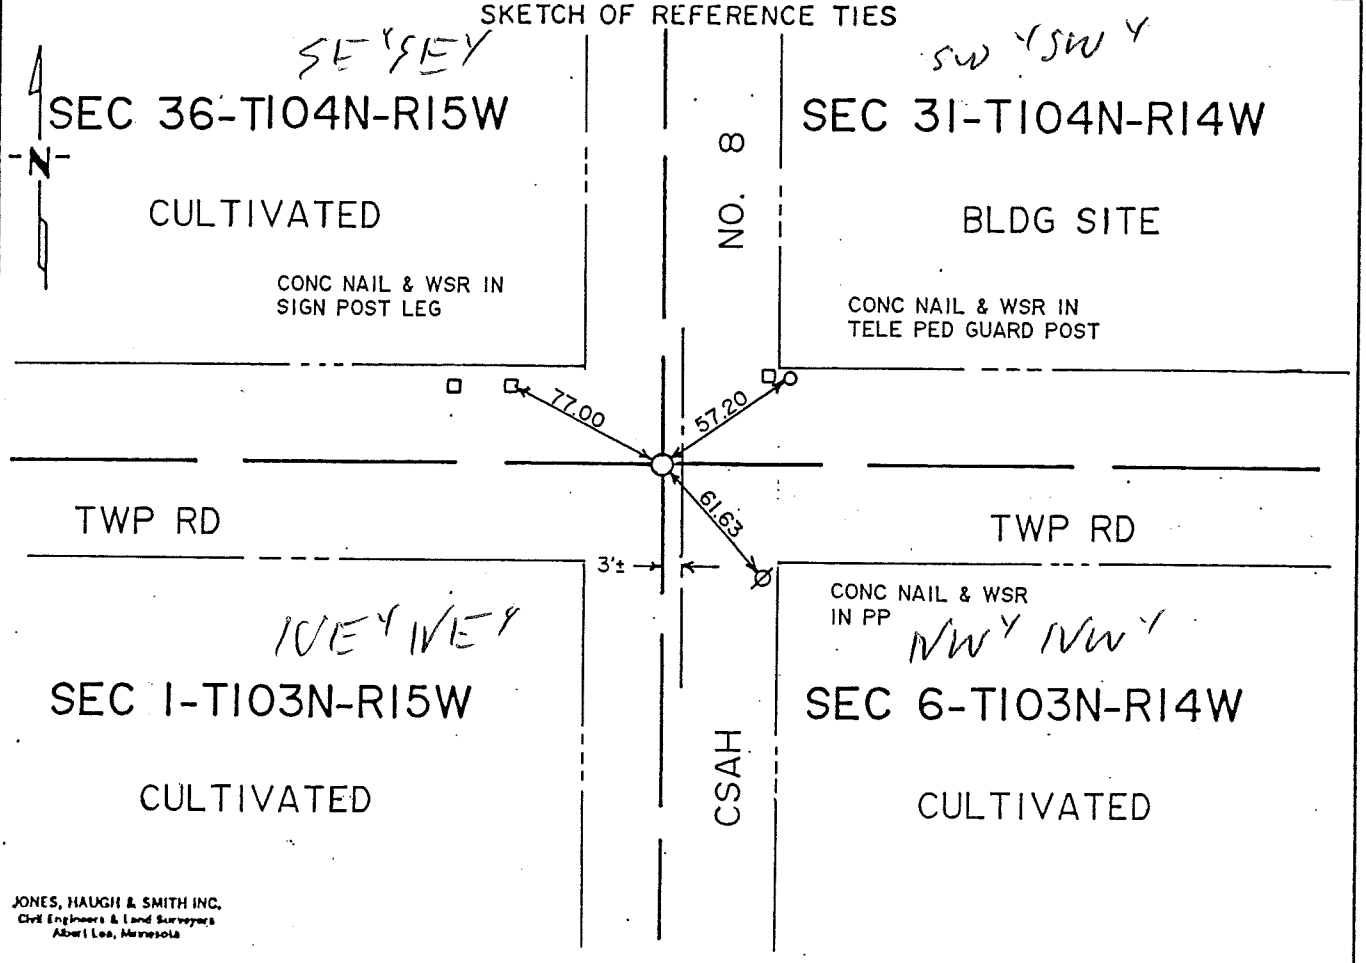

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

[signature] 6-11-93
SIGNATURE DATE

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 10 A .M. on the 21 day of June A.D., 19 93

COUNTY RECORDER Amanda Conger

By Marlene Marten, Deputy

DOCUMENT NO. 421592

Bk 79 Misc p. 586

M.H.D. FORM NO. 2105

BOOK 79 PAGE 588

STATEMENT OF EVIDENCE

NE cor Sec 1-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of the perpetuation of the original public land survey corner.

1938 Mower County Road Plans for County State Aid Highway No. 8 indicate a concrete monument inplace at this corner.

1993 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, RLS 13807, dug a 4'x3'x6' hole on centerline of east-west township road and three feet west of centerline of County State Aid Highway No. 8. We found a 6" diameter x 18" concrete monument with an iron in center at a depth of one foot, which is in agreement with the records. Therefore we accepted the concrete monument found as the perpetuation of the original public land survey corner and set a cast iron monument near road surface above the monument found.

The monument found and cast iron monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

BOOK 79 PAGE 589

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NE Corner of Section 2, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 07/26/2004 (DATE) found a FIELD STONE

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 07/26/2004 (DATE) placed a 5/8"X16" REBAR WITH CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

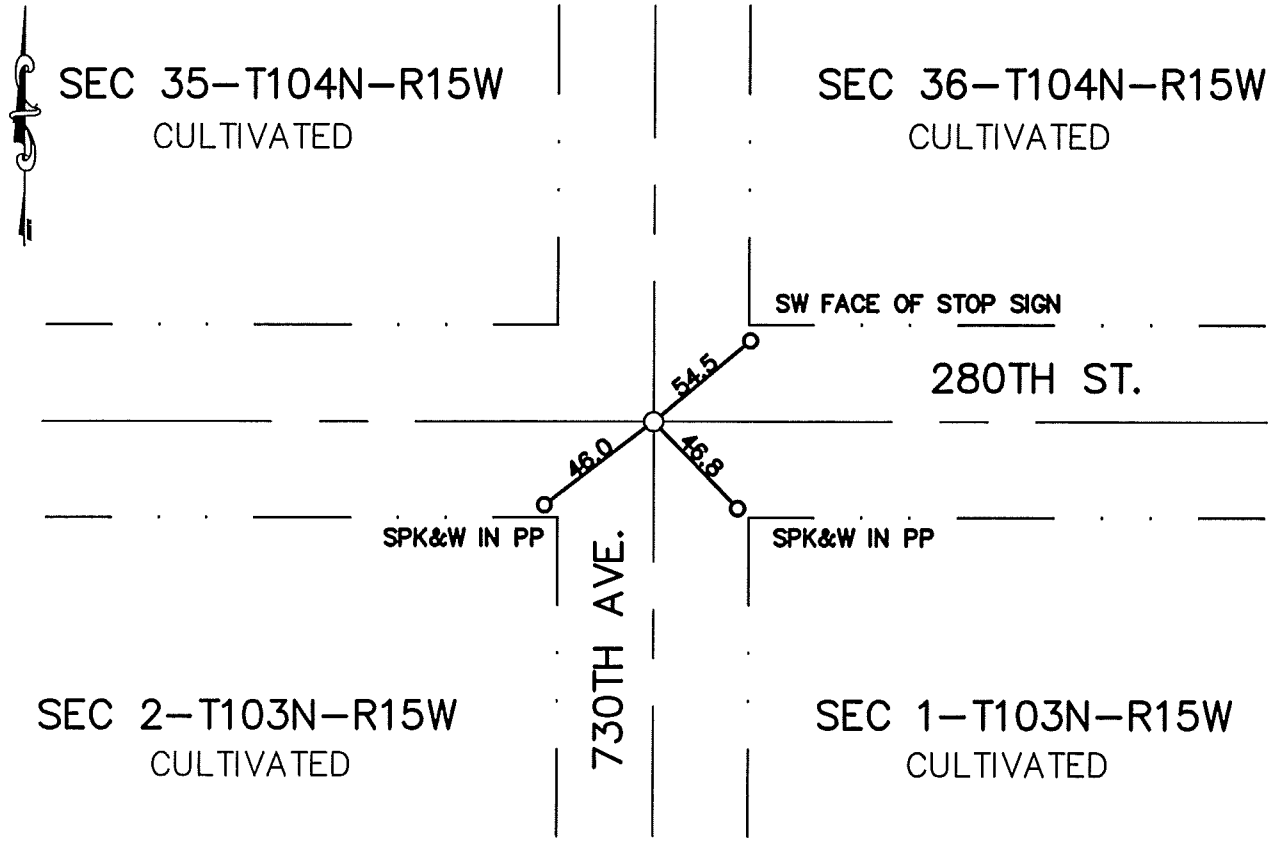

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 9-30-04

Registration No. 13807

☒ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 20___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

NE Corner Section 2-T103N-R15W

Deputy Surveyor John Ball of the U.S. General Land Office originally established this corner in 1853 . The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Department
Mower County Recorder
Tucker Land Surveying

2004 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug with Boe Brothers backhoe at centerline of township road east-west and centerline of township road north-south. Uncovered a field stone 3.5' below road surface. Accepted stone as the best evidence of the original PLS corner. Placed a 5/8"x16" rebar capped #13807 on the east side of stone found. Placed a 5/8"x16" rebar with cast iron monument over stone 0.6' below road surface.

The monument is in agreement with the record and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E 1/4 Corner of Section 2, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 07/26/2004 (DATE) found a SPIKE

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 07/26/2004 (DATE) placed a 5/8"X16" REBAR WITH CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

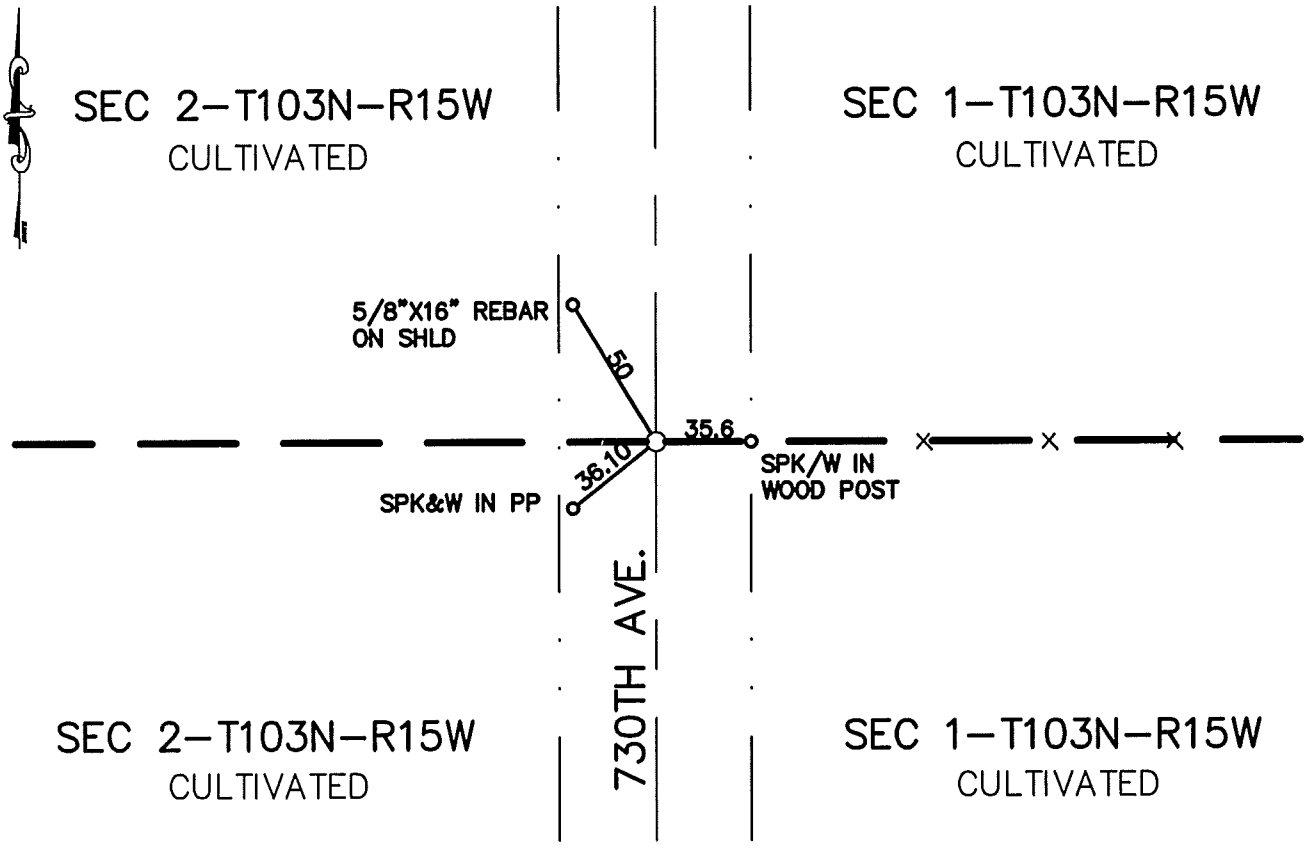

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

_____ (SIGNATURE) 9-30-04 (DATE)

Registration No. 13807

☒ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 20___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

E 1/4 Corner Section 2-T103N-R15W

Deputy Surveyor John Quigley of the U.S. General Land Office originally established this corner in 1853 . The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Department
Mower County Recorder
Tucker Land Surveying

2004 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug with Boe Brothers backhoe at centerline of township road north-south and in line with line fence east. Uncovered spike 0.3' below road surface. Continued digging to virgin soil and found no other evidence of the original PLS corner. Placed a 5/8"x16" rebar with cast iron monument in place of spike. Fits said centerline and fence line.

The monument is in agreement with the record and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NW Corner of Section 2, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On _____ (DATE) found a _____

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On _____ (DATE) placed a _____

SKETCH OF REFERENCE TIES

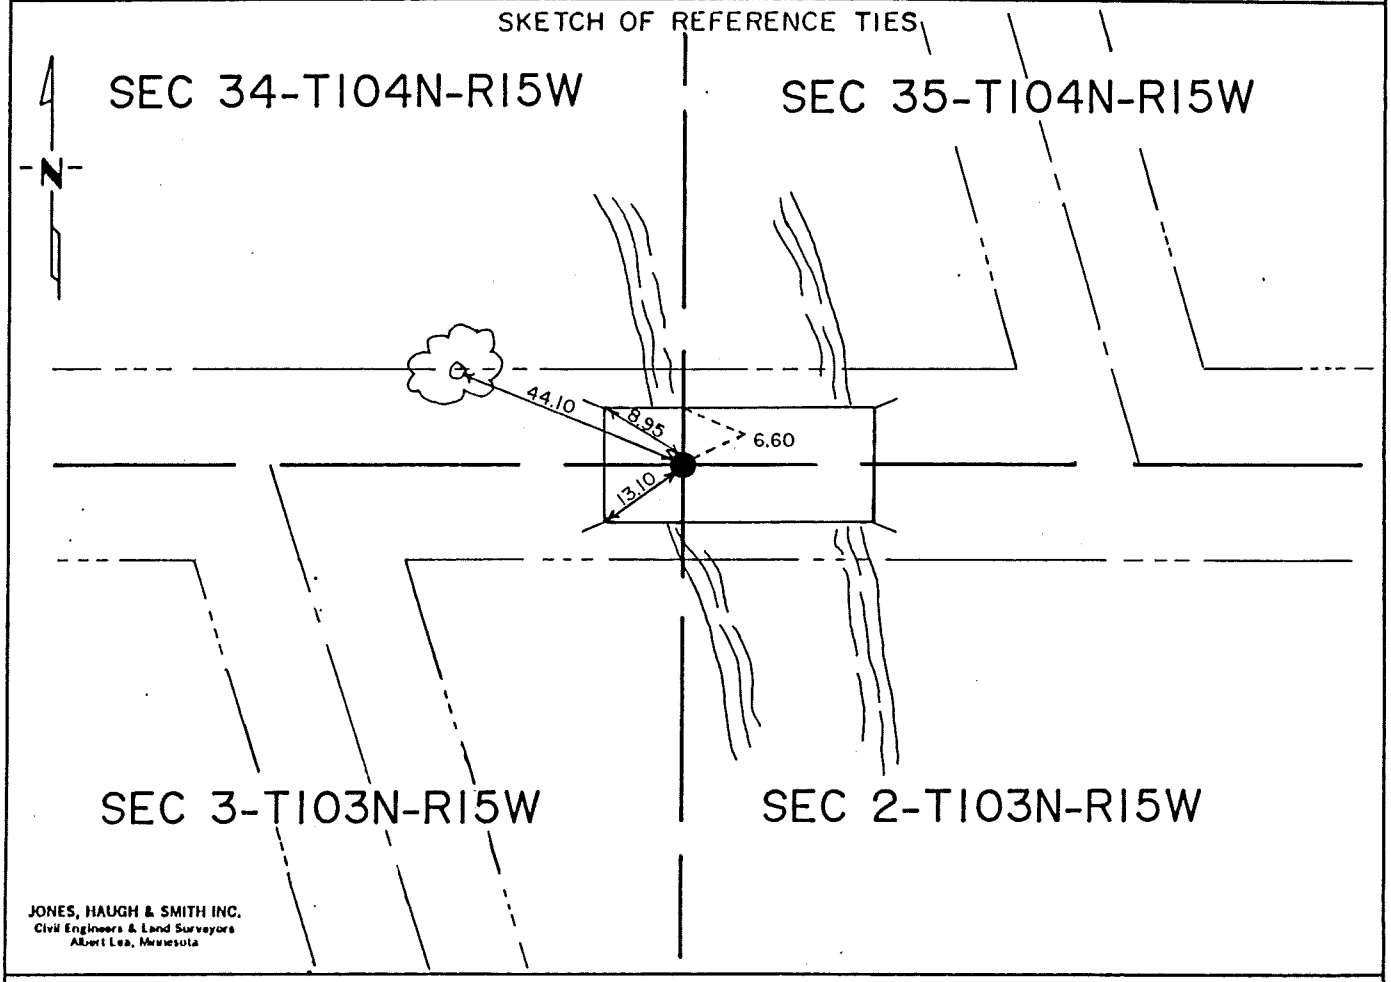

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ (SIGNATURE) 11-24-92 (DATE)

Registration No. 13907

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the ____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NW corner Section 2-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:

Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1889 The private field notes of Claussen indicate a government post inplace at the northwest corner.

1949 Book A in the office of the Mower County Highway Department shows a 1/2" iron rod in concrete bridge deck. The following ties were taken:

6.6' N to concrete bridge rail
8.95' NW to NW cor bridge rail
13.1' SW to SW cor bridge rail
44.1' NW to popular tree

1991 Jones, Haugh & Smith Inc crew, under the direction of John H. Schulte IV, uncovered a 1/2" diameter iron in concrete bridge deck and the following ties were measured which were in agreement with 1949 County records.

6.60' N to concrete bridge rail
8.95' NW to northwest corner bridge rail
13.10' SW to SW corner bridge rail

The monument found fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NE Corner of Section 4, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 03/15/1994 (DATE) found a 1.5"X1.5" BAR

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 03/15/1994 (DATE) placed a –

SKETCH OF REFERENCE TIES

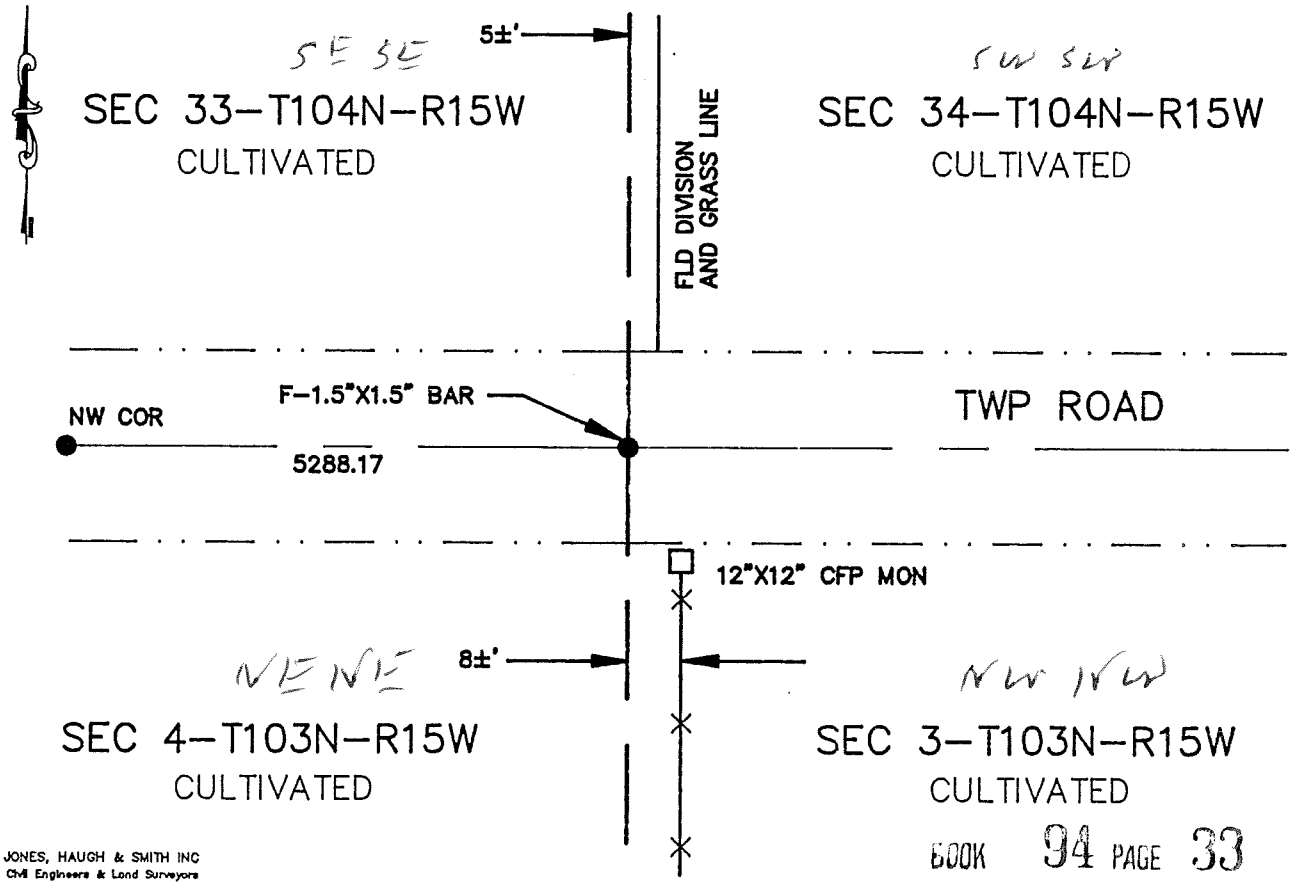

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
[illegible], Minnesota

BOOK 94 PAGE 33

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 1-17-97

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 5 P.M. on the 23 day of Jan A.D., 1997

COUNTY RECORDER Charles Enger

By Susan M. Davis, Deputy

DOCUMENT NO. 450685

M.H.D. FORM NO. 2105

Book 94 Misc Page 33

NE Cor SEC 4-103-15

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1853. The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

No record of this corner was obtained from the above mentioned offices.

1930	Mower Co. Hwy. Dept. notes show a corner at this location.
1960	MHD I-90 R/W map shows a T-post over a stone monument at this location.
1994	Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug by hand at the CL of township road E-W and uncovered a 1.5"x1.5" iron bar 1.5' deep in accordance with the 1960 MHD record.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 6, Township 103, Range 15,

5th P.M. STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☒ On 6-13-90 found a Cast Iron Monument.

☒ left monument as found, ☐ lowered monument, ☐ removed monument (expl.)

☐ On _____ placed a _____

SKETCH OF REFERENCE TIES

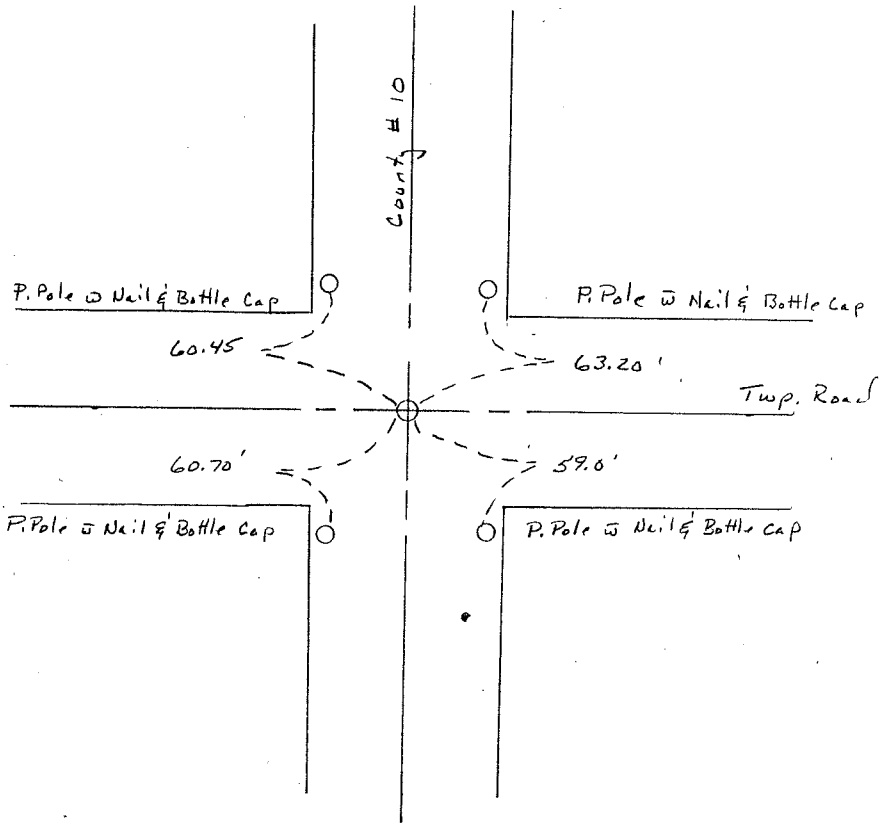

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Raymond J. Tucker — Signature

6-29-90 — Date

Registration No. 15471

☒ Land Surveyor, ☐ Prof. Engineer

☐ County Surveyor, ☐ County Engr.

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Recorders office at _____.M. on the ___ day of _____ A.D., 19____.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

STATEMENT OF EVIDENCE:

NORTHEAST CORNER SECTION 6 -T103N - R15W

1853 - John Ball, Deputy Surveyor, set a quarter section post, built mound with trench per instruction, put hand full small stones in center and planted osage orange seeds in SE corner during the Original Public Land Survey.

1952 - Mower County Highway Department note show an inplaced concrete monument 8" below the surface.

1962 - C.E. Milner, R.L.S., 1476, during a Power Line Encroachment Survey shows a monument 1.34 feet West of centerline.

March 1990 - Mower County Highway Department notes show an inplaced cast iron monument.

June 1990 - Tucker Land Surveying excavated this location and found a cast iron monument. Accepted as corner.

The above corner agrees with a electronic survey made of monuments and occupation lines in the area and is accepted as a perpetuation of the public land survey corner.

For details of the analysis and electronic survey data contact: Tucker Land Surveying, Dexter, Minnesota 55926.

p102 TIE BOOK

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 6, Township 103N, Range 15 W, 5th P.M. STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☒ On Dec. 5, 1980 found a steel rod in concrete monument over a 6"x8"x6" Stone

☒ left monument as found, ☐ lowered monument, ☐ removed monument (expl.)

☒ On Dec. 5, 1980 placed a cast iron Monument over concrete monument and stone.

SKETCH OF REFERENCE TIES

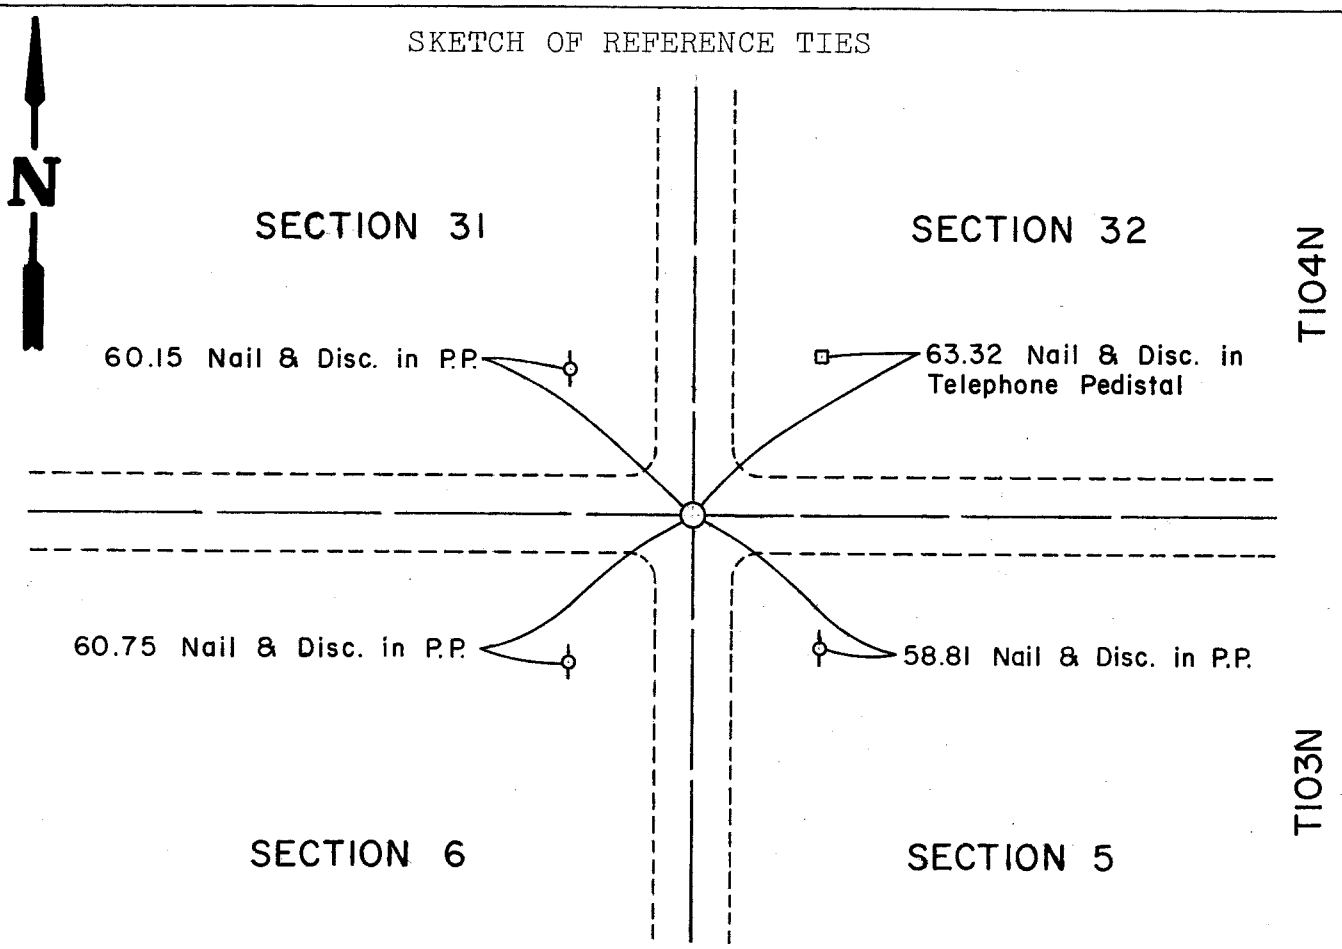

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Ronald L. Olson — Signature
12-16-80 — Date

Registration No. 11009
☒ Land Surveyor, ☒ Prof. Engineer
☐ County Surveyor, ☐ County Engr.

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Recorders office at _____.M. on the ___ day of _____ A.D., 19___.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

STATEMENT OF EVIDENCE:

NORTHEAST CORNER SECTION 6, TOWNSHIP 103 NORTH, RANGE 15 WEST, 5th P.M.

July, 1853 — John Ball, Deputy Surveyor, set the corner during the original Public Land Survey.

Dexter Township, Mower County, Minnesota constructed roads North-South and East-West through the vicinity of the corner.

1930's-1940's — Mower County set concrete monuments at corners in the county.

1952 — Mower County obtained control of the North-South road and constructed a county road. An iron rod in concrete was found down 0.7 feet at the road intersection. The road was raised in this area.

December 5, 1980

Ronald J. Olson, Land Surveyor, searched the area with a magnetic locator. An excavation was made with the cooperation of the Mower County Engineer and two concrete monuments with iron rods were found in the embankment over a 6 inch by 6 inch by 8 inch high pointed stone found 4 feet below the surface. The excavation was 4 feet E-W by 6 feet N-S by 4 feet deep centered on the stone. The earth under the stone was undisturbed and no other evidence was found.

An electronic measurement was made to the monument 1 mile north and the distance agrees within 1 foot of the distance measured in 1952.

The stone has been perpetuated as the corner for over 40 years and is accepted as marking the corner of the original Public Land Survey.

For additional details contact Zenk Engineering, Inc., Albert Lea, Minnesota 56007.

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter Corner of Section 6, Township 103, Range 15, 5th P.M. STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☐ On 6-13-90 found a 2 1/2' long steel pipe. Reset pipe location

☐ left monument as found, ☐ lowered monument, ☐ removed monument (expl.)

☒ On 6-22-90 placed a Standard County Monument.

SKETCH OF REFERENCE TIES

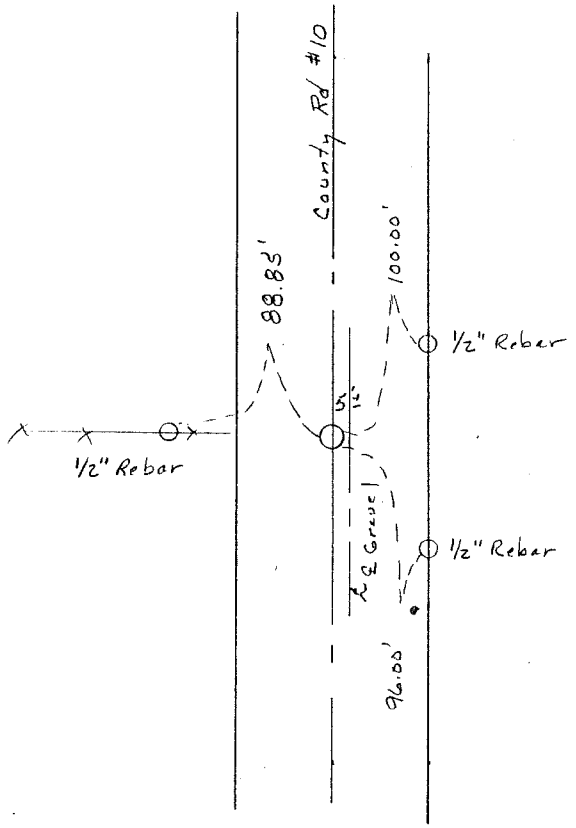

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Raymond A Tucker
Signature

6-29-90
Date

Registration No. 15471
☒ Land Surveyor, ☐ Prof. Engineer

☐ County Surveyor, ☐ County Engr.

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Recorders office at _____.M. on the ___ day of _____ A.D., 19____.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

STATEMENT OF EVIDENCE:

EAST QUARTER CORNER SECTION 6 - T103N - R15W

1853 - John Quigley, Deputy Surveyor, set a quarter section post, built a mound with trench per instruction, placed a handfull small stones in center and planted osage orange seeds in S.E. Corner during the Origianl Public Land Survey.

1962 - C.E. Milner, R.L.S. 1476, during a Power Line Encroachment Survey shows a monument 2.01 feet West of centerline.

June 1990 - Tucker Land Surveying excavated this location and found a 2 1/2 feet long steel pipe flush with surface 5 feet West of Centerline. Removed and excavated to original ground found nothing else. Reset pipe location with Standard County Monument.

The above corner agrees with a electronic survey made of monuments and occupation lines in the area and is accepted as a perpetuation of the public land survey corner.

For details of the analysis and electronic survey data contact: Tucker Land Surveying, Dexter, Minnesota 55926.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

S 1/4 Corner of Section 7, Township 103 Range 15, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 7/21/2000 (DATE) found a _____

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 7/21/2000 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

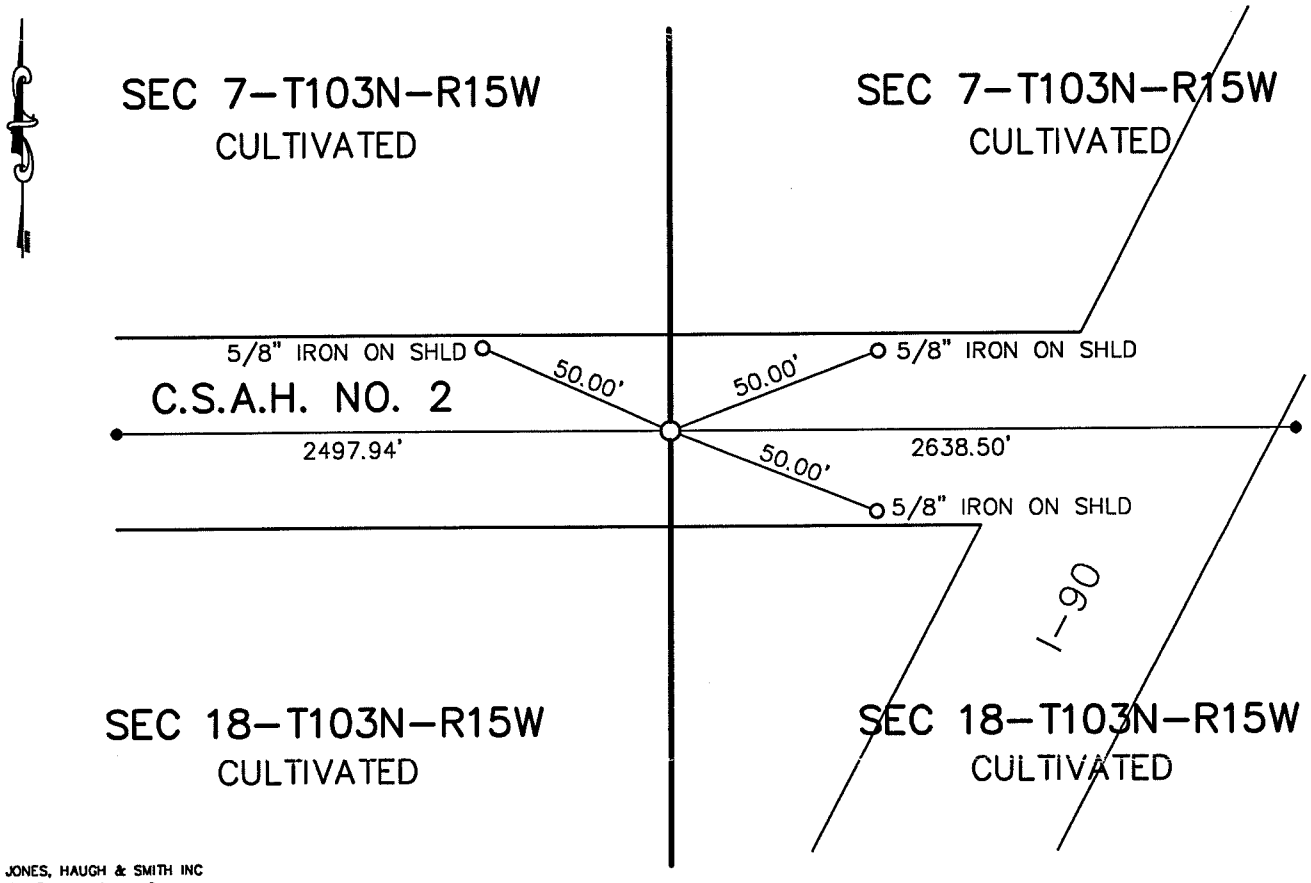

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

_____ 9-7-00
SIGNATURE DATE

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

S 1/4 Corner Section 7-103-15

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1853. The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Tucker Land Surveying
MnDOT

Mower County Highway Department road plan of C.S.A.H. No. 2 shows corner to be on straight line between SW & SE corner.

MnDOT R/W Map for I-90 shows no location for this corner.

1999 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, set corner by using County Road Plan. County distance from SW corner to the SE corner is 5137.90. Found 5136.44, 1.46 short. Set corner on straight line between SW & SE. Held County Road plan distance from SE corner to S ¼ corner. Set 5/8" X 16" iron with cast iron monument, at road surface.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh, and Smith Inc.

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 7, Township 103, Range 15,


5th P.M. STATE OF MINNESOTA, County of Mower

At the corner location shown on the sketch:

☒ On 6-13-90 found a Concrete Monument 2.5' west of centerline North 0.50' deep. Found another Conc. Monument 1.80' deep below first.
☒ left monument as found, ☐ lowered monument, ☐ removed monument (expl.)

☐ On _____ placed a _____

SKETCH OF REFERENCE TIES

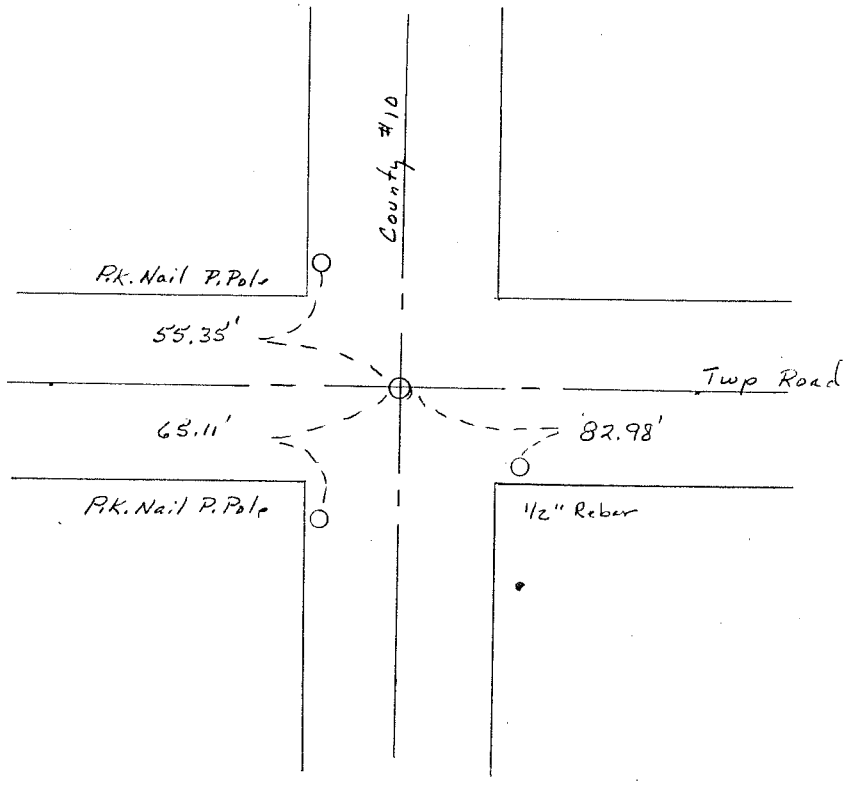

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Raymond J Tucker — Signature
6-29-90 — Date

Registration No. 15471
☒ Land Surveyor, ☐ Prof. Engineer

☐ County Surveyor, ☐ County Engr.

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Recorders office at _____.M. on the ___ day of _____ A.D., 19____.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

STATEMENT OF EVIDENCE:

NORTHEAST CORNER SECTION 7-T103N-R15W

1853 - John Quigley, Deputy Surveyor, set a section corner post, built mound with trench per instruction put handful small stone in center and planted osage and orange seeds in Southeast Corner during the Original Public Land Survey.

1952 - Mower County Highway Department notes show an inplaced concrete monument.

1986 - Tucker Land Surveying notes show an inplaced concrete monument set 1/2" rebar with cap stamp RLS 15471.

1990 - Mower County Highway Department notes show an inplace 1/2" rebar with cap stamped RLS 15471.

June 1990 - Tucker Land Surveying excavated this location and found a concrete monument 2.5 feet west of centerline North 0.50 feet deep continued down found another concrete monument 1.80 feet deep below the first one.

The above corner agrees with a electronic survey made of monuments and occupation lines in the area and is accepted as a perpetuation of the public land survey corner.

For details of the analysis and electric survey data contact: Tucker Land Surveying, Dexter, MN 55926.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

S 1/4 Corner of Section 8, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 08/01/1996 (DATE) found a –

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 08/01/1996 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

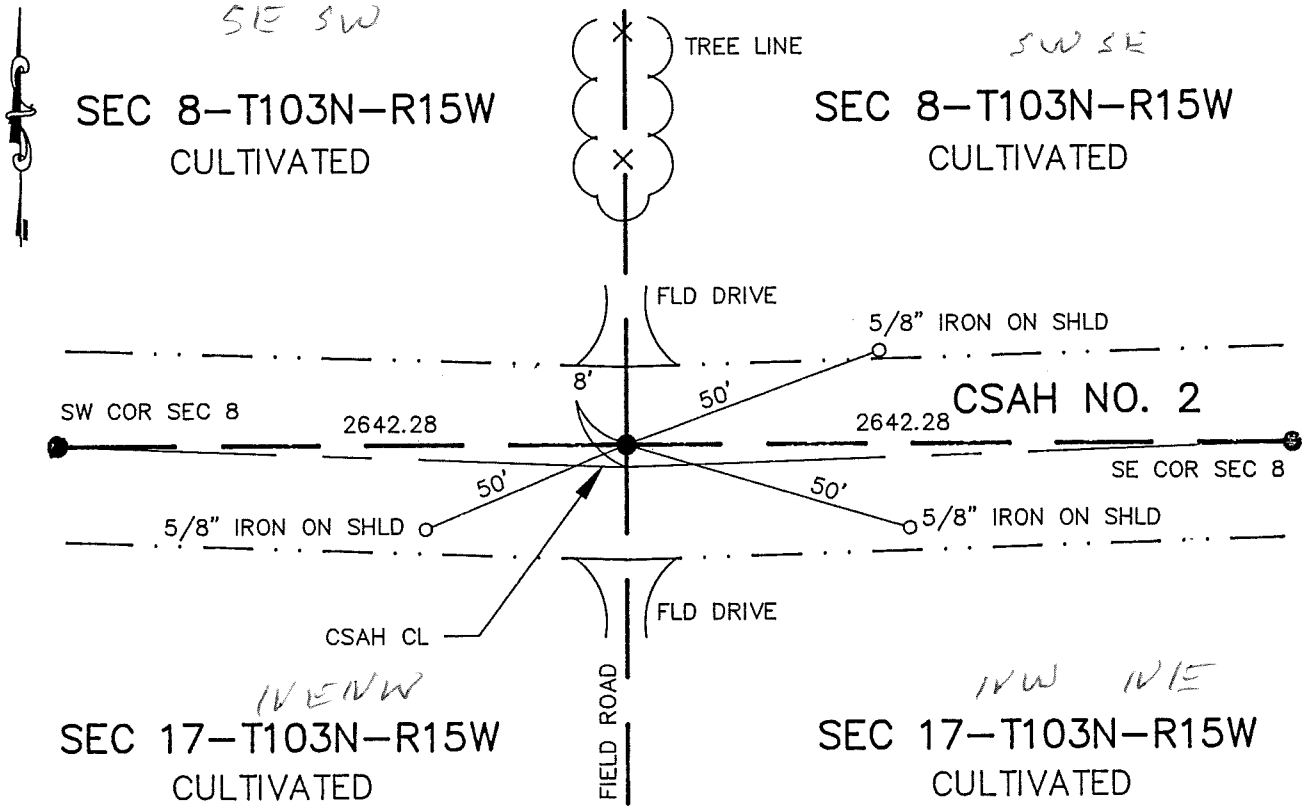

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

BOOK 93 PAGE 601

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

[signature] 1-9-97
SIGNATURE DATE

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 4 P .M. on the 14 day of Jan A.D., 1997

COUNTY RECORDER Charles Engen

By Susan M. Davis, Deputy

DOCUMENT NO. 450529

M.H.D. FORM NO. 2105

Book 93 Misc Page 601

S 1/4 Cor SEC 8-103-15

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1853. The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

No record of this corner was obtained from the above mentioned offices.

1996 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug with county backhoe 8' north of CL of C.S.A.H. No. 2 and in line with fence line north. Uncovered no evidence of original PLS corner. Placed corner on a split between the SW and SE section corners. Corner fits fence lines and is 8' north of CL.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NE Corner of Section 8, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 08/01/1996 (DATE) found a 5/8"X12" IRON OVER 2 x 2 HUB

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 08/01/1996 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

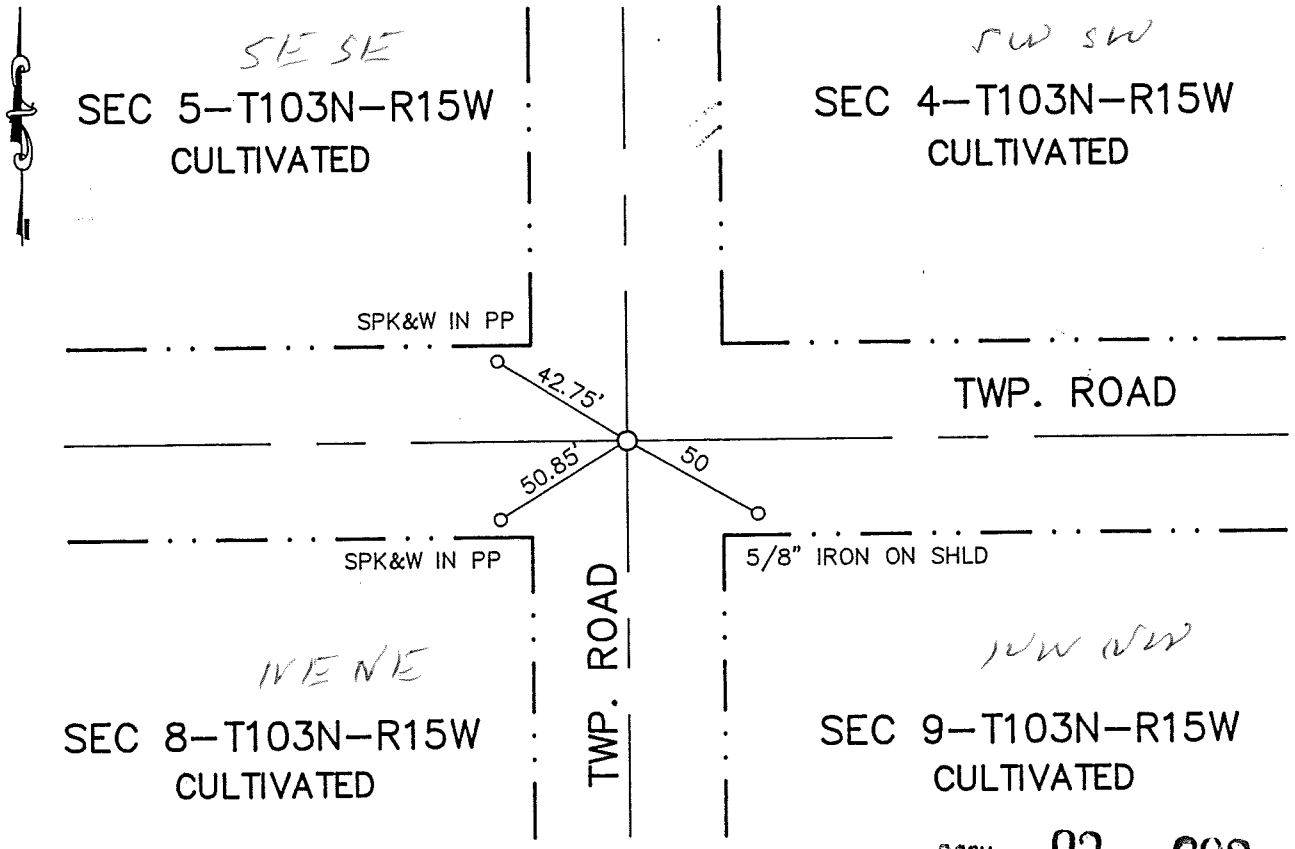

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

BOOK 93 PAGE 603

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 1-9-97

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 4 p .M. on the 14 day of Jan A.D., 1997

COUNTY RECORDER Charles Engen

By Susan M. Davis, Deputy

DOCUMENT NO. 450530

M.H.D. FORM NO. 2105

Book 93 Misc Page 603

NE Cor SEC 8-103-15

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1853. The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

1930 Mower County Highway Department records show a 2"x2' hub and iron pin inplace.

1996 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug with county backhoe at the intersection of township road N-S and E-W. Uncovered a 5/8"x12" iron on the south side of a 2"x2' stake. Continued digging and found no other evidence of original PLS corner. Accepted iron and stake as true corner. Placed a 5/8"x16" iron capped #13807 on the west side of monuments. Placed a cast iron monument over monuments found.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E 1/4 Corner of Section 8, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 08/01/1996 (DATE) found a –

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 08/01/1996 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

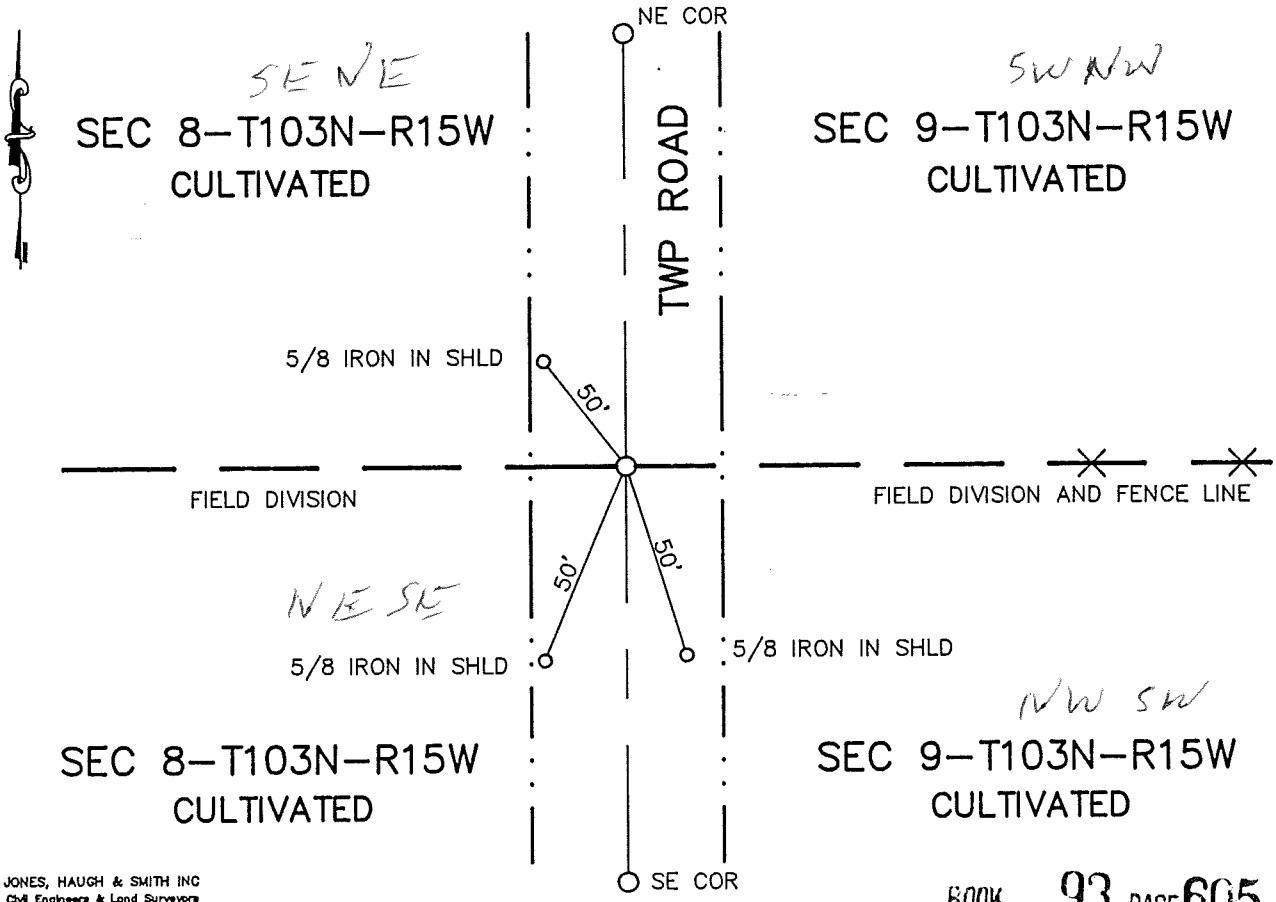

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

BOOK 93 PAGE 605

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 1-9-97

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 4 P .M. on the 14 day of Jan A.D., 1997

COUNTY RECORDER Charles Evgen

By Susan M. Davis, Deputy

DOCUMENT NO. 450531

M.H.D. FORM NO. 2105

Book 93 Misc Page 605

E 1/4 Cor SEC 8-103-15

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1853. The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

No record of this corner was obtained from the above mentioned offices.

1996 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug with county backhoe at the CL of township road N-S and in line with field divisions E-W. Found no evidence of original PLS corner. Placed corner on CL of road and in line with field divisions E-W.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

TIE BOOK p102

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter Corner of Section 10, Township 103N, Range 15W, 5th P.M. STATE OF MINNESOTA, County of Mower

At the corner location shown on the sketch:


☒ On June 1983 found a 4" diameter cast iron monument, and a 12"x10" pointed stone below, raised cast iron to surface.

☒ left monument as found, ☐ lowered monument, ☐ removed monument (expl.)

☐ On _____ placed a _____

_____

SKETCH OF REFERENCE TIES

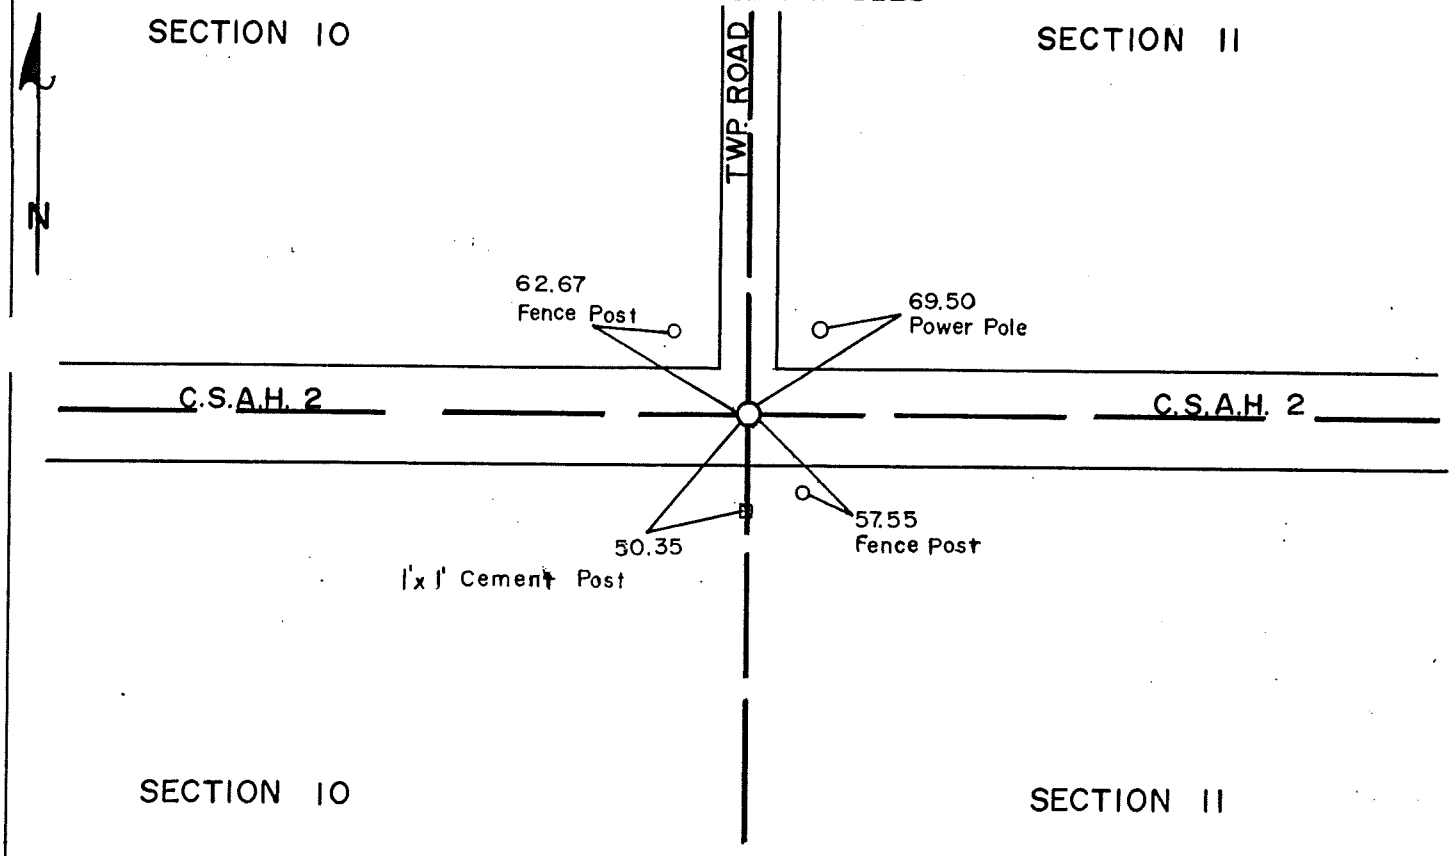

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Raymond J. Tucker — Signature
Aug. 29, 1984 — Date

Registration No. 15471
☒ Land Surveyor, ☐ Prof. Engineer
☐ County Surveyor, ☐ County Engr.

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Recorders office at _____.M. on the ___ day of _____ A.D., 19____.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

STATEMENT OF EVIDENCE:

EAST QUARTER CORNER SECTION 10 - T103N - R15W

1853 - John Quigley, Deputy Surveyor, set a post and built a mound and placed a handful of small stones in the center during the original public land survey.

1930 - Mower County Highway Department notes show a inplace monument during a survey on C.A.R. C-8 (now C.S.A.H. #2).

1960 - Mower County Highway Department notes show a inplace concrete monument during a survey on C.S.A.H. #2.

1980 - Mower County Highway Department notes show a inplace monument and placed a 3/4" iron rod during a survey on C.S.A.H. #2.

1983 - R. J. Tucker, RLS, assisted by Mower County Highway Department personnel found a 4" diameter cast iron monument with a 12" x 10" pointed stone below, the cast iron monument was raised to the surface.

The above corner agrees with a electronic survey made of monuments and occupation lines in the area and is accepted as a perpetuation of the public land survey corner.

For details of the analysis and electronic survey data contact: Tucker Land Surveying, Dexter, Minnesota 55926.

"D" TILE DOOR PLOT

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Southwest Corner of Section 10, Township 103N, Range 15W, 5th P.M.

STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☒ On 12-17-80 (DATE) found a 5/8" ø iron in concrete over a rock, broken tile and oak stake.

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 12-17-80 (DATE) placed a 4" diameter cast iron monument stamped section corner over 5/8" ø iron in concrete

SKETCH OF REFERENCE TIES

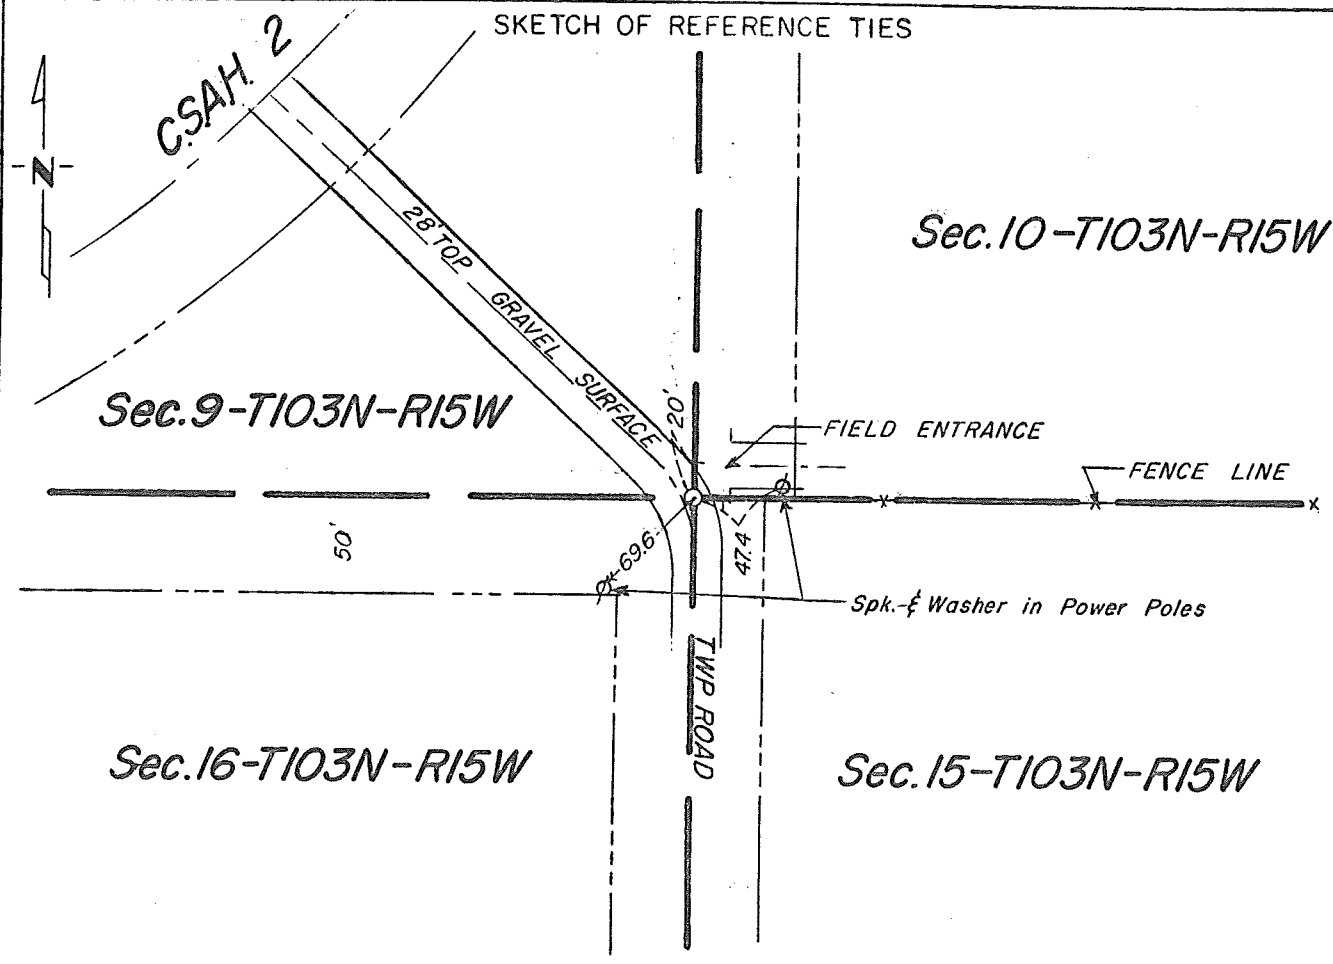

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ _____
SIGNATURE DATE

Registration No. 13807

☒ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the Co Recorder office at _____ .M. on the _____ day of _____ A.D., 19___

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

Southwest Corner Section 10 - T103N - R15W

July 1853 - John Quigly, Deputy Surveyor, set a post and built a mound with a hand full of small stones in center for the southwest corner of Section 10-T103N-R15W, during the original public land survey.

1932 - A.C. White, RLS, located a rock and broken tile at the southwest corner during a survey for C.A.R. C-8 (now CSAH No. 2).

1960 - Mower County Highway Department notes show a concrete monument inplace at the Southwest corner.

December 1980 - Jones, Haugh & Smith survey crew assisted by Mower County Highway Department personnel found a 5/8" ø iron in concrete over a rock, broken tile and oak stake and placed a 4" diameter cast iron marker over the concrete marker.

The above corner agrees with occupation lines and existing road centerlines and has been used and recognized as the corner in several surveys, it is accepted as a perpetuation of the public land survey corner.

The electronic survey data and details of the analysis of this corner are in the private records of Jones, Haugh & Smith Inc.

"E" TIE BOOK P102

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

West One Quarter Corner of Section 10, Township 103N, Range 15W, 5th P.M.

STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☒ On 12-17-80 (DATE) found a 5/8" ø iron in concrete over stone, and brick and oak stake

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 12-17-80 (DATE) placed a 4" diameter cast iron marker stamped quarter corner over 5/8" ø iron in concrete.

SKETCH OF REFERENCE TIES

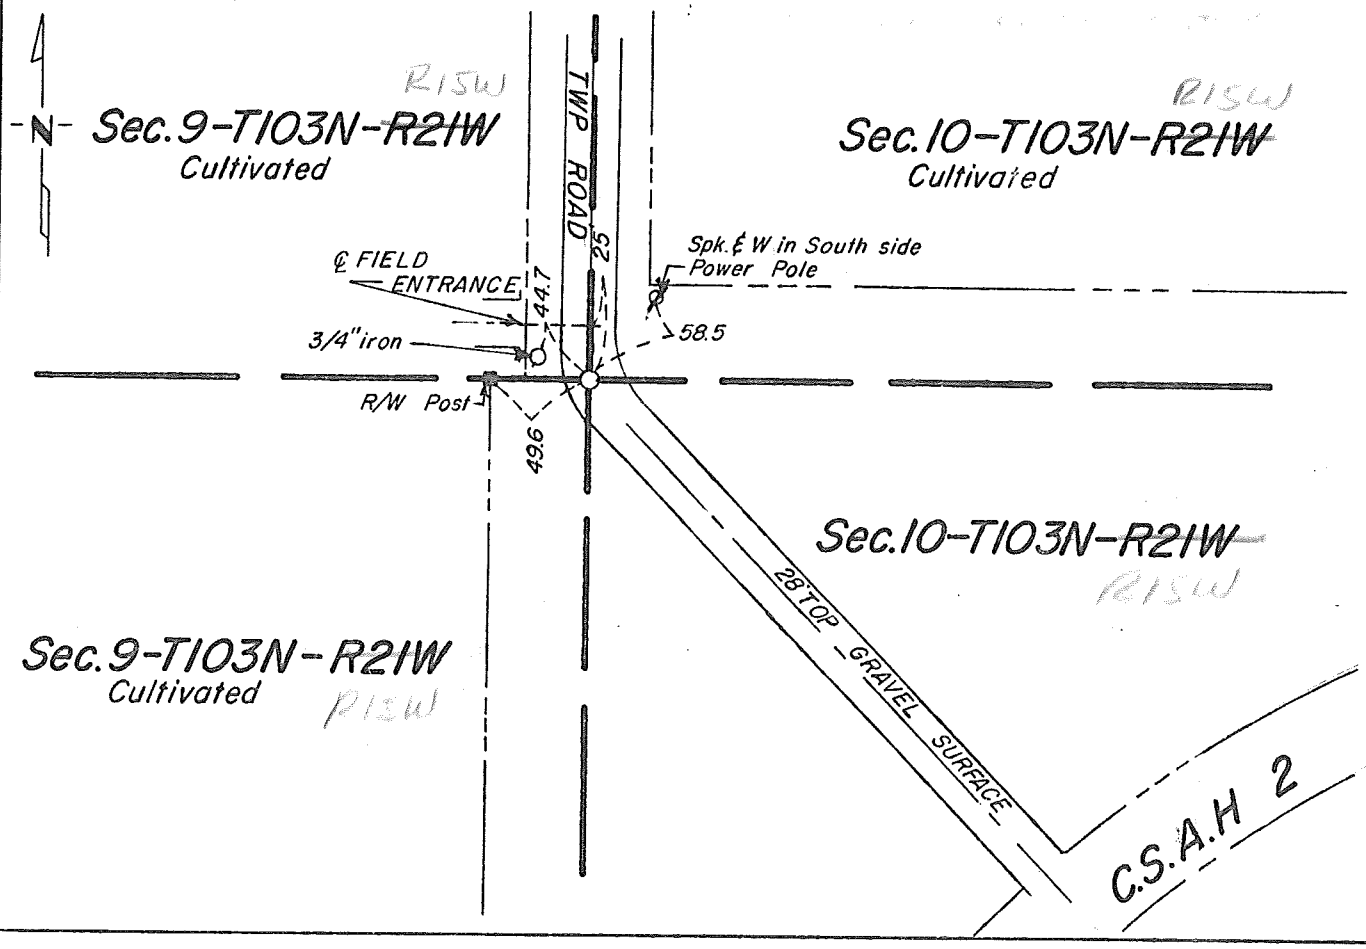

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ SIGNATURE _____ DATE

Registration No. 13807

☒ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of Mower

I hereby certify that this document was filed in the Co Recorder office at _____ .M. on the _____ day of _____ A.D., 19___

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

West One Quarter Corner Section 10 - T103N - R15W

July 1853 - John Quigly, Deputy Surveyor, set a post and built a mound with a hand full of small stones in center for the west one quarter corner of Section 10-T103N-R15W, during the original public land survey.

1932 A.C. White, RLS, located a stone and brick at the W¼ corner during a survey for C.A.R. C-8 (now CSAH No. 2).

1960 Mower County Highway Department notes show a concrete monument inplace at the W¼ corner.

December 1980 Jones, Haugh & Smith survey crew assisted by Mower County Highway Department personnel found a 5/8" ø iron in concrete over stone, and brick and oak stake and placed a 4" diameter cast iron marker over the concrete marker.

The above corner agrees with occupation lines and existing road centerlines and has been used and recognized as the corner in several surveys, it is accepted as a perpetuation of the public land survey corner.

The electronic survey data and details of the analysis of this corner are in the private records of Jones, Haugh & Smith Inc.

TIE BOOK p 99

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter Corner of Section 11, Township 103N, Range 15W, 5th P.M. STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☒ On June 1983 found a 4" diameter cast iron monument, and a concrete cylinder with a rebar in the center below, raised cast iron to surface.
☒ left monument as found, ☐ lowered monument, ☐ removed monument (expl.)

☐ On _____ placed a _____

_____

SKETCH OF REFERENCE TIES

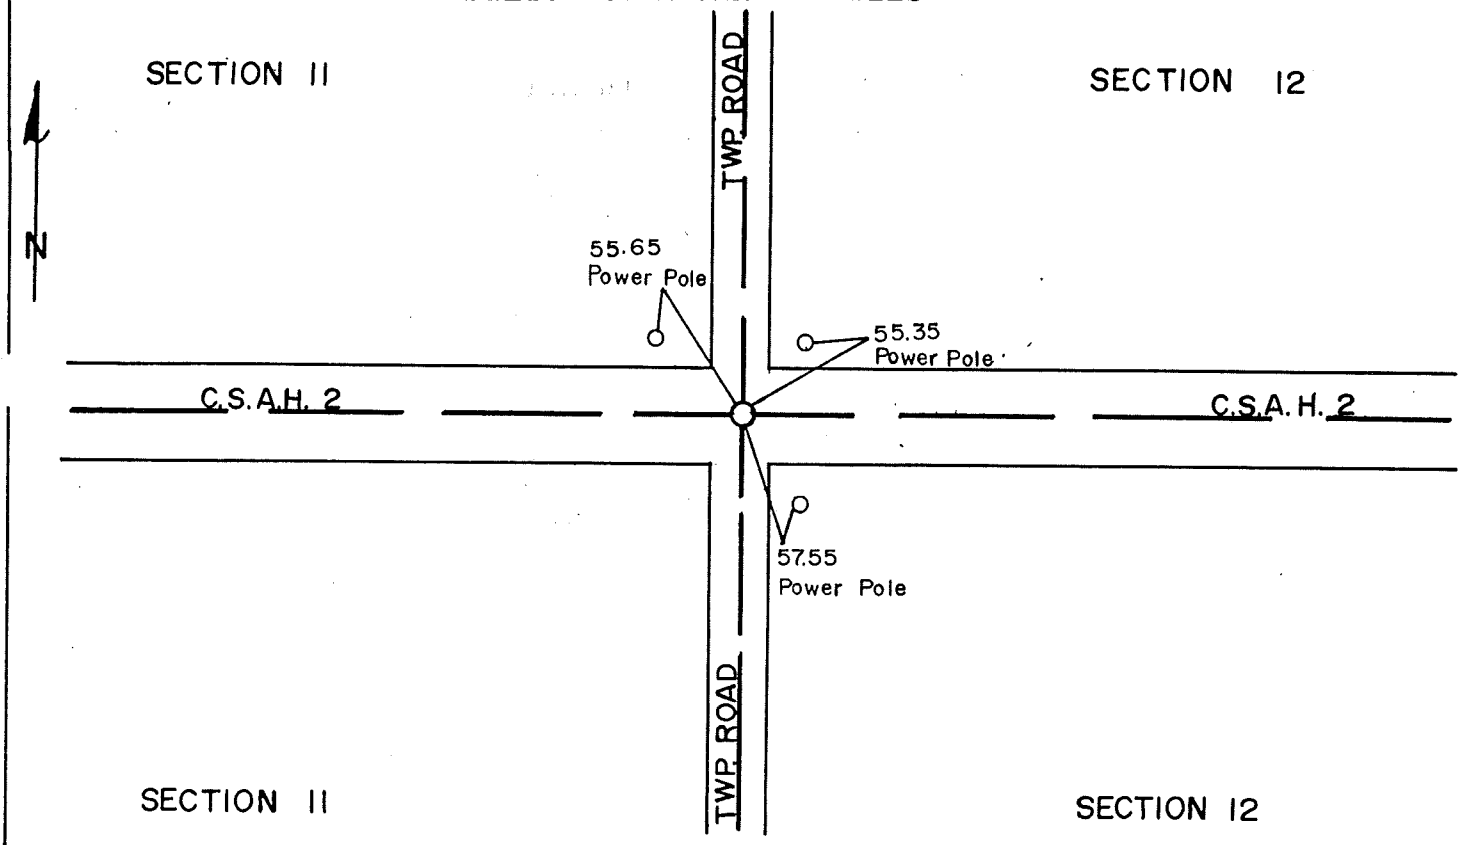

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Raymond J. Tucker — Signature
Aug. 29, 1984 — Date

Registration No. 15471
☒ Land Surveyor, ☐ Prof. Engineer
☐ County Surveyor, ☐ County Engr.

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Recorders office at _____.M. on the ___ day of _____ A.D., 19____.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

STATEMENT OF EVIDENCE:

EAST QUARTER CORNER SECTION 11 - T103N - R15W

1853 - John Quigley, Deputy Surveyor, set a post and built a mound and placed a handful of small stones in the center during the public land survey.

1930 - Mower County Highway Department notes show a inplace monument during a survey on C.A.R. C-8 (now C.S.A.H. #2).

1941 - Mower County Highway Department notes show a inplace monument.

1960 - Mower County Highway Department notes show a inplace concrete monument during a survey on C.S.A.H. #2.

1980 - Mower County Highway Department notes show a inplace monument during a survey on C.S.A.H. #2.

1983 - R. J. Tucker, RLS, assisted by Mower County Highway Department personnel found a 4" diameter cast iron monument and a concrete cylinder with a rebar in the center below, the cast iron monument was raised to the surface.

The above corner agrees with a electronis survey made of monuments and occupation lines in the area and is accepted as a perpetuation of the public land survey corner.

For details of the analysis and electronic survey data contact: Tucker Land Surveying, Dexter, Minnesota 55926.

Revised "4" TIE BOOK P 99

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter Corner of Section 12, Township 103N, Range 15W, 5th P.M. STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☒ On June 1983 found a concrete cylinder with a rebar in the center.

☒ left monument as found, ☐ lowered monument, ☐ removed monument (expl.)

☒ On June 1983 placed a 4" diameter cast iron monument above flush with the surface.

SKETCH OF REFERENCE TIES

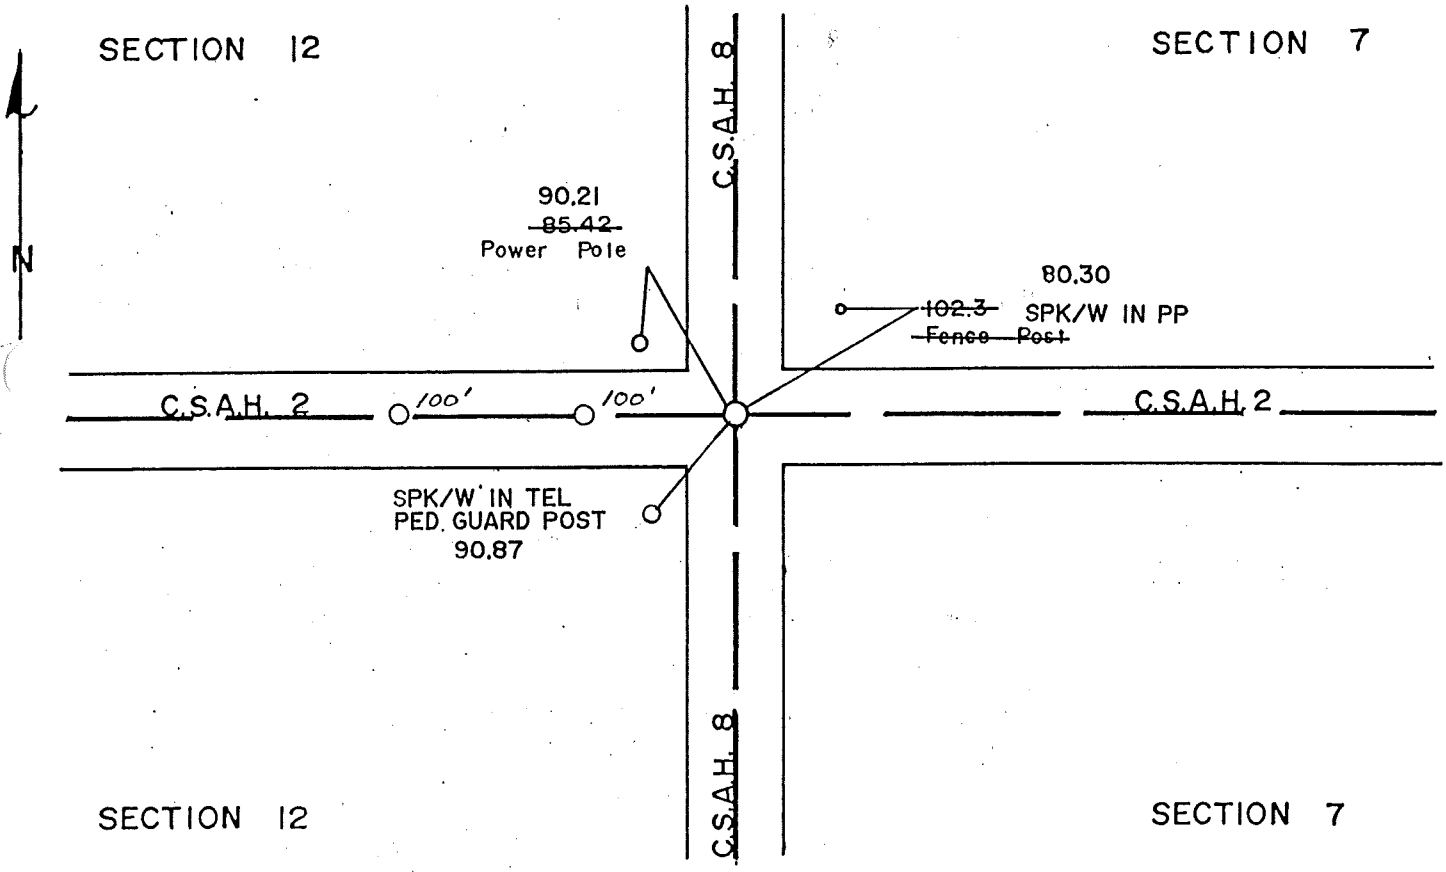

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Raymond J Tucker
Signature

Aug. 29, 1984
Date

Registration No. 15471

☒ Land Surveyor, ☐ Prof. Engineer

☐ County Surveyor, ☐ County Engr.

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Recorders office at _____.M. on the ___ day of _____ A.D., 19___.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

STATEMENT OF EVIDENCE:

EAST QUARTER CORNER SECTION 12 - T103N - R15W

1853 - John Ball, Deputy Surveyor, set a post during the original public land survey.

1930 - Mower County Highway Department notes show a inplace stone during a survey on C.A.R. C-8 (now C.S.A.H. #2).

1936 - Mower County Highway Department notes show a inplace concrete monument during a survey.

1960 - Mower County Highway Department notes show a inplace concrete monument during a survey on C.S.A.H. #2.

1980 - Mower County Highway Department notes show a inplace concrete monument during a survey on C.S.A.H. #2.

1983 - R. J. Tucker, RLS, assisted by Mower County Highway Department personnel found a concrete cylinder with a rebar in the center and placed a 4" diameter cast iron monument above it flush with the surface.

The above corner agrees with a electronic survey made of monuments and occupation lines in the area and is accepted as a perpetuation of the public land survey corner.

For details of the analysis and electronic survey data contact: Tucker Land Surveying, Dexter, Minnesota 55926.

TIE BOOK P 99

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter Corner of Section 12, Township 103N, Range 15W, 5th P.M. STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☒ On June 1983 found a concrete cylinder with a rebar in the center.

☒ left monument as found, ☐ lowered monument, ☐ removed monument (expl.)

☒ On June 1983 placed a 4" diameter cast iron monument above flush with the surface.

SKETCH OF REFERENCE TIES

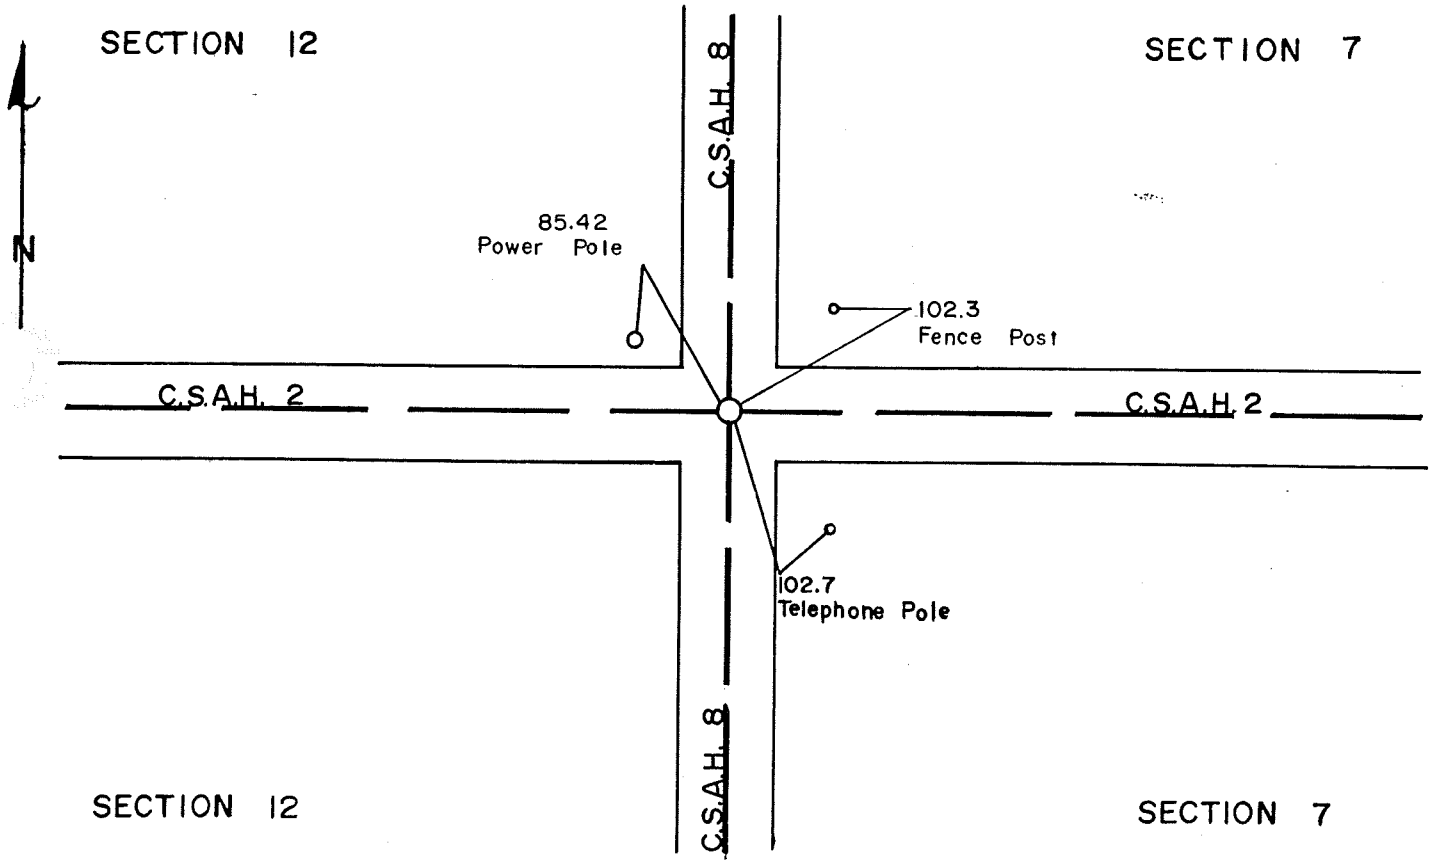

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Raymond J. Tucker
Signature

Aug. 29, 1984
Date

Registration No. 15471
☒ Land Surveyor, ☐ Prof. Engineer

☐ County Surveyor, ☐ County Engr.

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Recorders office at _____.M. on the ___ day of _____ A.D., 19____.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

STATEMENT OF EVIDENCE:

EAST QUARTER CORNER SECTION 12 - T103N - R15W

1853 - John Ball, Deputy Surveyor, set a post during the original public land survey.

1930 - Mower County Highway Department notes show a inplace stone during a survey on C.A.R. C-8 (now C.S.A.H. #2).

1936 - Mower County Highway Department notes show a inplace concrete monument during a survey.

1960 - Mower County Highway Department notes show a inplace concrete monument during a survey on C.S.A.H. #2.

1980 - Mower County Highway Department notes show a inplace concrete monument during a survey on C.S.A.H. #2.

1983 - R. J. Tucker, RLS, assisted by Mower County Highway Department personnel found a concrete cylinder with a rebar in the center and placed a 4" diameter cast iron monument above it flush with the surface.

The above corner agrees with a electronic survey made of monuments and occupation lines in the area and is accepted as a perpetuation of the public land survey corner.

For details of the analysis and electronic survey data contact: Tucker Land Surveying, Dexter, Minnesota 55926.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NW Corner of Section 12, Township 103N, Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☒ On 4-26-91 (DATE) found ~~a~~ no evidence of PLS corner.

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 4-26-91 (DATE) placed a cast iron monument on ℄ of N-S road and fence line E-W.

SKETCH OF REFERENCE TIES

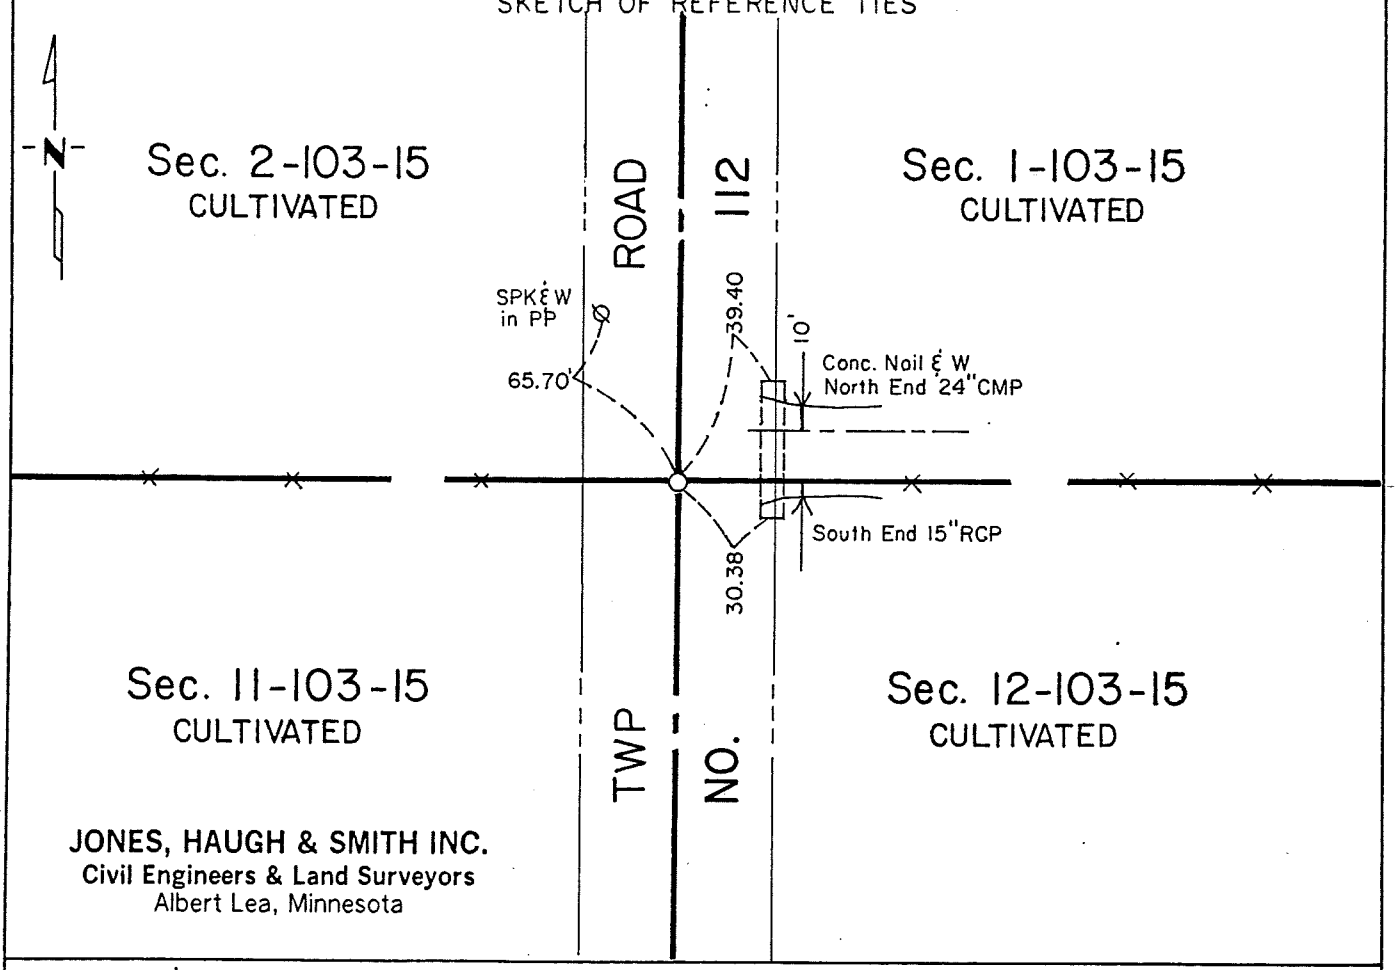

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 5-6-91

Registration No. 13807

☒ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NW corner Sec 12-103-15

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Dept.
Mower County Recorder's Office
Zenk Engineering
Tucker Land Surveying

1941 A large pointed field stone was uncovered on the centerline of township road in line with east-west fence. No ties were taken.

1991 Jones, Haugh & Smith crew, under the direction of John H. Schulte IV, dug with County backhoe on centerline of north-south road in line with fence east-west for Bridge Survey No. L5060. Dug a 5'x12'x3' deep hole and found no evidence of public land survey corner or a perpetuation thereof. Using 1941 records placed cast iron monument on centerline north-south road in line with fence east-west 0.5 feet below road surface.

The monument set is in agreement with the records and fits occupation lines, fence lines and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

Revised

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 12, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-27-93 (DATE) found a 1"ø x 16" PIPE AND A 6"ø x 18" CONC MONUMENT WITH IRON IN CENTER

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-27-93 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

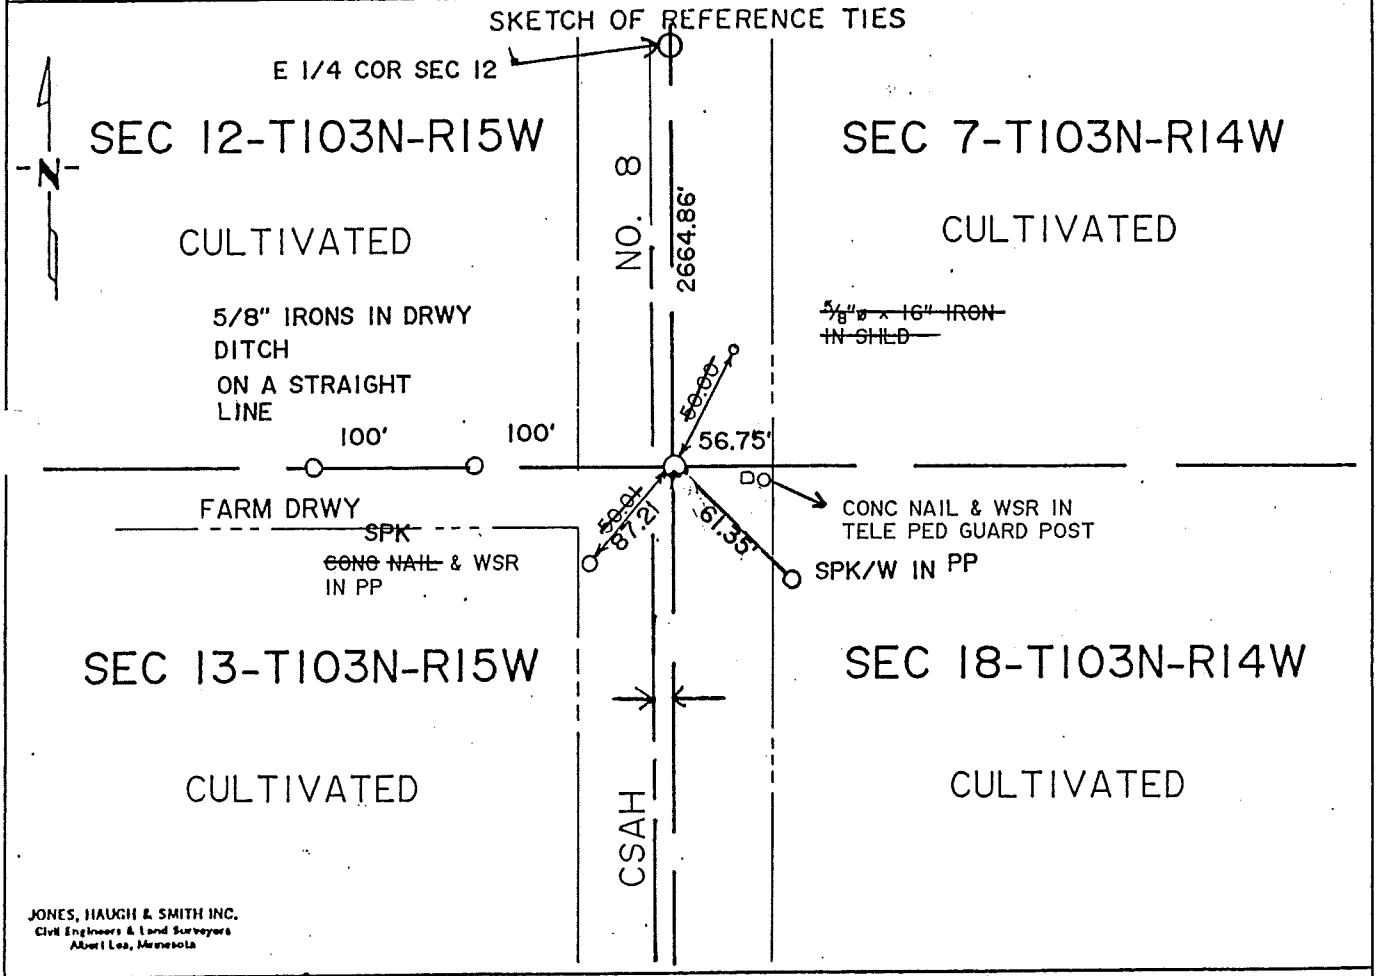

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ SIGNATURE _____ DATE

Registration No. _____

☐ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

MLD FORM NO. 2105

STATEMENT OF EVIDENCE

SE cor Sec 12-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of the perpetuation of the original public land survey corner.

1887 Clausen, Mower County Surveyor, notes indicate that there was a government post at this corner.

1938 Mower County Road Plans for County State Aid Highway No. 8 indicate a concrete monument inplace at this corner.

1945 Mower County Highway Dept Book 1 indicates a concrete monument inplace at this corner.

1993 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, RLS 13807, dug a 3'x3'x6' hole on centerline of County State Aid Highway No. 8 and in line with fence going east. We found a 1" diameter x 16" pipe 1.5 feet below road surface. Continued digging to a depth of three feet and found a 6" diameter x 18" concrete monument with an iron in center. The monuments found are in agreement with the records. Therefore we accepted monuments found as the perpetuation of the original public land survey corner and set a cast iron monument near road surface above concrete monument found.

The monument found and cast iron monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 12, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-27-93 (DATE) found a 1"ø x 16" PIPE AND A 6"ø x 18" CONC MONUMENT WITH IRON IN CENTER

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-27-93 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

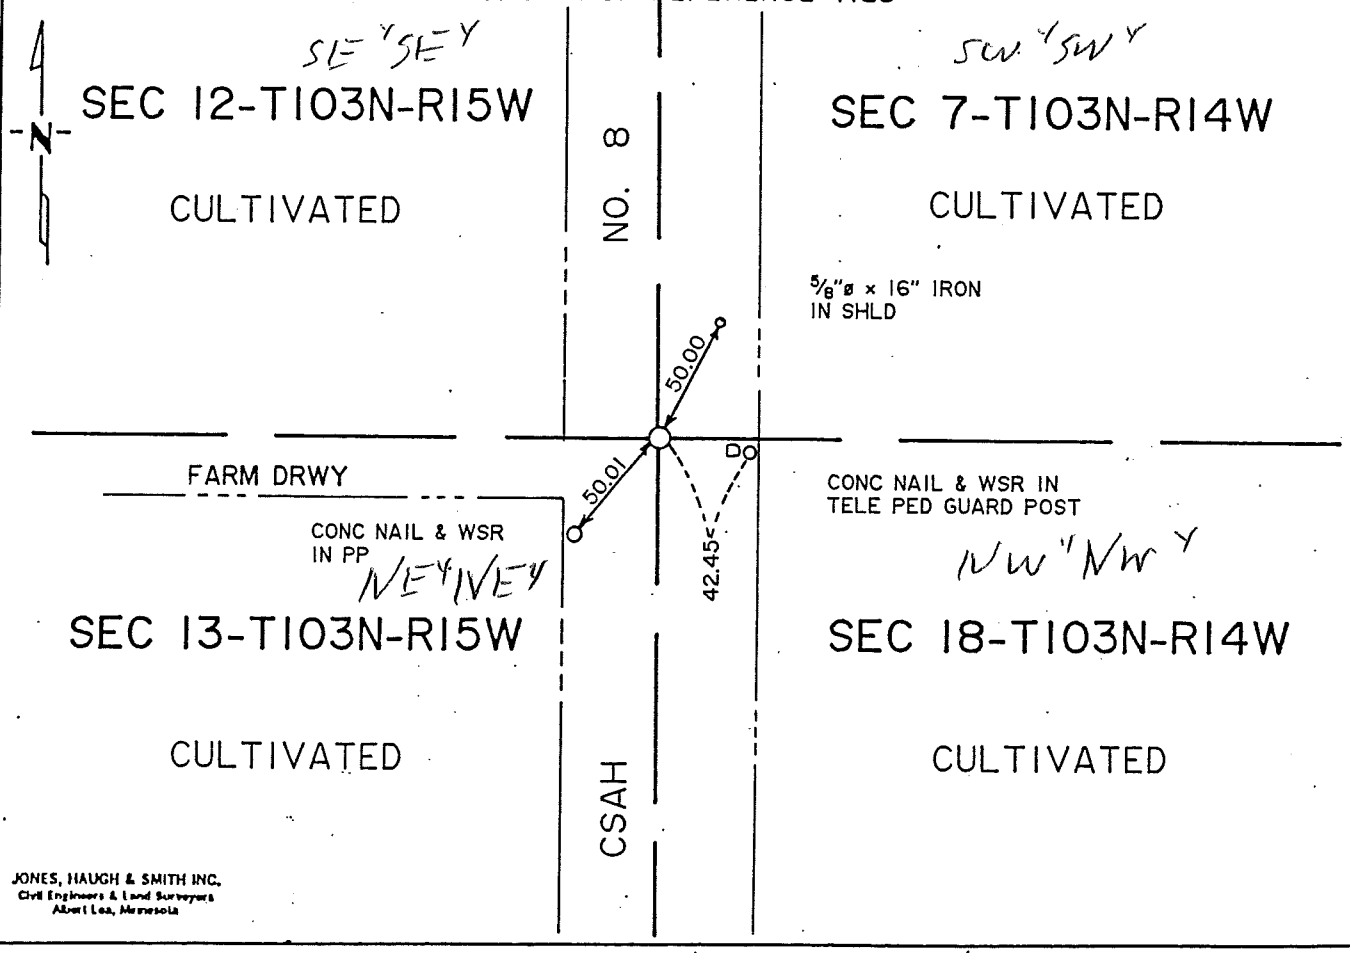

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 6-11-93

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 10 A.M. on the 21 day of June A.D., 19 93

COUNTY RECORDER Chandra Conger

By Marlene Martin, Deputy

DOCUMENT NO. 421593

Bk 79 Misc Pg. 590

M.H.D. FORM NO. 2105

BOOK 79 PAGE 590

STATEMENT OF EVIDENCE

SE cor Sec 12-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of the perpetuation of the original public land survey corner.

1887 Clausen, Mower County Surveyor, notes indicate that there was a government post at this corner.

1938 Mower County Road Plans for County State Aid Highway No. 8 indicate a concrete monument inplace at this corner.

1945 Mower County Highway Dept Book 1 indicates a concrete monument inplace at this corner.

1993 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, RLS 13807, dug a 3'x3'x6' hole on centerline of County State Aid Highway No. 8 and in line with fence going east. We found a 1" diameter x 16" pipe 1.5 feet below road surface. Continued digging to a depth of three feet and found a 6" diameter x 18" concrete monument with an iron in center. The monuments found are in agreement with the records. Therefore we accepted monuments found as the perpetuation of the original public land survey corner and set a cast iron monument near road surface above concrete monument found.

The monument found and cast iron monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

BOOK 79 PAGE 591

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SW Corner of Section 13, Township 103 Range 15, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 4-9-03 (DATE) found a LARGE SPIKE

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-22-03 (DATE) placed a CIM

SKETCH OF REFERENCE TIES

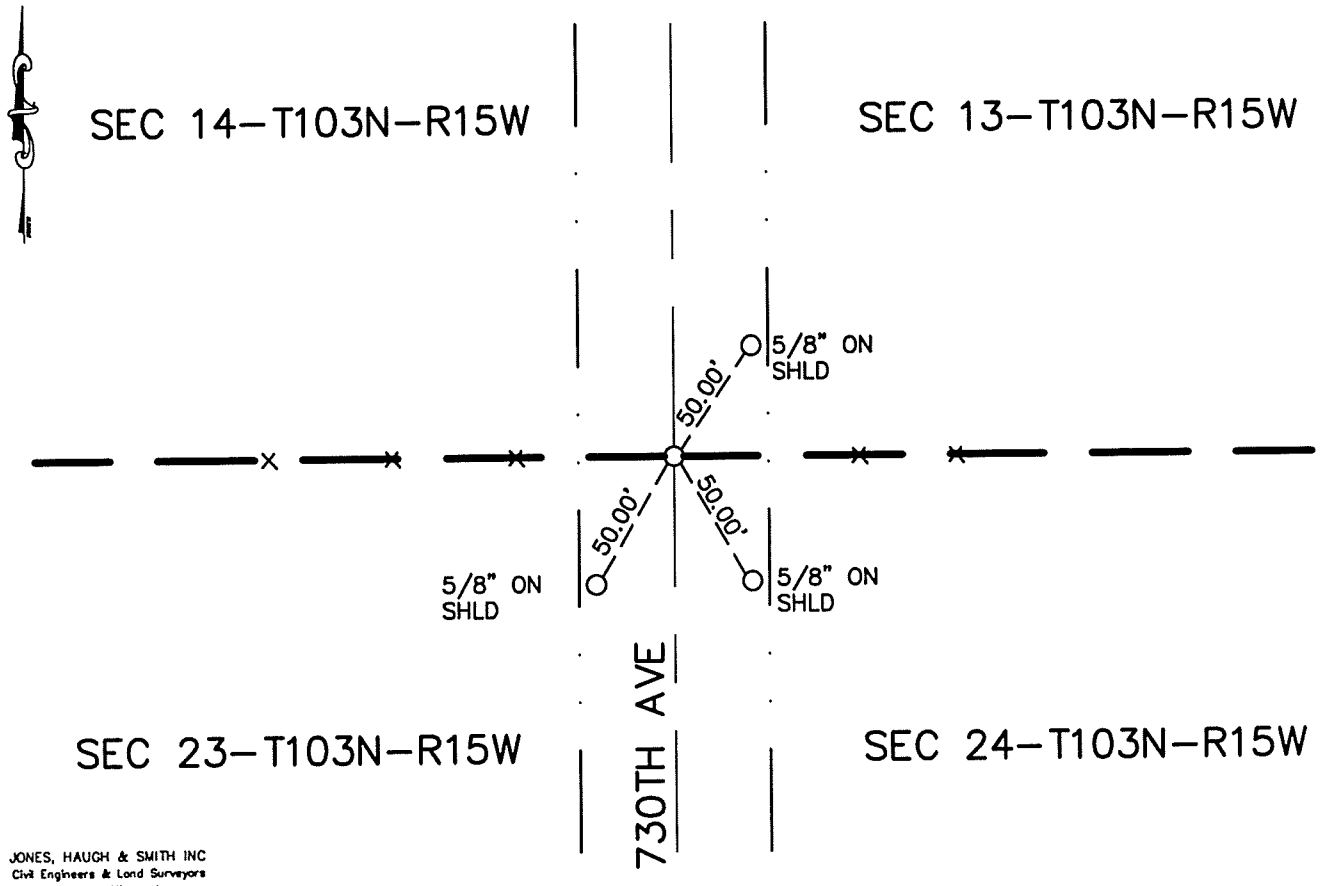

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 6-11-03

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 20___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

SW Cor Sec 13-103-15

Deputy Surveyor John Quigley of the U.S. General Land Office originally established this corner in 1853. The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Tucker Land Surveying

1945 Charlie Milner RLS # 1476, did not find a monument for corner. He set a steel rod 4" below existing road surface and located 33.0' east of and in line with corner fence post of fence to west. Simon Olson, property owner to NW indicated this corner fence post to be 33' west of section corner.(6-1-45)

2003 JHS crew dug by hand at location of signal from locator and uncovered a large spike in line with fences east and west on centerline of north and south road.

2003 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug with Mower County backhoe at location of spike and in line with fences east and west. Dug a 4'X12' hole 3' deep, and did not find iron pin. Then placed a 5/8"X16" iron with cap No. 13807 in place of spike 2.5' below road surface. Set 5/8"X16" iron with cast iron monument over capped 5/8" iron six tenths below road surface. Took new ties.

The monument fits occupation and road centerline within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

Revised.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E1/4 Corner of Section 13, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-28-93 (DATE) found a 5/8"ø x 18" IRON AND A 6"ø x 18" CONC MON WITH IRON IN CNT

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 9-25-96 (DATE) placed a 5/8"ø x 16" IRON

SKETCH OF REFERENCE TIES

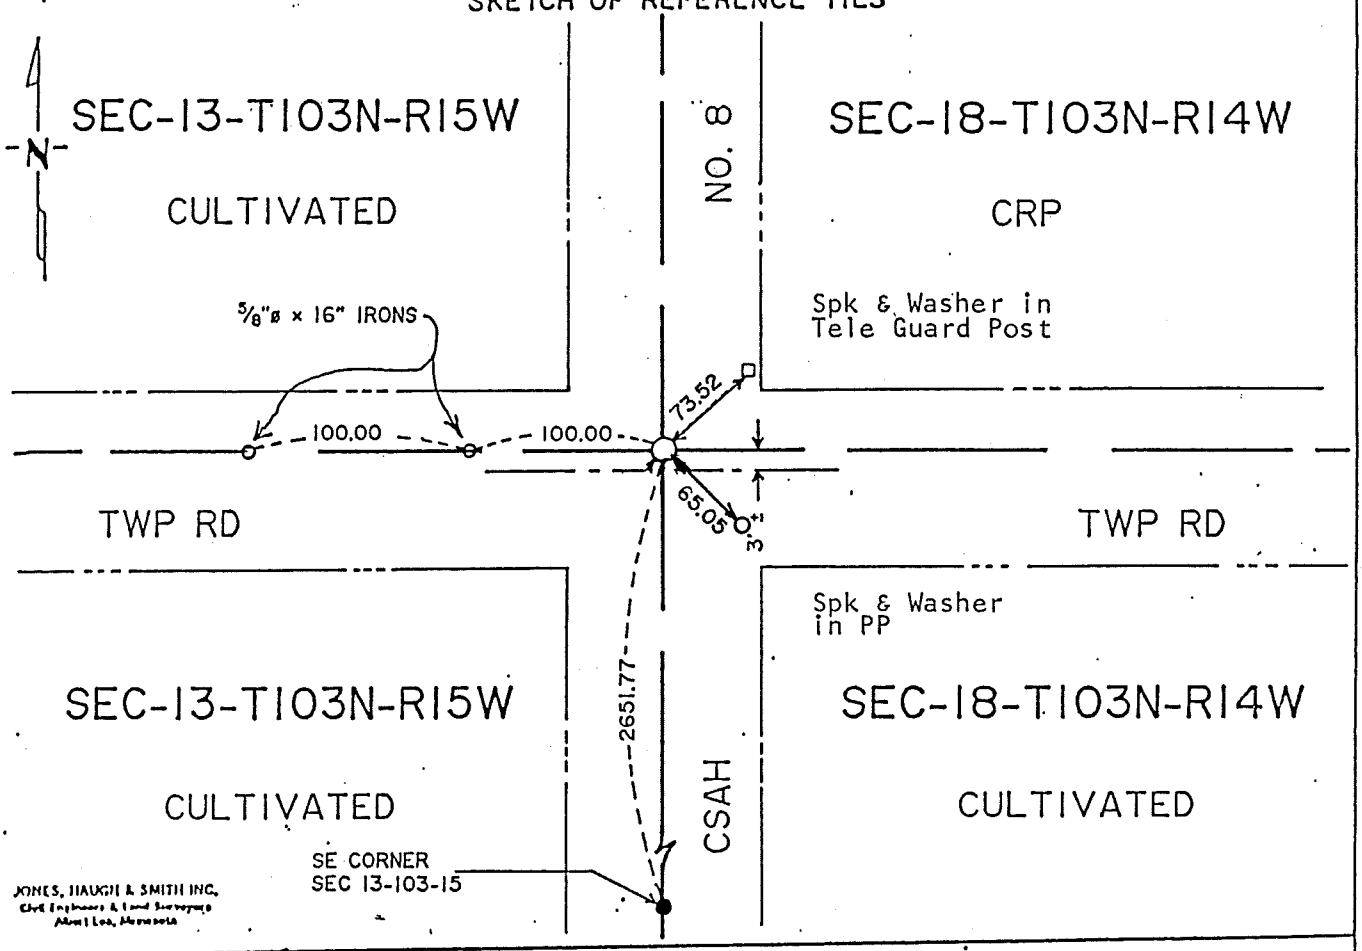

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ SIGNATURE _____ DATE

Registration No. _____

☐ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the ____ day of _____ A.D., 19 ____

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

E 1/4 corner Section 13-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1885 Clausen, Mower County Surveyor, notes indicate a post at this corner.

1945 Mower County Highway Department, Book 1, indicates a clay tile filled with concrete and an iron in center. Monument was set at the split between northeast corner and southeast corner of Section 13 and also on a straight line.

1993 Jones, Haugh & Smith Inc crew under the direction of John Schulte, RLS 13807, dug a 3'x2'x8' long hole with county backhoe on centerline centerline of County State Aid Highway No. 8 and east-west township roads. We found a 5/8" diameter x 18" iron on centerline centerline of said roads six inches below road surface. Continued digging to a depth of two feet and found a 6" diameter clay tile filled with concrete and a 3/8" diameter iron in center. Concrete monument found was three feet north of centerline of east-west township road and one foot west of centerline County State Aid Highway No. 8. Therefore we discarded 5/8" diameter x 18" iron and accepted concrete monument found which is noted in 1945 Mower County Highway Department notes as the perpetuation of the original public land survey corner. We set a 5/8" diameter x 16" iron near road surface and above concrete monument found.

1996 Jones, Haugh & Smith Crew re-set corner from ties.

The monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E1/4 Corner of Section 13, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-28-93 (DATE) found a 5/8"ø x 18" IRON AND A 6"ø x 18" CONC MON WITH IRON IN CNT

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 6-30-93 (DATE) placed a 5/8"ø x 16" IRON

SKETCH OF REFERENCE TIES

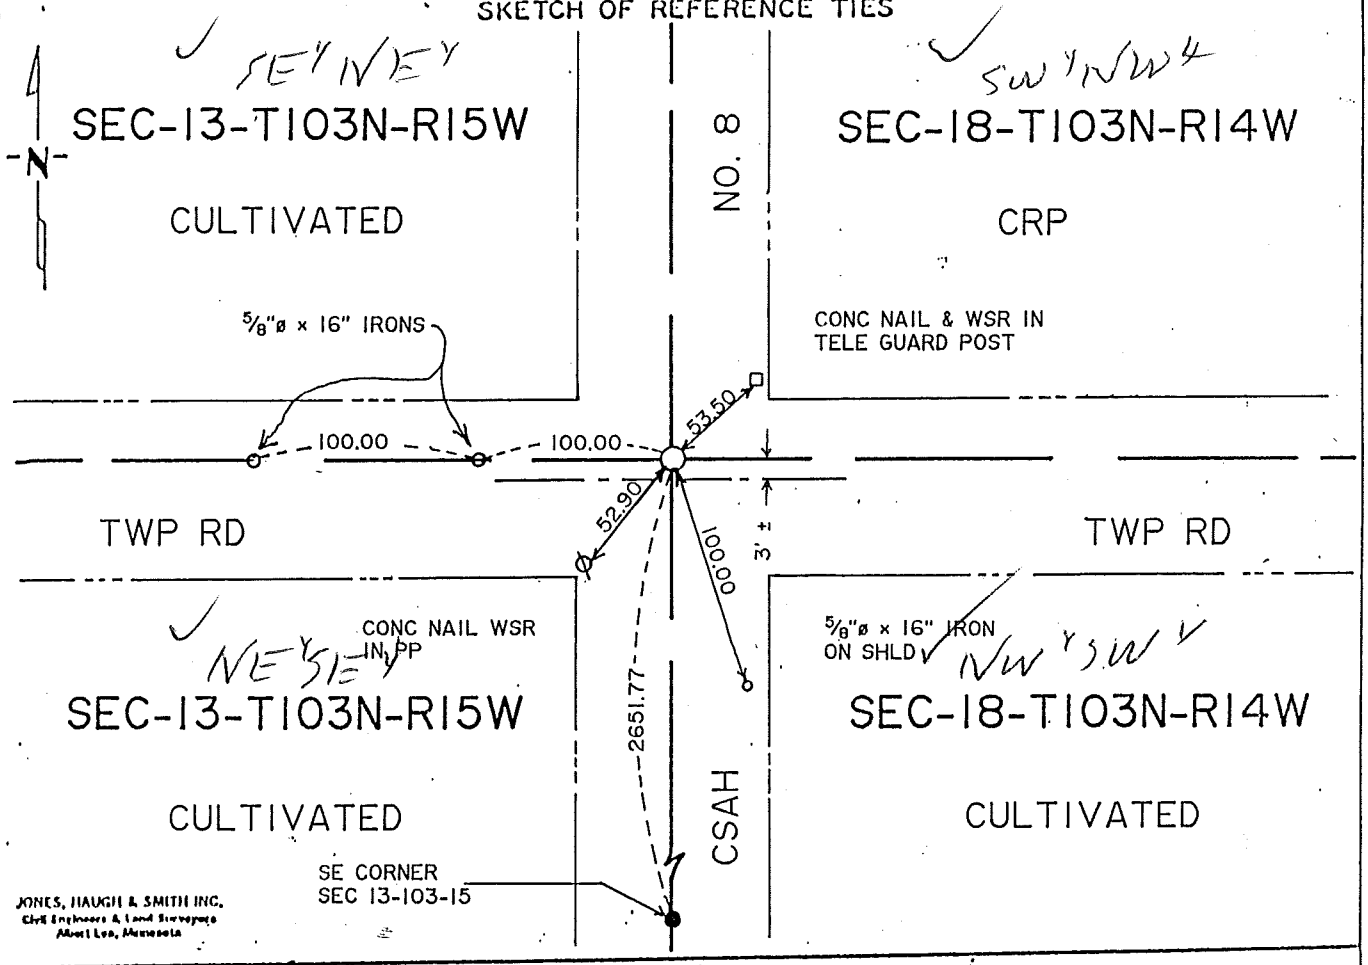

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 7-13-93

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 8 P.M. on the 14 day of July A.D., 1993

COUNTY RECORDER Amanda Enger

By Marlene Marten, Deputy

DOCUMENT NO. 122235

Bk 80 Misc Pg 313

M.H.D. FORM NO. 2105 BOOK 80 PAGE 313

STATEMENT OF EVIDENCE

E 1/4 corner Section 13-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1885 Clausen, Mower County Surveyor, notes indicate a post at this corner.

1945 Mower County Highway Department, Book 1, indicates a clay tile filled with concrete and an iron in center. Monument was set at the split between northeast corner and southeast corner of Section 13 and also on a straight line.

1993 Jones, Haugh & Smith Inc crew under the direction of John Schulte, RLS 13807, dug a 3'x2'x8' long hole with county backhoe on centerline centerline of County State Aid Highway No. 8 and east-west township roads. We found a 5/8" diameter x 18" iron on centerline centerline of said roads six inches below road surface. Continued digging to a depth of two feet and found a 6" diameter clay tile filled with concrete and a 3/8" diameter iron in center. Concrete monument found was three feet north of centerline of east-west township road and one foot west of centerline County State Aid Highway No. 8. Therefore we discarded 5/8" diameter x 18" iron and accepted concrete monument found which is noted in 1945 Mower County Highway Department notes as the perpetuation of the original public land survey corner. We set a 5/8" diameter x 16" iron near road surface and above concrete monument found.

The monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

BOOK 80 PAGE 314

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E1/4 Corner of Section 13, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-28-93 (DATE) found a 5/8"ø x 18" IRON AND A 6"ø x 18" CONC MON WITH IRON IN CNT

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 9-25-96 (DATE) placed a 5/8"ø x 16" IRON

SKETCH OF REFERENCE TIES

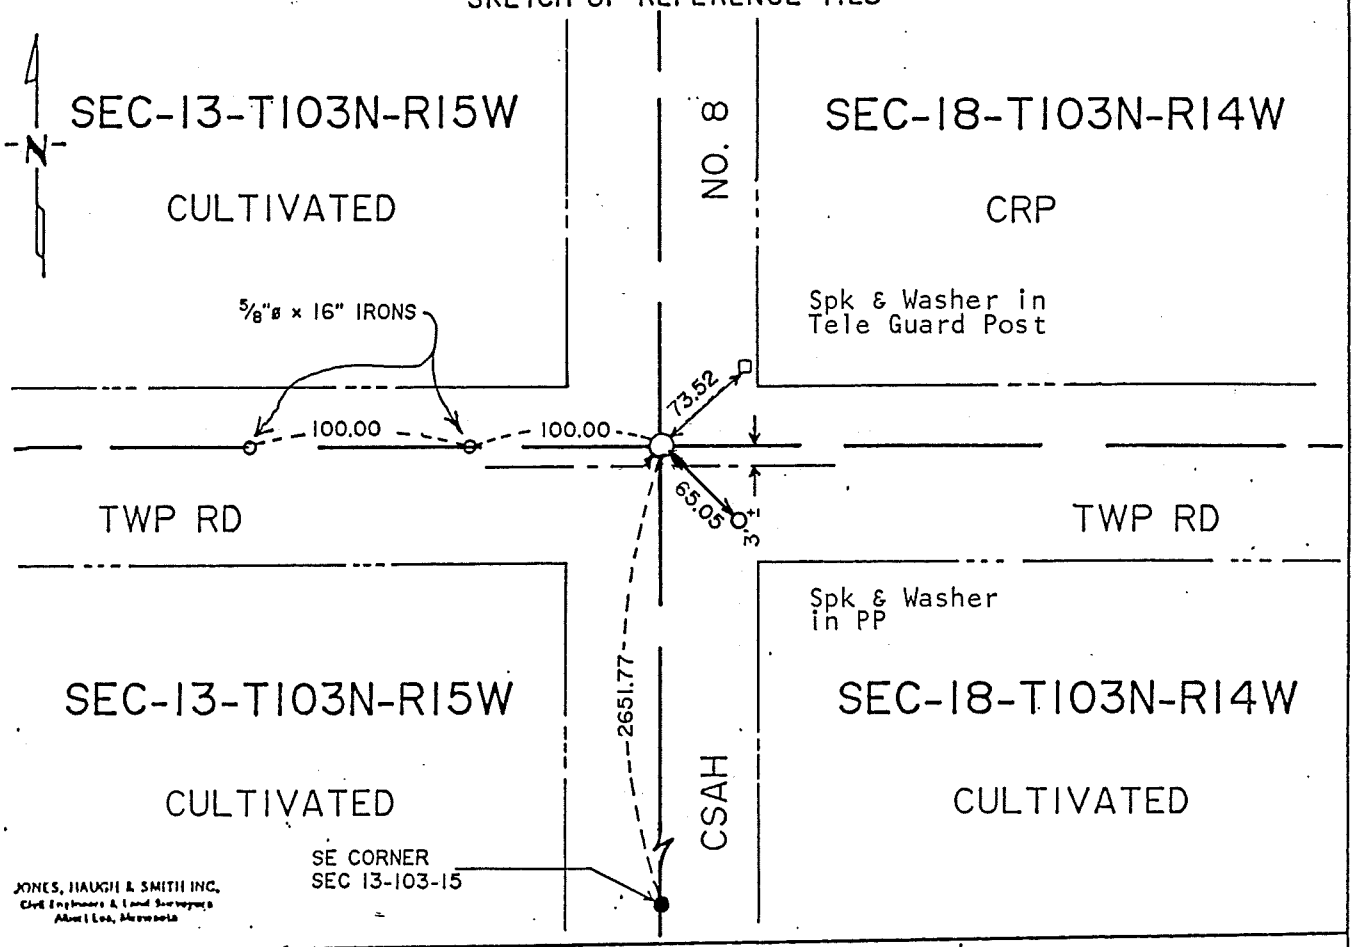

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ 9-27-96
SIGNATURE DATE

Registration No. 15807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19 ___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

E 1/4 corner Section 13-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1885 Clausen, Mower County Surveyor, notes indicate a post at this corner.

1945 Mower County Highway Department, Book 1, indicates a clay tile filled with concrete and an iron in center. Monument was set at the split between northeast corner and southeast corner of Section 13 and also on a straight line.

1993 Jones, Haugh & Smith Inc crew under the direction of John Schulte, RLS 13807, dug a 3'x2'x8' long hole with county backhoe on centerline centerline of County State Aid Highway No. 8 and east-west township roads. We found a 5/8" diameter x 18" iron on centerline centerline of said roads six inches below road surface. Continued digging to a depth of two feet and found a 6" diameter clay tile filled with concrete and a 3/8" diameter iron in center. Concrete monument found was three feet north of centerline of east-west township road and one foot west of centerline County State Aid Highway No. 8. Therefore we discarded 5/8" diameter x 18" iron and accepted concrete monument found which is noted in 1945 Mower County Highway Department notes as the perpetuation of the original public land survey corner. We set a 5/8" diameter x 16" iron near road surface and above concrete monument found.

1996 Jones, Haugh & Smith Crew re-set corner from ties.

The monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

Revised

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 13, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-28-93 (DATE) found a 3/4"ø x 16" IRON AND A 6"ø x 18" CONC MONUMENT

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 9-25-96 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

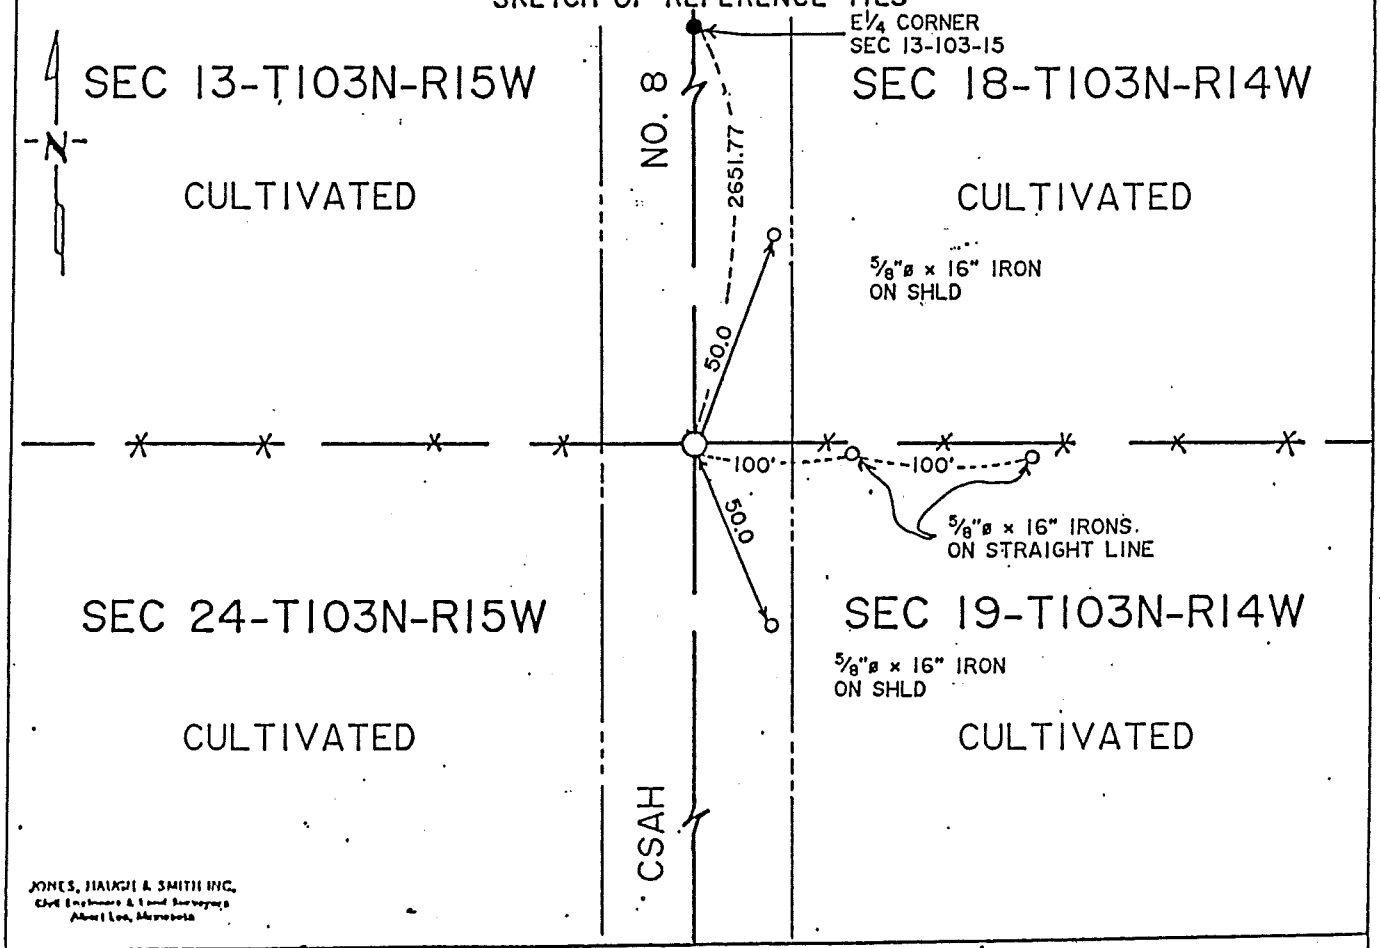

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ SIGNATURE _____ DATE

Registration No. _____

☐ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

SE corner Section 13-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1885 Clausen, Mower County Surveyor, notes indicate a stone at this location.

1945 Mower County Highway Department, Book 1, indicates a 6" diameter concrete monument with iron in center and a one inch diameter pipe above concrete monument.

1979 Jones, Haugh & Smith Inc crew found a 3/4" diameter pipe at this location.

1993 Jones, Haugh & Smith Inc crew under the direction of John Schulte, RLS 13807, dug a 3'x4'x5' long hole with county backhoe on the centerline of County State Aid Highway No. 8 and inline with east-west line fences. We found a 3/4" diameter x 16" pipe four inches below road surface and a 6" diameter x 18" clay tile filled with concrete and a 3/8" diameter iron in center which was at a depth of four feet and inline with east-west line fences. Therefore we accepted concrete monument noted in above said information as the perpetuation of this corner and set a cast iron monument near road surface above concrete monument found.

1996 Jones, Haugh & Smith Inc crew re-set corner from ties.

The monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 13, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-28-93 (DATE) found a 3/4"ø x 16" IRON AND A 6"ø x 18" CONC MONUMENT

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 9-25-96 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

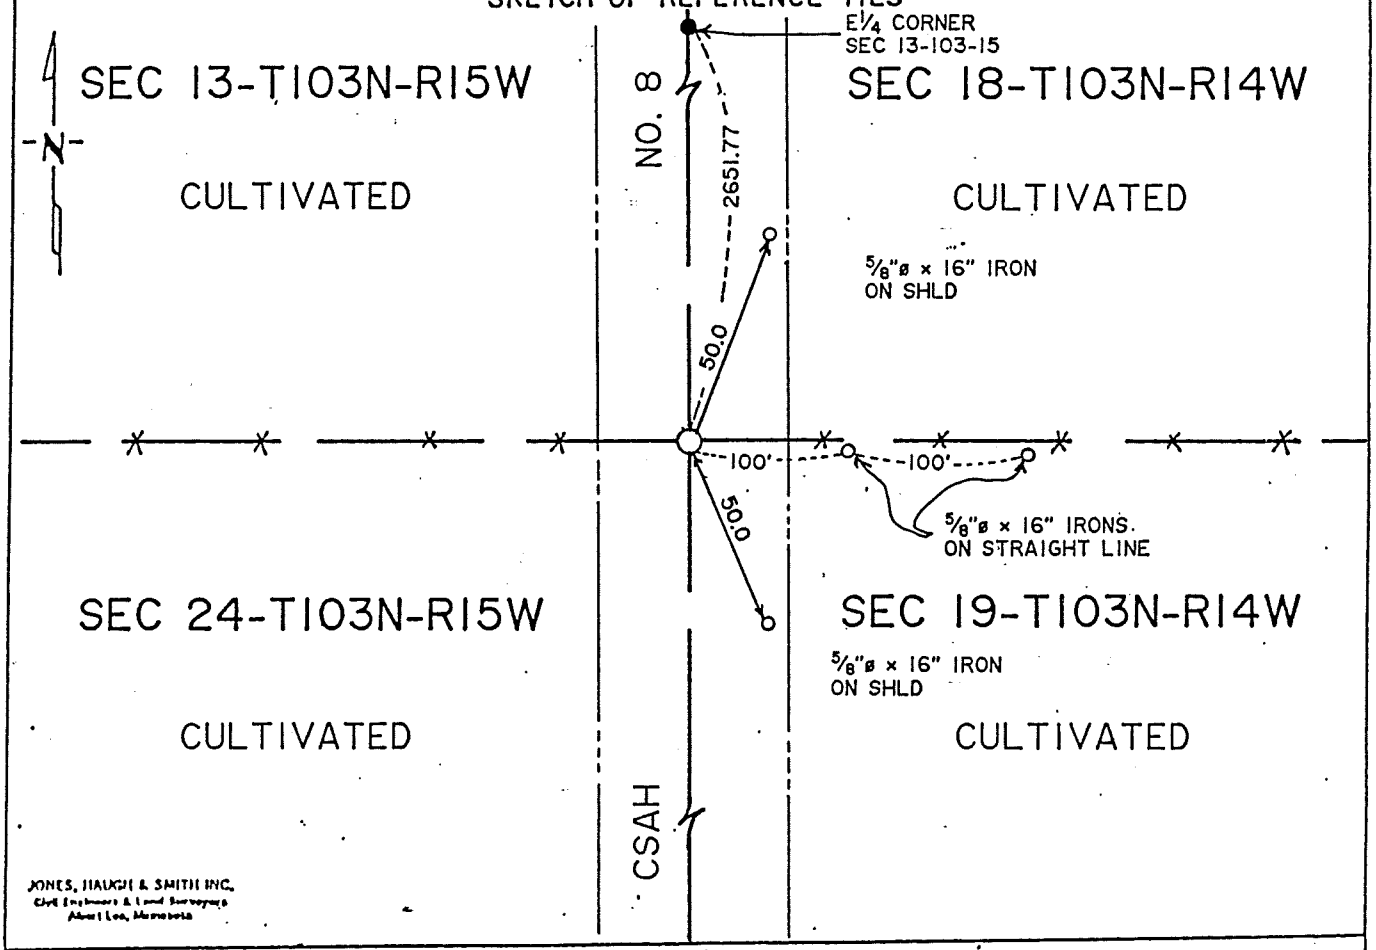

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 9-27-96

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the ____ day of _____ A.D., 19 ___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

SE corner Section 13-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1885 Clausen, Mower County Surveyor, notes indicate a stone at this location.

1945 Mower County Highway Department, Book 1, indicates a 6" diameter concrete monument with iron in center and a one inch diameter pipe above concrete monument.

1979 Jones, Haugh & Smith Inc crew found a 3/4" diameter pipe at this location.

1993 Jones, Haugh & Smith Inc crew under the direction of John Schulte, RLS 13807, dug a 3'x4'x5' long hole with county backhoe on the centerline of County State Aid Highway No. 8 and inline with east-west line fences. We found a 3/4" diameter x 16" pipe four inches below road surface and a 6" diameter x 18" clay tile filled with concrete and a 3/8" diameter iron in center which was at a depth of four feet and inline with east-west line fences. Therefore we accepted concrete monument noted in above said information as the perpetuation of this corner and set a cast iron monument near road surface above concrete monument found.

1996 Jones, Haugh & Smith Inc crew re-set corner from ties.

The monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 13, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-28-93 (DATE) found a 3/4"ø x 16" IRON AND A 6"ø x 18" CONC MONUMENT

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-28-93 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

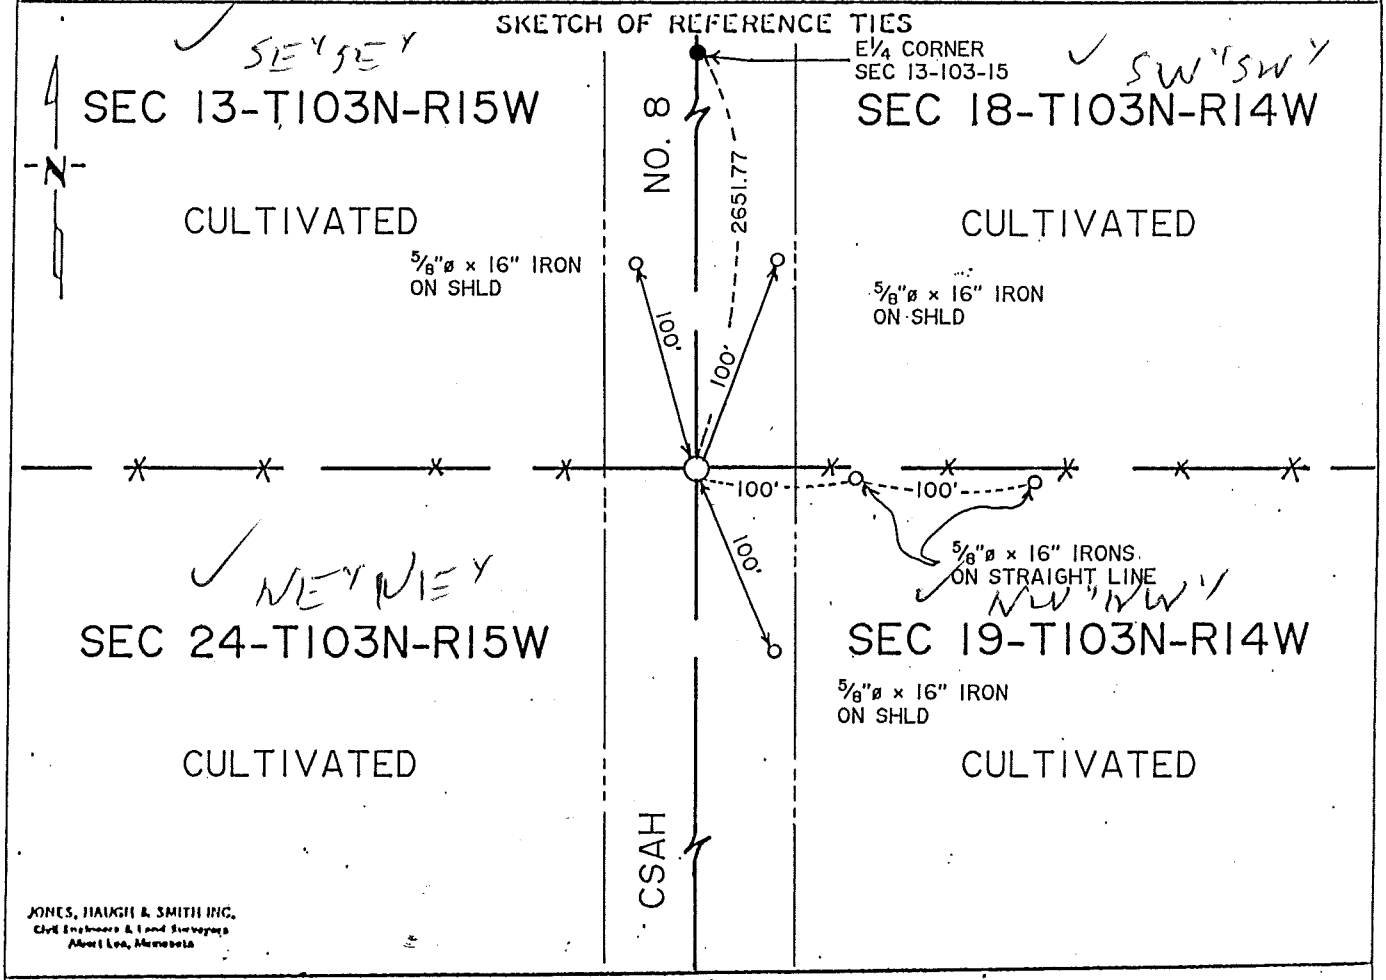

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 7-13-93

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 8:00 P.M. on the 14 day of July A.D., 19 93

COUNTY RECORDER Susanne Engen

By Marlene Marten, Deputy

DOCUMENT NO. 422834

Bk 80 Misc Pg. 311

M.H.D. FORM NO. 2105

BOOK 80 PAGE 311

STATEMENT OF EVIDENCE

SE corner Section 13-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1885 Clausen, Mower County Surveyor, notes indicate a stone at this location.

1945 Mower County Highway Department, Book 1, indicates a 6" diameter concrete monument with iron in center and a one inch diameter pipe above concrete monument.

1979 Jones, Haugh & Smith Inc crew found a 3/4" diameter pipe at this location.

1993 Jones, Haugh & Smith Inc crew under the direction of John Schulte, RLS 13807, dug a 3'x4'x5' long hole with county backhoe on the centerline of County State Aid Highway No. 8 and inline with east-west line fences. We found a 3/4" diameter x 16" pipe four inches below road surface and a 6" diameter x 18" clay tile filled with concrete and a 3/8" diameter iron in center which was at a depth of four feet and inline with east-west line fences. Therefore we accepted concrete monument noted in above said information as the perpetuation of this corner and set a cast iron monument near road surface above concrete monument found.

The monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

"C" TIE BOOK P102

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

North Quarter Corner of Section 16, Township 103N, Range 15W, 5th P.M. STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☒ On June 1983 found a 4" diameter cast iron monument, and a 8"x10"x 6" stone with a wood stake below, raised the cast iron to surface.
☒ left monument as found, ☐ lowered monument, ☐ removed monument (expl.)

☐ On _____ placed a _____

_____

SKETCH OF REFERENCE TIES

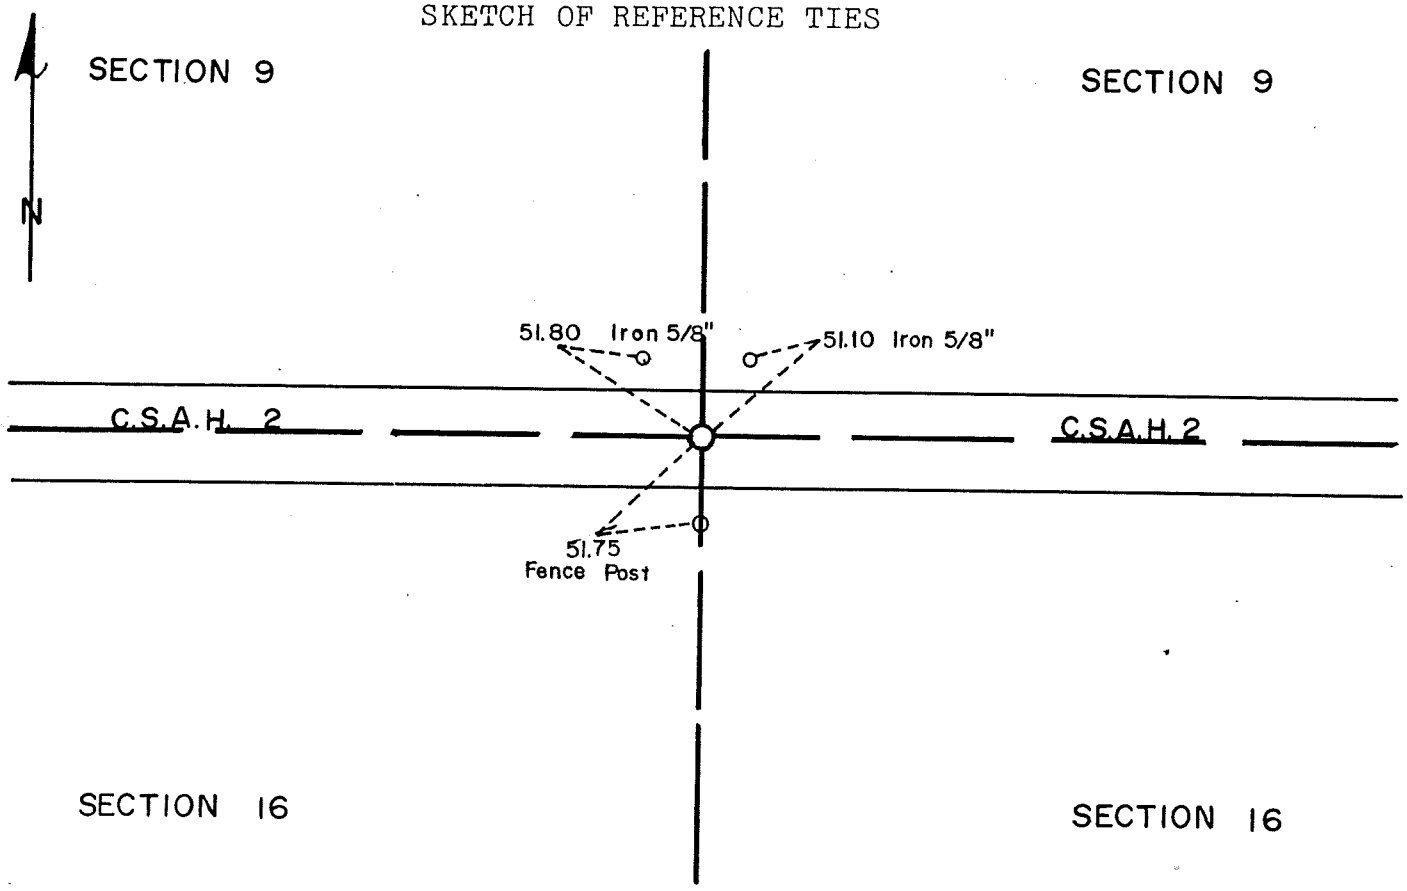

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Raymond J Tacker — Signature
Aug. 29, 1984 — Date

Registration No. 15471
☒ Land Surveyor, ☐ Prof. Engineer
☐ County Surveyor, ☐ County Engr.

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Recorders office at _____.M. on the ___ day of _____ A.D., 19____.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

STATEMENT OF EVIDENCE:

NORTH QUARTER CORNER SECTION 16 - T103N - R15W

1853 - John Quigley, Deputy Surveyor, set a post and built a mound and placed a handful of small stones in the center during the original public land survey.

1930 - Mower County Highway Department notes show a inplace monument during a survey on C.A.R. C-8 (now C.S.A.H. #2).

1960 - Mower County Highway Department notes show a inplace concrete monument during a survey on C.S.A.H. #2.

1980 - Mower County Highway Department notes show a found concrete monument and placed a car valve over.

1983 - R. J. Tucker, RLS, assisted by Mower County Highway Department personnel found a 4" diameter cast iron monument and a 8"x10"x6" stone and a wood stake below, the cast iron monument was raised to the surface.

The above corner agrees with a electronic survey made of monuments and occupation lines in the area and is accepted as a perpetuation of the public land survey corner.

For details of the analysis and electronic survey data contact: Tucker Land Surveying, Dexter, Minnesota 55926.

"L" SEE TIE BOOK P102

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


Northeast Corner of Section 17, Township 103N, Range 15W, 5th P.M. STATE OF MINNESOTA, County of Mower

At the corner location shown on the sketch:

☒ On June 1983 found a 4" diameter cast iron monument, and a concrete cylinder with a rebar in the center below, raised cast iron to surface.
☒ left monument as found, ☐ lowered monument, ☐ removed monument (expl.)

☐ On _____ placed a _____

SKETCH OF REFERENCE TIES

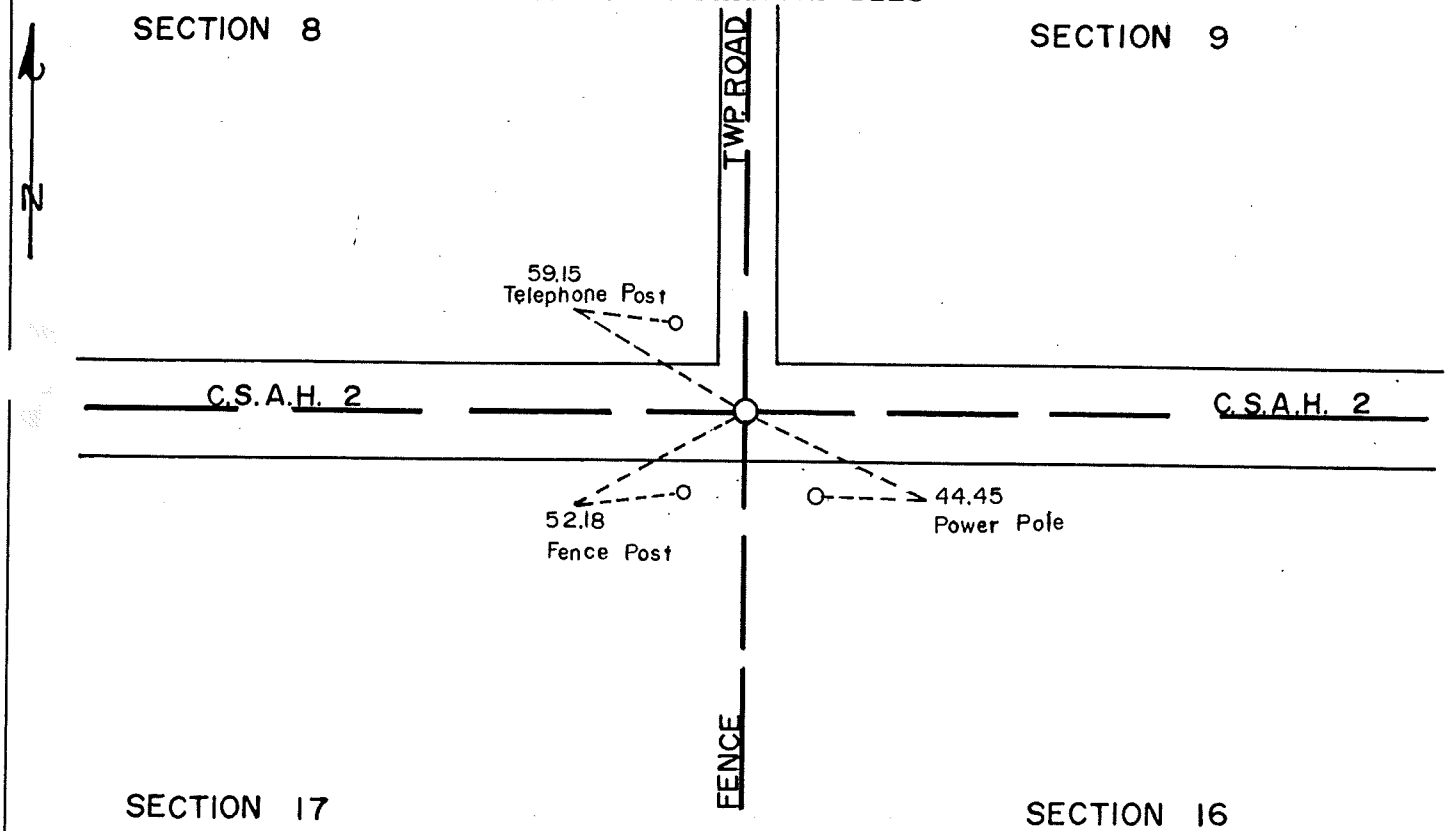

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Raymond J. Tucker — Signature
Aug. 29, 1984 — Date

Registration No. 15471
☒ Land Surveyor, ☐ Prof. Engineer
☐ County Surveyor, ☐ County Engr.

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Recorders office at _____.M. on the ___ day of _____ A.D., 19____.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

STATEMENT OF EVIDENCE:

NORTHEAST CORNER SECTION 17 - T103N - R15W

1853 - John Quigley, Deputy Surveyor, set a post and built a mound and placed a handful of small stones in the center during the original public land survey.

1930 - Mower County Highway Department notes show inplace monument during a survey on C.A.R. C-8 (now C.S.A.H. #2).

1960 - Mower County Highway Department notes show a inplace concrete monument during a survey on C.S.A.H. #2.

1980 - Mower County Highway Department notes show a placed 3/4" iron rod over a concrete monument during a survey on C.S.A.H. #2.

1983 - R. J. Tucker, RLS, assisted by Mower County Highway Department personnel found a 4" diameter cast iron monument and a concrete cylinder with a rebar in the center below, the cast iron monument was raised to the surface.

The above corner agrees with a electronic survey made of monuments and occupation lines in the area and is accepted as a perpetuation of the public land survey corner.

For details of the analysis and electronic survey data contact: Tucker Land Surveying, Dexter, Minnesota 55926.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SW Corner of Section 18, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 1966± (DATE) found a 8" FIELD STONE AND 2X2 HUB

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 7-14-03 (DATE) placed a CIM WITH SURVEYOR MARKER

SKETCH OF REFERENCE TIES

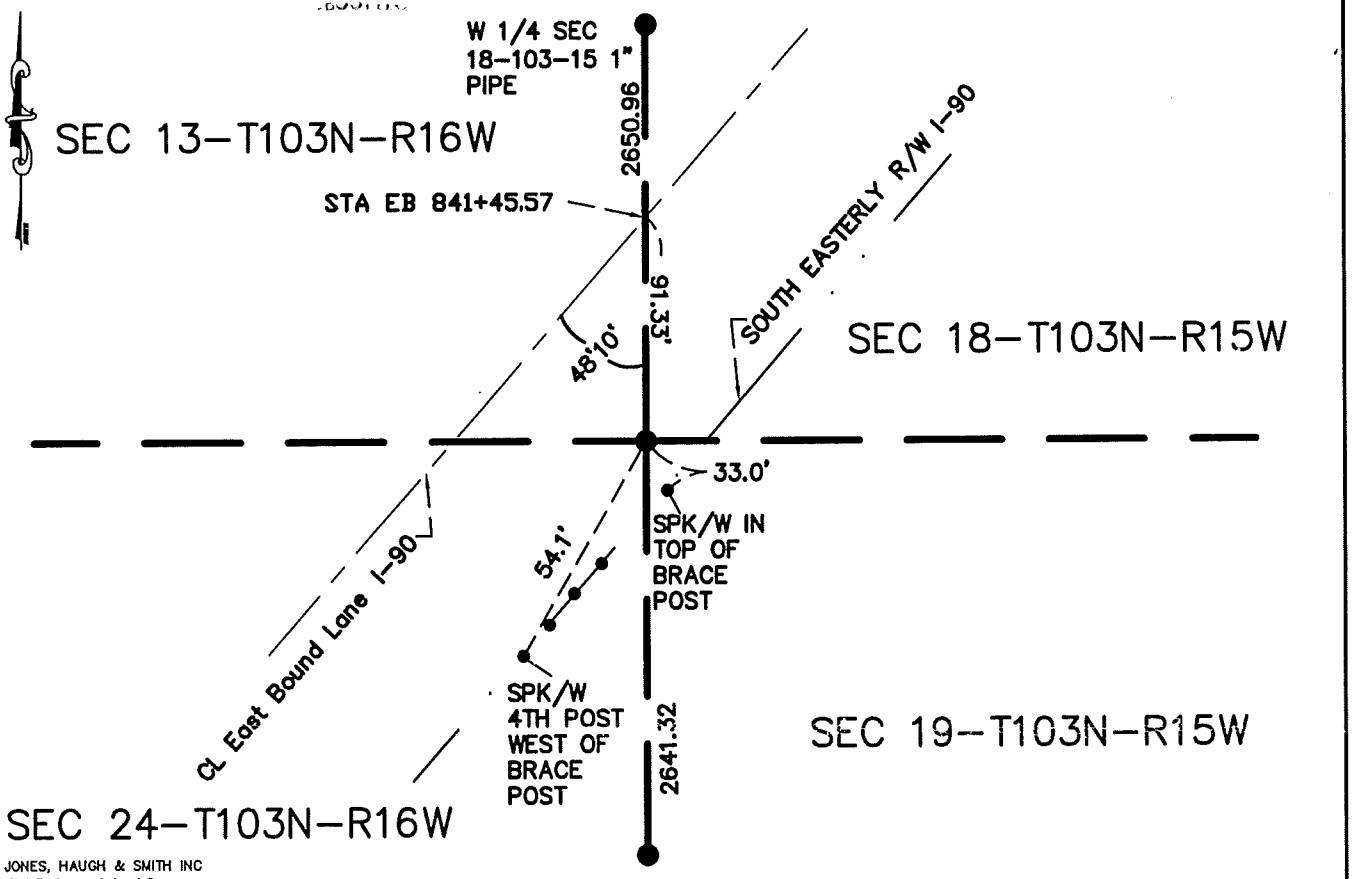

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 8-21-03

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 20___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

SW Cor Sec 18-103-15

Deputy Surveyor William I. Anderson of the U.S. General Land Office originally established this corner in 1854. The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Tucker Land Surveying

1974 MNDOT I-90 R/w map shows 8" fieldstone and 2X2 hub ~~at corner~~ 91.33' south or station 841+45.57.

2003 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807. Searched the area and found no evidence of stone. Corner was reset from MNDOT stationing on I-90 R/W map at an angle of 48 degrees 10 minutes turned from south west to south from centerline of east bound lane I-90 91.33' south of station 841+45.57.

The monument is in agreement with the record and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

"A" SECTIC BOOK P-102

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 18, Township 103N, Range 15W, 5th P.M. STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☒ On June 1983 found a 4" diameter cast iron monument, and a concrete cylinder with a rebar in the center below, raised cast iron to surface.
☒ left monument as found, ☐ lowered monument, ☐ removed monument (expl.)

☐ On _____ placed a _____

_____

SKETCH OF REFERENCE TIES

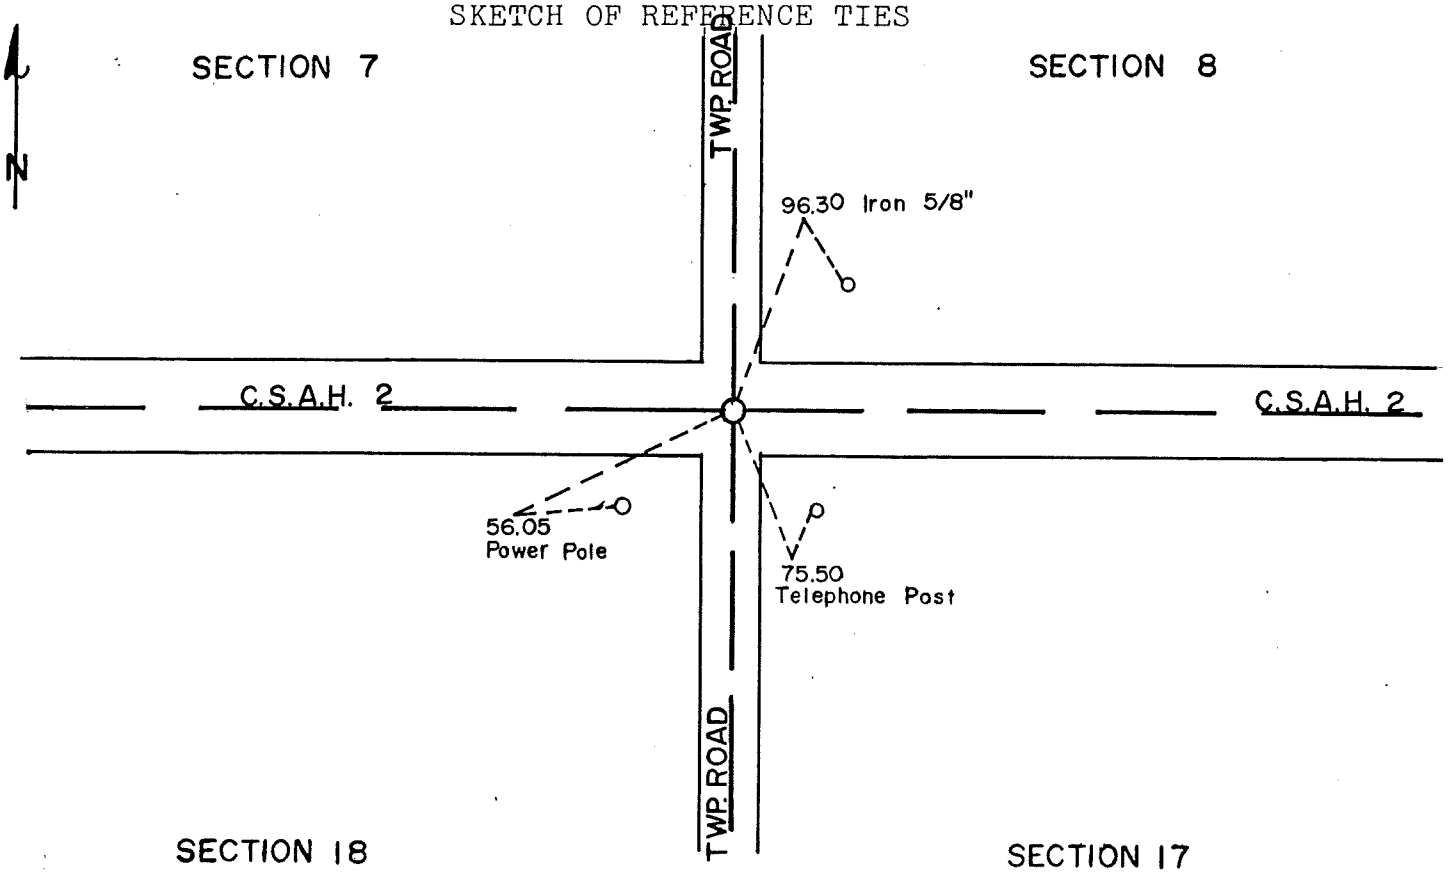

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Raymond J. Tucker — Signature
Aug 29, 1984 — Date

Registration No. 15471
☒ Land Surveyor, ☐ Prof. Engineer
☐ County Surveyor, ☐ County Engr.

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Recorders office at _____.M. on the ___ day of _____ A.D., 19____.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

STATEMENT OF EVIDENCE:

NORTHEAST CORNER SECTION 18 - T103N - R15W

1853 - John Quigley, Deputy Surveyor, set a post and built a mound and placed a handful of small stones in the center during the original public land survey.

1930 - Mower County Highway Department notes show a inplace monument during a survey on C.A.R. C-8 (now C.S.A.H. #2).

1952 - Mower County Highway Department notes show a inplace stone monument.

1957 - Minnesota Highway Department notes show a inplace field stone and placed a 3/4" iron pin above flush with the surface during a survey on Interstate 90.

1960 - Mower County Highway Department notes show a inplace monument during a survey on C.S.A.H. #2.

1980 - Mower County Highway Department notes show a inplace 3/4" iron rod during a survey on C.S.A.H. #2.

1983 - R. J. Tucker, RLS, assisted by Mower County Highway Department personnel found a 4" diameter cast iron monument and a concrete cylinder with a rebar in the center below, the cast iron monument was raised to the surface.

The above corner agrees with a electronic survey made of monuments and occupation lines in the area and is accepted as a perpetuation of the public land survey corner.

For details of the analysis and electronic survey data contact: Tucker Land Surveying, Dexter, Minnesota 55926.

Index No. P 110 [illegible] PR

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter Corner of Section 24, Township 103N, Range 15W, 5th P.M.

STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☒ On 1-9-89 (DATE) found a P.K. Nail flush with bituminous.

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On _____ (DATE) placed a _____

SKETCH OF REFERENCE TIES

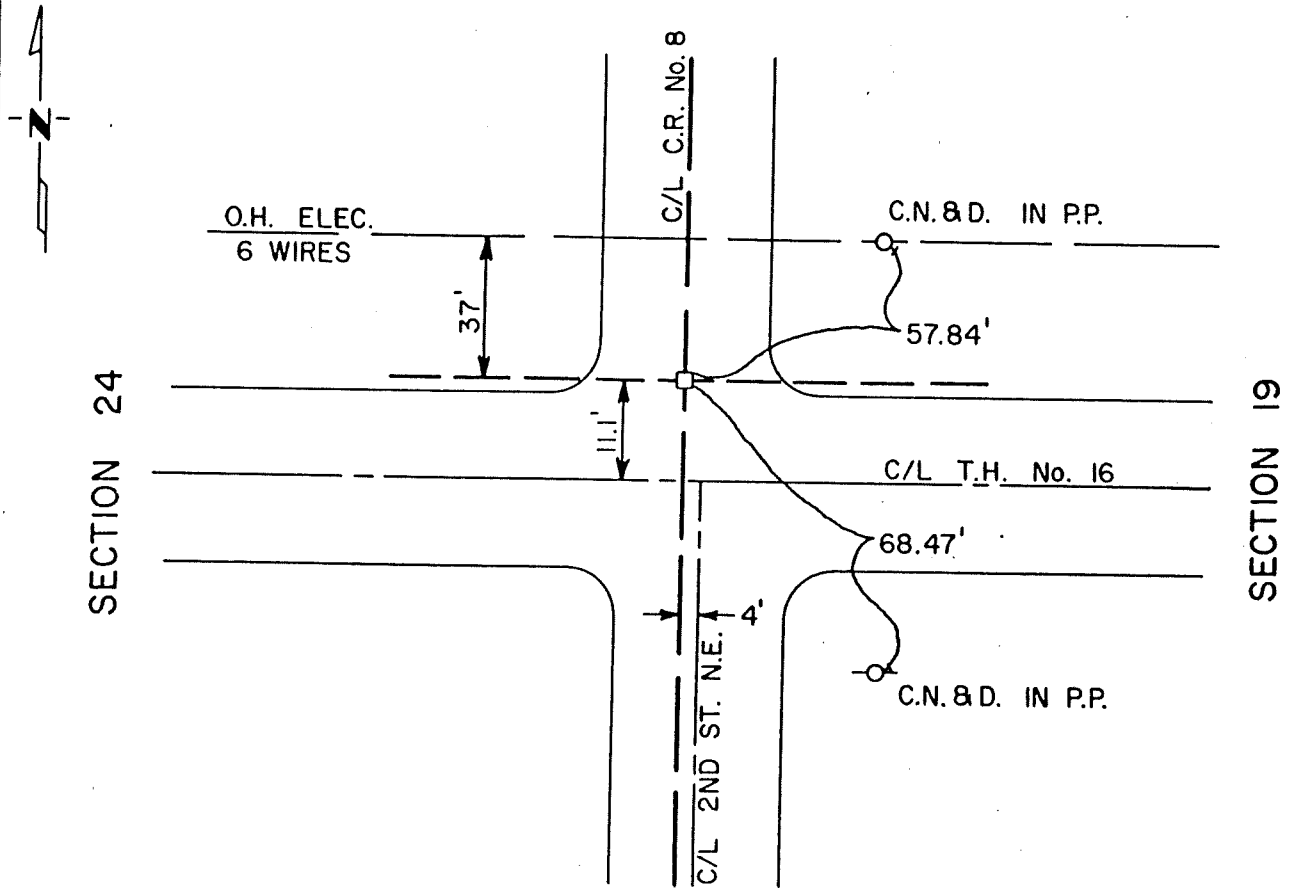

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

[signature] (SIGNATURE) 12/16/89 (DATE)

Registration No. 16162

☒ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the Reg. of Deeds office at _____ .M. on the ____ day of _____ A.D., 19__

Register of Deeds _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

East Quarter Corner of Section 24, Township 103N, Range 15W, 5th P.M.

Statement of Evidence:

July, 1853 — John Ball, U.S. Deputy Surveyor, set a post and put a handful of stones in the center for the corner during the Original Public Land Survey.

Aug., 1877 — G.W. Allen surveyed Proprietors Addition in Grand Meadow and used the East Quarter Corner of Section 24 and the Northeast corner of Section 25 to layout the lots and blocks in the plat.

1932 — Minnesota Highway Department calls for acorner 11.1' No. of T.H. #16 on the centerline of C.R. #8.

March 17, 1983 — MN/DOT found a 1/2" rebar 0.6' below the surface, 11.1' north of the centerline T.H. #16 on centerline of C.R. #8 to the north and 4' west of centerline 2nd Street to the south.

Jan. 9, 1989 — Doug Rude, Yaggy Colby Associates, found a P.K. nail flush with the bituminous that checked the MN/DOT 1983 ties.

An analysis of the record and survey data indicate the MN/DOT position agrees in both directions with the Grand Meadow platted block corners. It agrees with the 1938 Mower County Highway plan. This position is also on a straight line with consistent half mile distances north-south as you would expect on a township line. The P.K. nail over the 1/2" rebar is therefore accepted as a perpetuation of the Original Public Land Corner and marks the East Quarter Corner of Section 24.

For further information, contact Yaggy Colby Associates, Rochester, Minnesota.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E 1/4 Corner of Section 24, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 06/08/1994 (DATE) found a 5/8" ø IRON

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 06/08/1994 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

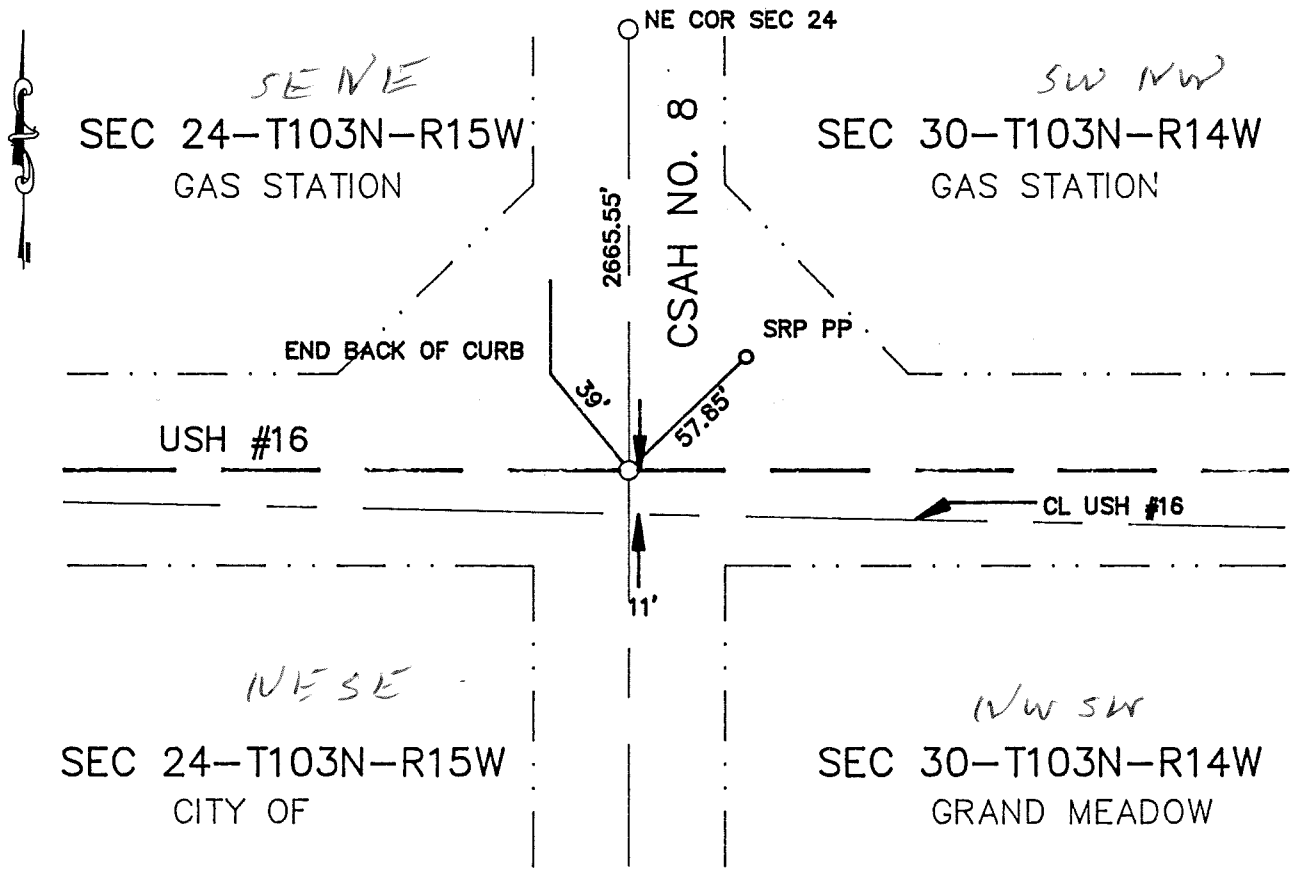

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

BOOK 94 PAGE 35

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 1-17-97

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 5 P.M. on the 23 day of Jan A.D., 1997

COUNTY RECORDER Charles Engen

By Susan M. Davis, Deputy

DOCUMENT NO. 450686

M.H.D. FORM NO. 2105

Book 94 Misc Page 35

E 1/4 Cor SEC 24-103-15

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1853. The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

1930 USH #16 Hwy. plans show a location for this corner and Mower Co. Hwy. Dept. also shows a monument at this location.

1994 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, located a cast iron monument at this location before the reconstruction of CSAH #8 which was in agreement with MnDOT Highway plans and private surveyor C.E. Milner's records. Also in agreement with Mower County Highway Department records, JHS records, and location of found monuments in the city of Grand Meadow.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

Index No. p110 "S"

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 24, Township 103N, Range 15W, 5th P.M.

STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☒ On 10-23-89 (DATE) found a 5" dia. clay pipe 14" long filled with concrete with a 1/2" rod set in the center of the pipe, down 27".

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 10-23-89 (DATE) placed a 3/4" pipe, down 2".

SKETCH OF REFERENCE TIES

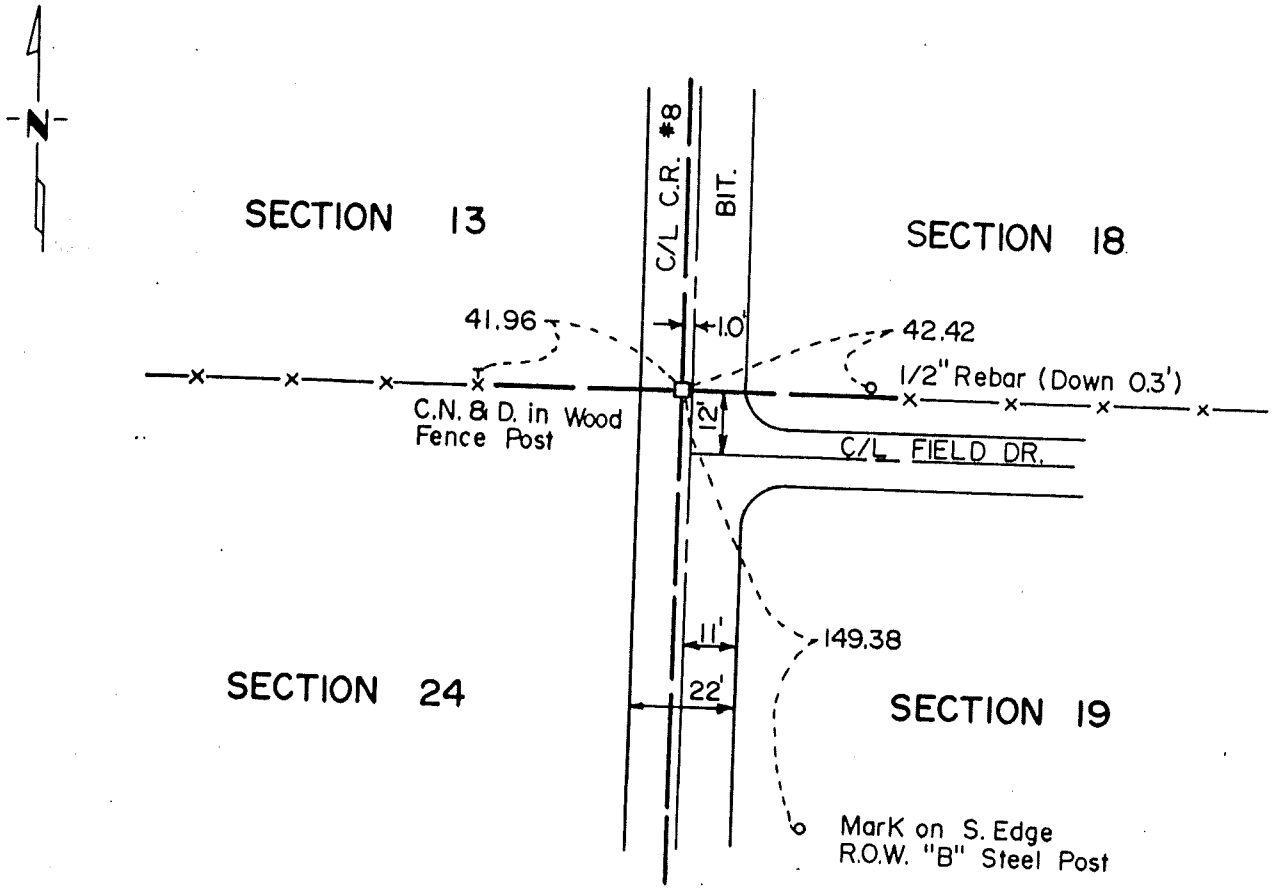

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Signature 12/16/89 (DATE)

Registration No. 1062

☒ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the Reg. of Deeds office at _____ .M. on the _____ day of _____ A.D., 19__

Register of Deeds _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

Northeast Corner Section 24, Township 103 North, Range 15 West, 5th p.m.

Statement of Evidence:

July, 1853	John Ball, U.S. Deputy Surveyor, set a post and put a hand full of stones in the center for the corner during the Original Public Land Survey.
1938	Mower County Engineering Department used occupation lines for the corner and recorded stationing on the 1938 construction plans.
January 9, 1989	D. Rude and crew dug up a red head nail in bituminous on the occupation lines and temporarily accepted.
October 23, 1989	D. Rude and crew excavated a 3' x 5' area centered on the occupation lines. A 5" dia. clay pipe 14" long filled with concrete with a 1/2" rod set in the center of pipe was found 27" down. A 3/4" pipe was set above the monument, 2" below the bituminous surface. An analysis of the record and survey data show this position agrees with the east-west fence lines, the north-south center-line of county road, and within 4' west and south of lost position. Distances between occupation lines today agreed with 1938 Mower Co. Highway plan distances. The clay pipe is, therefore, accepted as a perpetuation of the Original Public Land Corner and is accepted as marking the Northeast Corner of Section 24. For further information, contact Yaggy Colby Associates, Rochester, Minnesota.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

W 1/4 Corner of Section 24, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☒ On 08/07/1998 (DATE) found a PK NAIL (REPLACED)

☐ left monument as found, ☐ lowered monument, ☒ removed monument (explain)

☒ On 08/07/1998 (DATE) placed a 5/8" IRON AND CAP #22705

SKETCH OF REFERENCE TIES

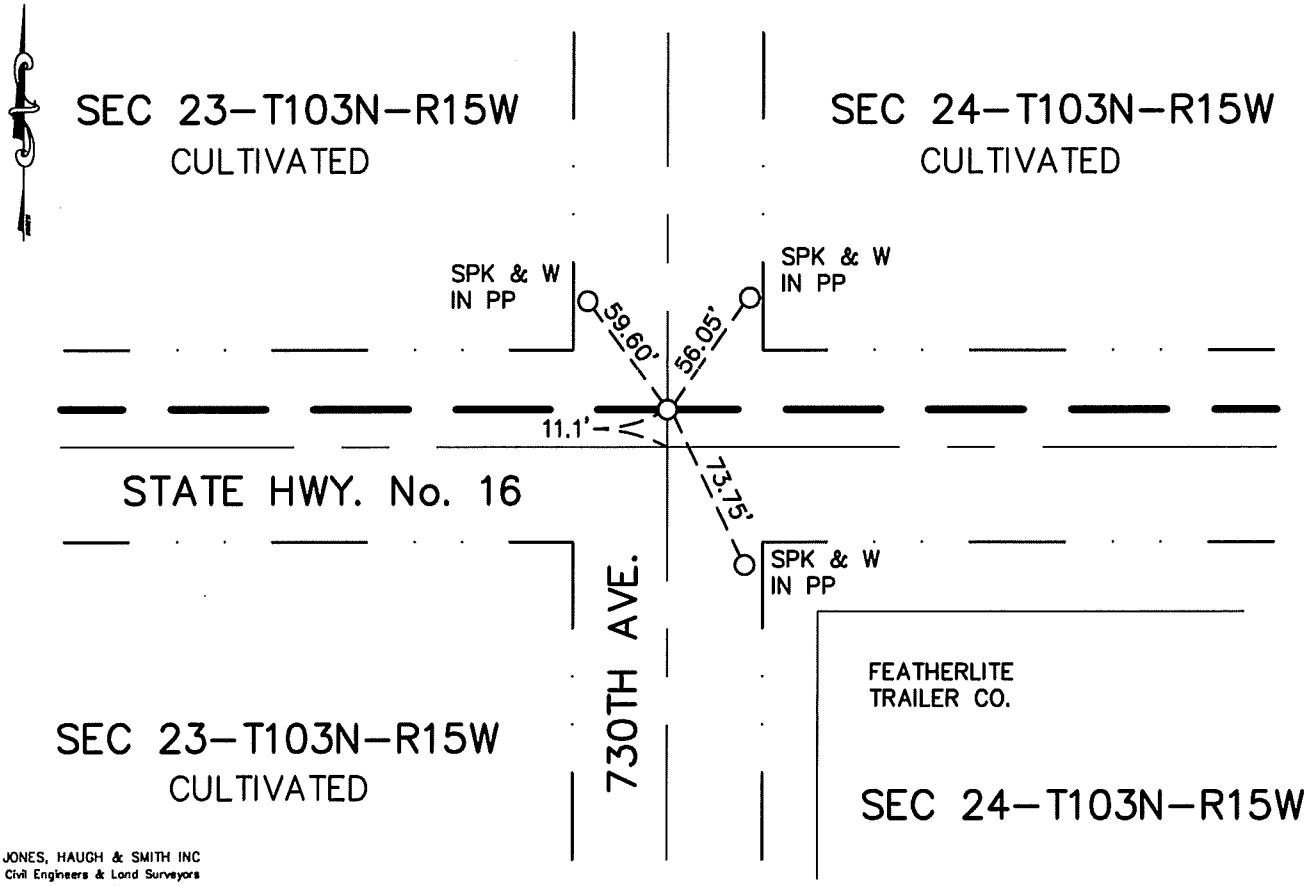

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

_____ 8-3-01
SIGNATURE DATE

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 20___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

W ¼ Cor Sec 24-103-15

Deputy Surveyor John Quigley of the U.S. General Land Office originally established this corner in 1853. The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Tucker Land Surveying

1998 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, located a PK nail 11.1' north of St. Hwy. 16 centerline set by Ray Tucker. Corner is in agreement with DOT Hwy plan. Removed PK nail and placed a 5/8" x 16" iron capped 22705.

2001 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, located 5/8" iron capped 22705. Took new ties.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 25, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 8/21/2002 (DATE) found a CONCRETE MONUMENT WITH IRON PIN

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 8/21/2002 (DATE) placed a CAPPED 5/8" IRON

SKETCH OF REFERENCE TIES

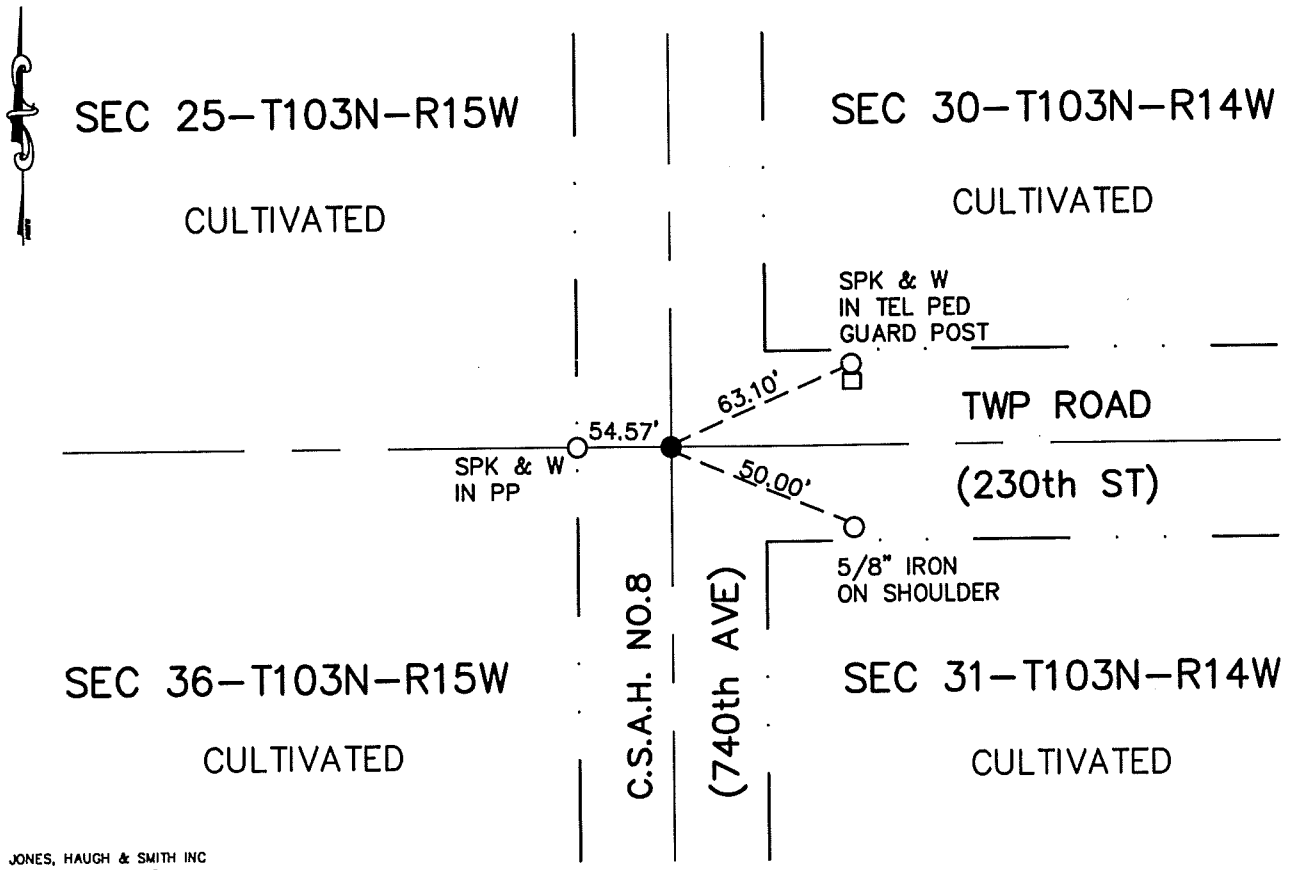

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 9-19-02

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 20___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

SE Cor Sec 25-103-15

Deputy Surveyor John Ball of the U.S. General Land Office originally established this corner in 1853. The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Tucker Land Surveying

Mower County Highway Plan shows a monument at this location.

2002 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug with Mower County backhoe uncovered concrete monument with iron pin in center 2.5 feet more or lesss deep under old road bed. Also large pointed stone on north side. Placed capped 5/8" iron 13807 between monument and stone. Set 5/8" X 16" iron with aluminum monument over monuments found at road surface.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

"4" P 110 TIE BOOK. P 30

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

North Quarter Corner of Section 25, Township 103, Range 15,

5th P.M. STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☐ On 4-3-81 found a 1/2" pipe over a 9" x 9" stone

☒ left monument as found, ☐ lowered monument, ☐ removed monument (expl.)

☐ On 7-30-81 placed a cast iron Monument

SKETCH OF REFERENCE TIES

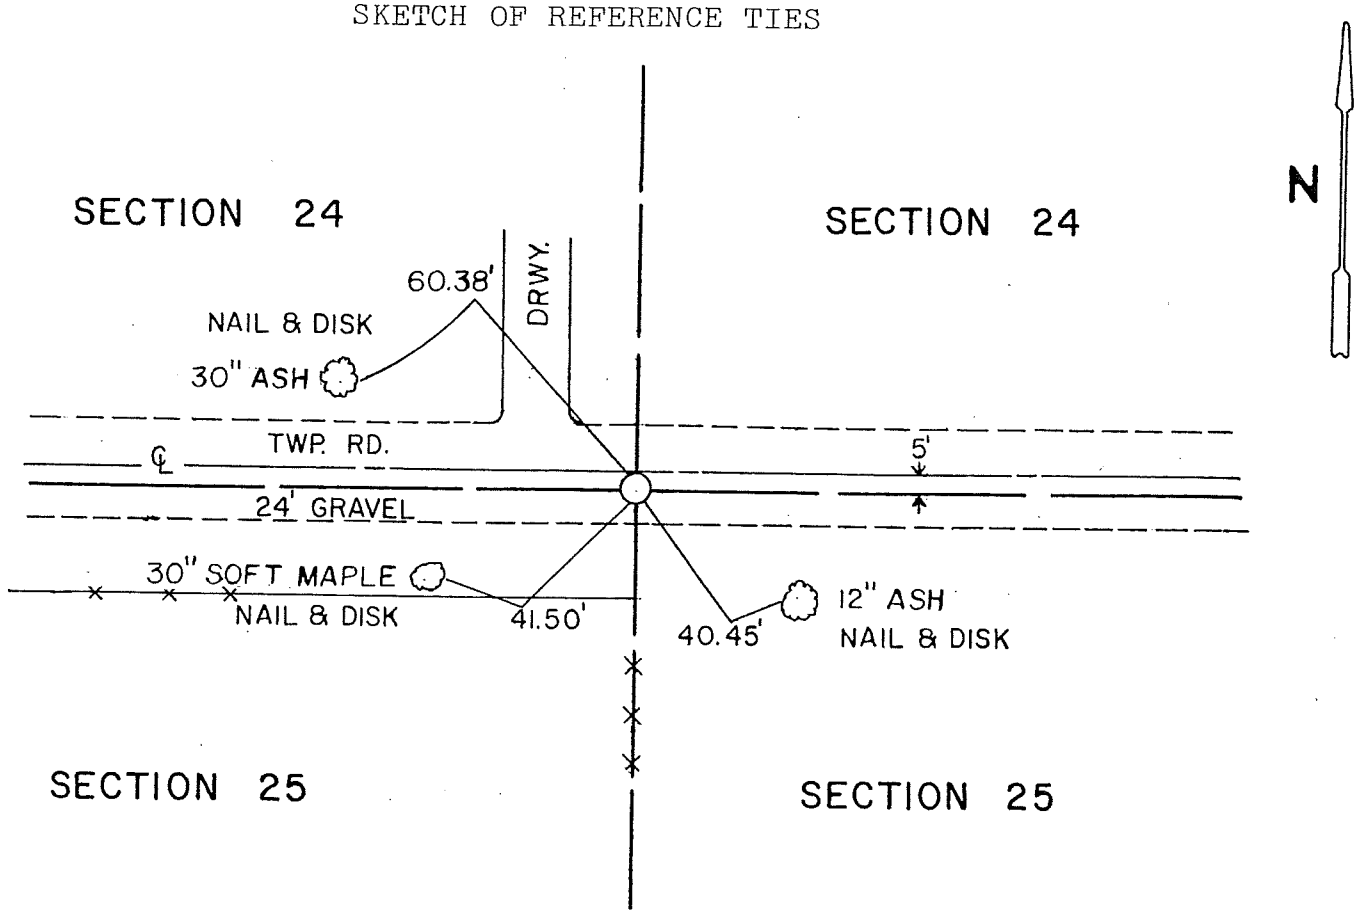

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Ronald J. Olson — Signature

9-2-81 — Date

Registration No. 11009

☒ Land Surveyor, ☒ Prof. Engineer

☐ County Surveyor, ☐ County Engr.

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Recorders office at _____.M. on the ___ day of _____ A.D., 19____.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

Statement of Evidence :

NORTH QUARTER CORNER, SECTION 25, TOWNSHIP 103 NORTH, RANGE 15 WEST, 5th PM

1854 John Quigley, Deputy Surveyor, set the corner during the original Public Land Survey.

Sept. 11, 1946 C. E. Milner, RLS 1476. Did a survey in Section 25 and shows on a certificate of survey a 3/4" pipe over a stone at the North Quarter Corner.

April 3, 1981 Raymond J. Tucker, L.S.I.T., searched the area with a magnetic locator. An excavation was made with the cooperation of the Grand Meadow City Maintenance Department and a 1/2" pipe was found over a 9 inch by 9 inch by 9 inch stone, 4.6 feet below the surface. The excavation was 4 feet N-S by 6 feet E-W by 4.8 feet. The earth under the stone was undisturbed and no other evidence was found. This stone is accepted as a perpetuation of the Public Land Survey. For additional details contact Zenk Engineering, Inc., Albert Lea, Minnesota 56007

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

P73 "L"

EAST QUARTER Corner of Section 30, Township 103N, Range 15 W, 5 P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

On 4-12-89 found A 12" E-W BY 10" N-S BY 7" HIGH STONE

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

On 4-12-89 placed A CTY. CAST IRON MON. OVER STONE

SKETCH OF REFERENCE TIES

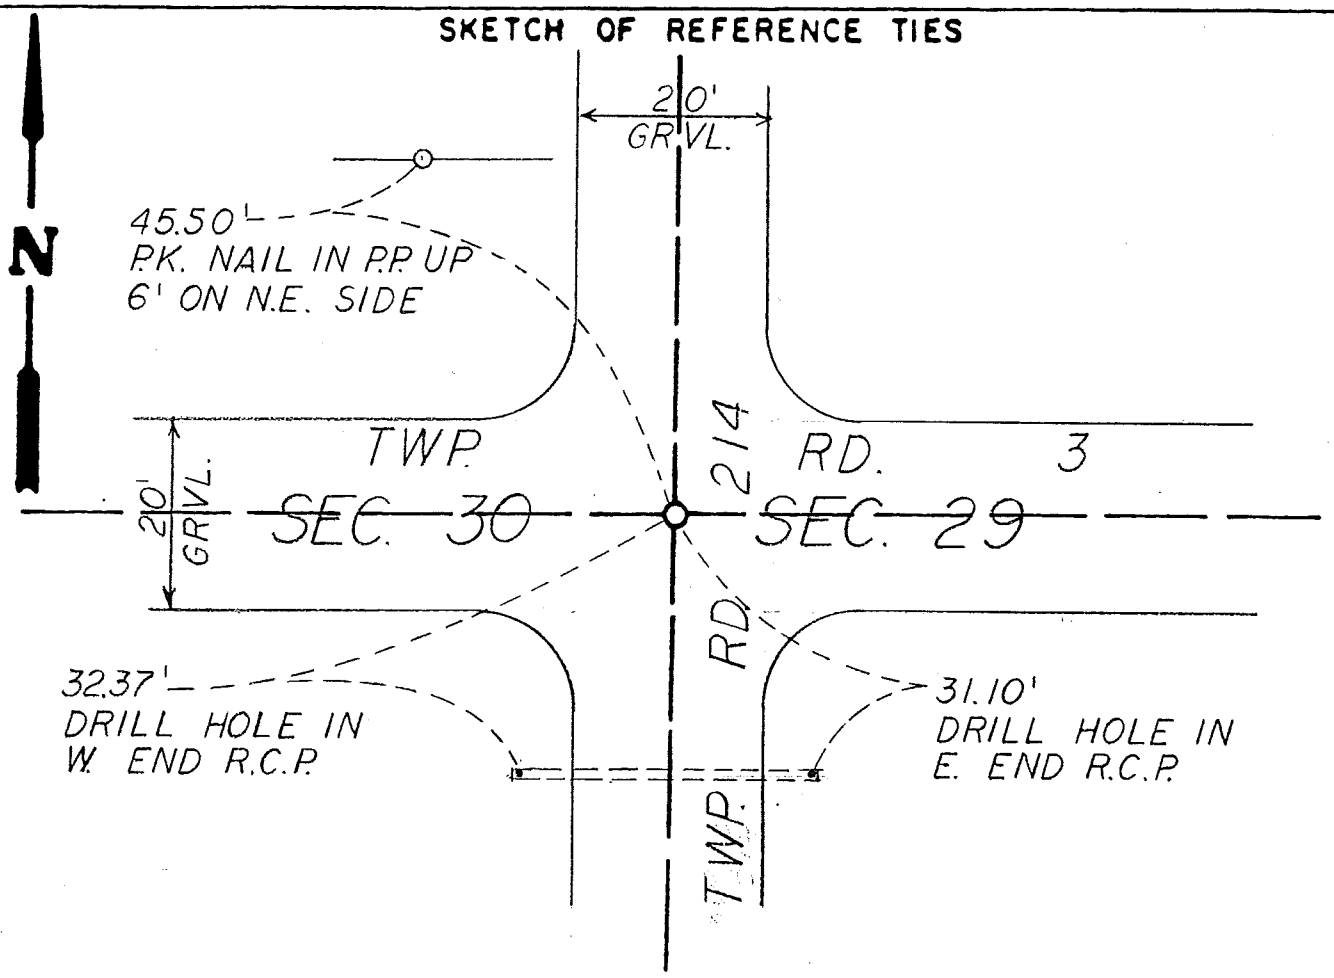

Statement of evidence relative to this corner location is on back of page

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Ronald J. Olson — Signature
7-25-89 — Date

Registration No. 11009

☒ Land Surveyor ☐ Prof Engineer
☐ County Surveyor ☐ County Engineer

Zenk•Read•Trygstad & ASSOCIATES, INC.
Engineers / Architects / Land Surveyors / Planners
Box 689, Albert Lea, MN 56007 507/373-0689

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Recorders office at _____ .M. on the ____ day of _____ A.D., 19___.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

Statement of Evidence

EAST QUARTER CORNER SECTION 30 TOWNSHIP 103 NORTH RANGE 15 WEST 5TH P.M.

July, 1853 — John Quigley, Deputy Surveyor, set qr. sec. post. Built mound with trench per instructions. Put hand full of small stones in center and planted Osage Orange Seeds in SE Corner during the original Public Land Survey.

April 12, 1989 — Ronald J. Olson, RLS 11009, excavated with a backhoe 6 feet square by 5 feet deep to natural ground centered at the intersection of the roads and found a 12" E-W by 10" N-S by 7" high stone 3.6 feet below the surface and below an old roadbed in gravel fill. The stone was found at the center of the intersection.

An analysis of the record data gives no indication of the origin of the stone. It is similar in size to other stones found at other corners in the area and was found to agree with the lines of occupation. The stone is accepted as marking the location of the original Public Land Survey Corner.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

W 1/4 Corner of Section 33, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 01/07/2002 (DATE) found a 1/2" IRON

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On _____ (DATE) placed a _____

SKETCH OF REFERENCE TIES

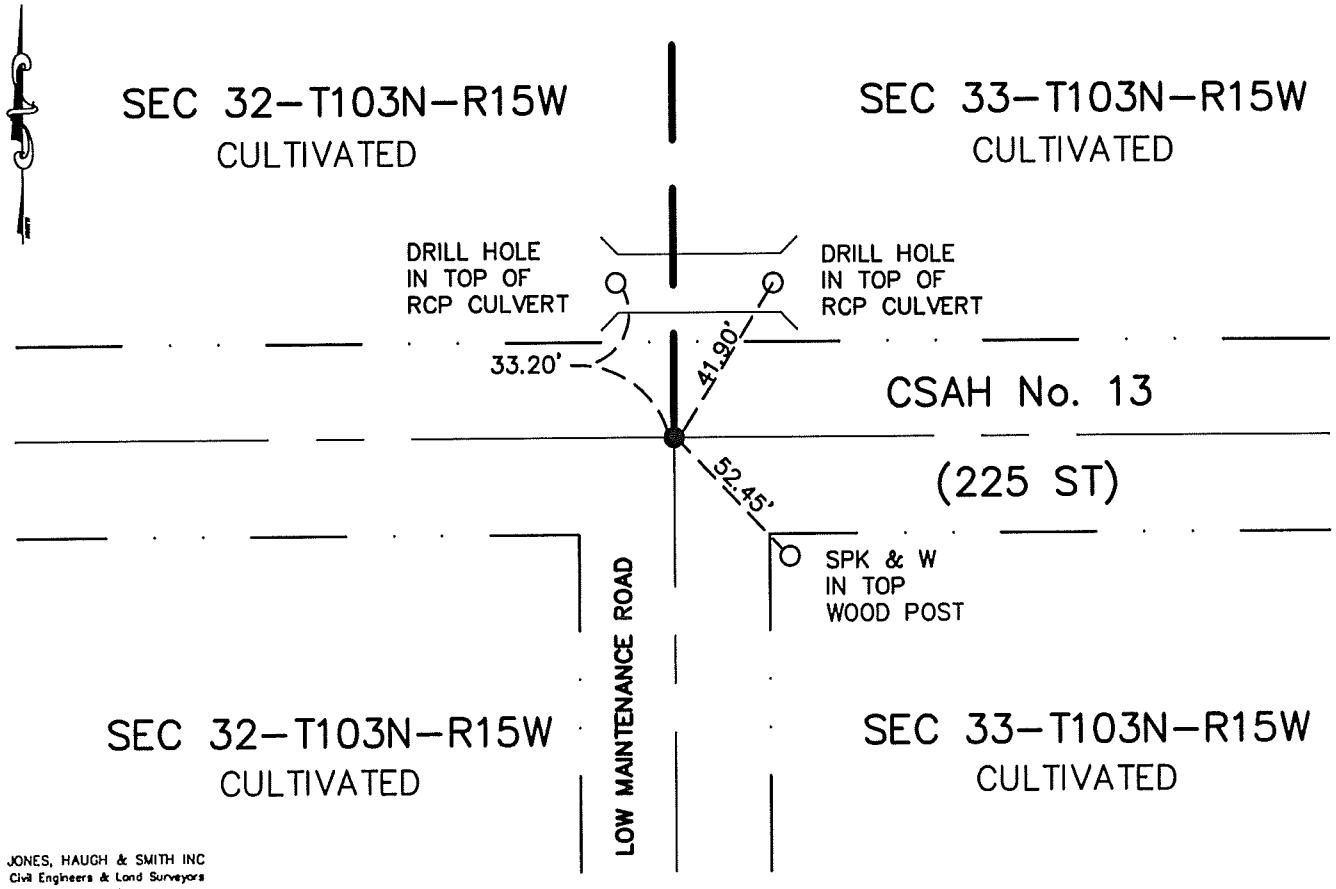

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 3-27-02

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 20___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

W ¼ Cor Sec 33-103-15

Deputy Surveyor John Quigley of the U.S. General Land Office originally established this corner in 1853. The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Tucker Land Surveying

1948 Mower County records show a rock inplace at this location.

2002 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug at this location and found a capped iron, RLS 15471, at a depth of 1.0' +/- below road surface. Checked with Ray Tucker and he stated that he had found a concrete monument and set an iron as a perpetuation thereof.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E 1/4 Corner of Section 33, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 01/07/2002 (DATE) found a CIM

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On _____ (DATE) placed a _____

SKETCH OF REFERENCE TIES

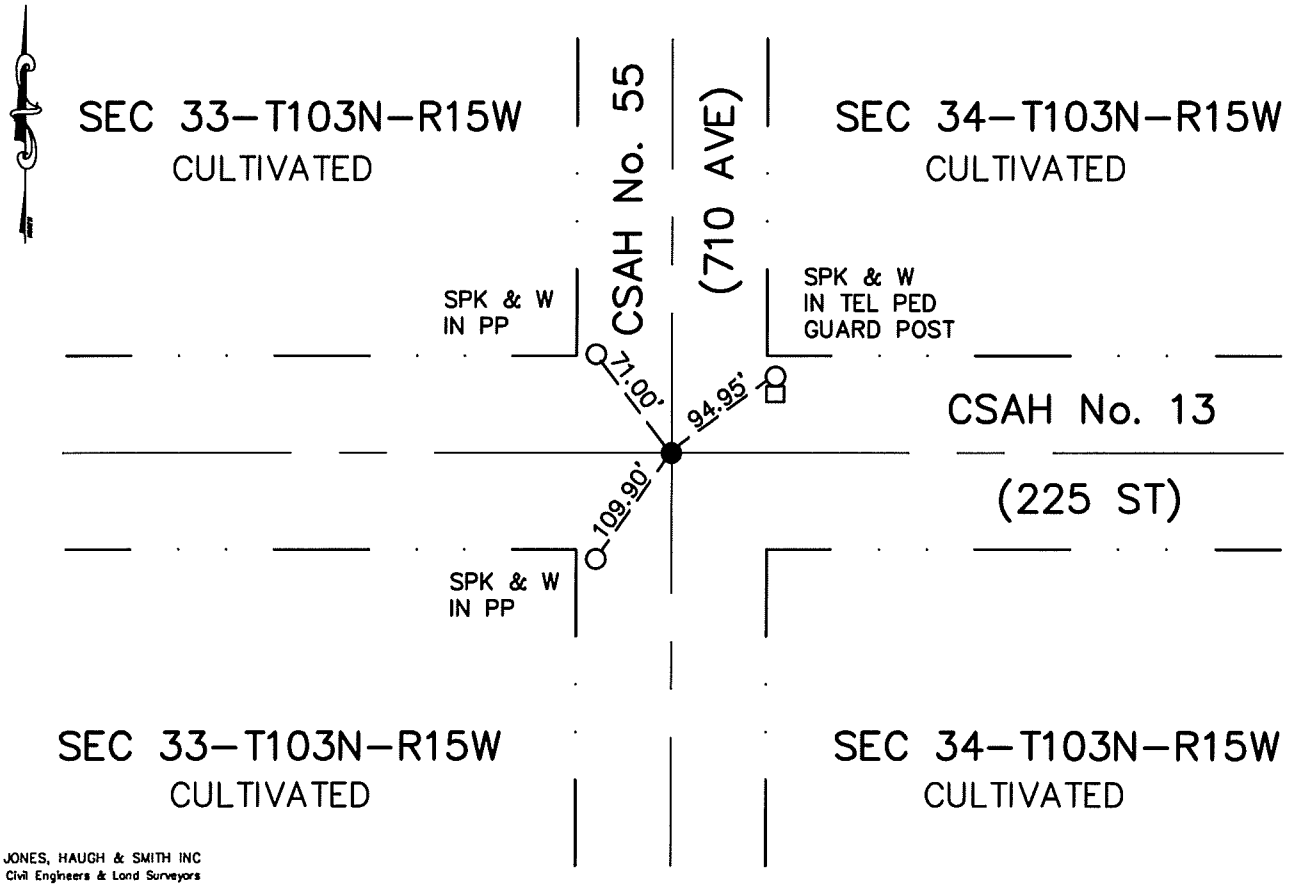

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 3-27-02

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 20___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

E ¼ Cor Sec 33-103-15

Deputy Surveyor John Quigley of the U.S. General Land Office originally established this corner in 1853. The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Tucker Land Surveying

1948 Mower County records show a pointed rock inplace at this location.

2002 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug by hand at signal from metal locator and uncovered a C.I.M. 1.0'+/- below road surface. Checked with Ray Tucker, RLS 15471, and he stated that he had set a CIM as a perpetuation of the corner after excavation and found the stone described in the 1948 records. Accepted monument to be a perpetuation of the original PLS corner. Took new ties.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E 1/4 Corner of Section 36, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 07/11/2002 (DATE) found a CONCRETE MONUMENT

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On _____ (DATE) placed a _____

SKETCH OF REFERENCE TIES

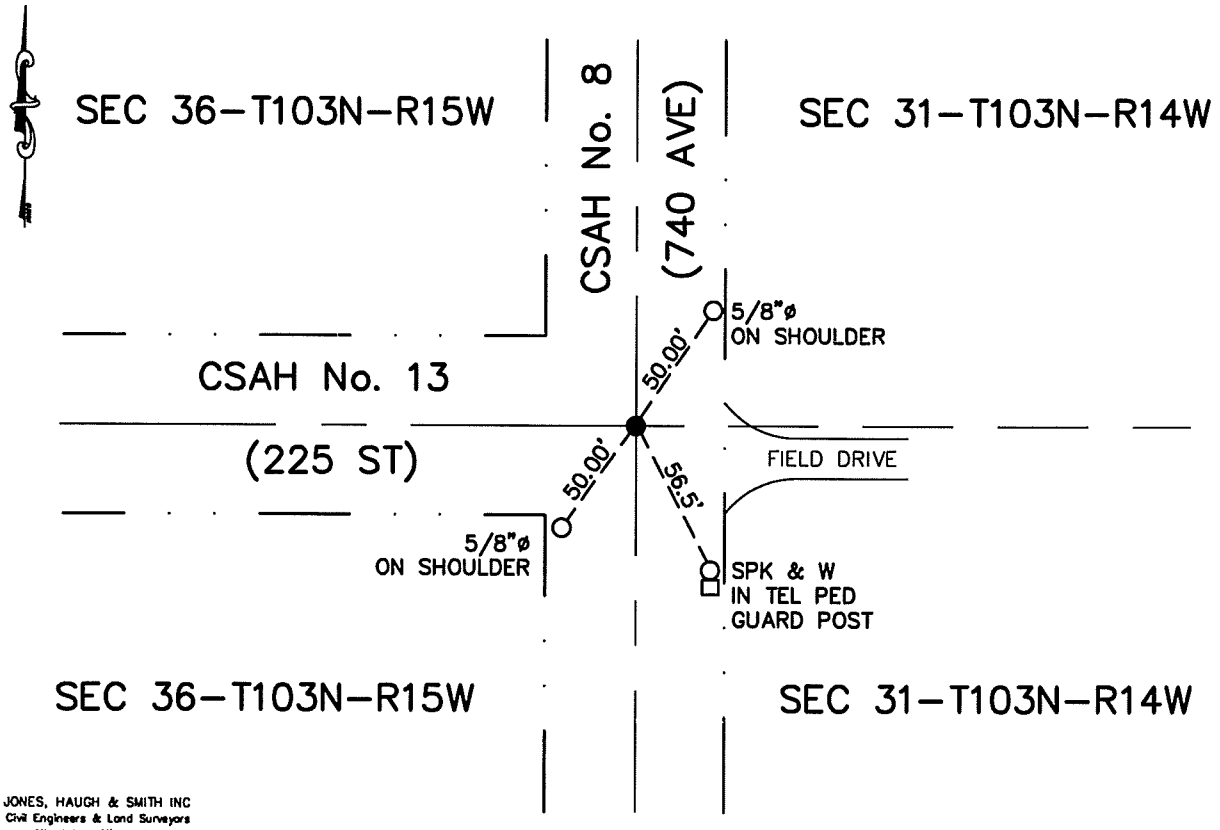

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

_____ (SIGNATURE) 7-15-02 (DATE)

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 20___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

E ¼ Cor Sec 36-103-15

Deputy Surveyor John Ball of the U.S. General Land Office originally established this corner in 1853. The government notes show a wood post was set with mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Tucker Land Surveying

1961 Mower County records show an inplace tile filled with concrete at this location.

2002 Jones Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug by hand at location of signal from magnetic locator and uncovered a P.K. nail on road surface. Continued digging and found a concrete monument with an iron pin 0.7' below road surface.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SW Corner of Section 36, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 4/13/1992 (DATE) found a 3/4" PIPE OVER CLAY BRICK OVER POINTED STONE.

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 4/13/1992 (DATE) placed a 5/8" DIA. IRON CAPPED RLS 13807 OVER STONE.

SKETCH OF REFERENCE TIES

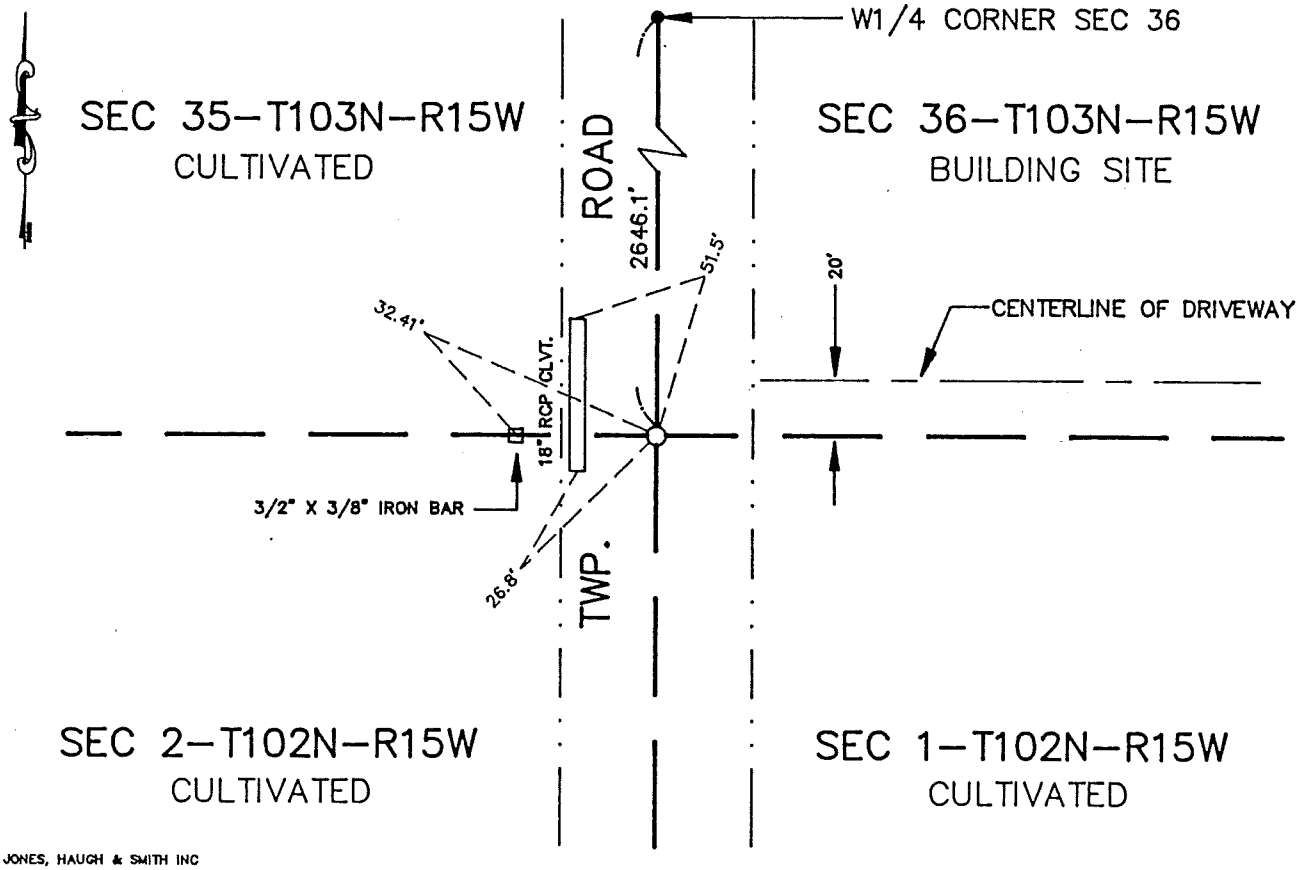

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 11-24-92

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

SW corner Section 36-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1889 Clausen field notes indicate a stone monument inplace at the southwest corner.

1945 Book A in the office of the Mower County Highway Department shows a concrete monument inplace at the southwest corner. The following ties were taken:
70.7' NE to 3rd fence post on twp rd
73.5' SE to iron fence post on twp rd
44.5' SE to tele pole
49.9' W to iron fence post in concrete on fence line
64.7' W to 3rd iron fence post on fence line

1992 Jones, Haugh & Smith Inc crew, under the direction of John H. Schulte IV, dug with county backhoe and uncovered a 3/4" capped pipe one inch deep. Continued digging and uncovered a clay brick 19" deep over pointed stone 6"x16". Placed 5/8" iron capped RLS 13807 under stone and set iron. Found 1 1/2" x 3/8" iron bar 32.41 feet from southwest corner. Set by C.E. Milner RLS as tie to corner in 1955.

The monument found fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SW Corner of Section 36, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☒ On 4-13-1992 (DATE) found a POINTED FIELD STONE WITH CLAY BRICK OVER.

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 4-13-1992 (DATE) placed a 5/8" DIA. IRON UNDER STONE AND A 5/8" DIA. IRON CAPPED RLS 13807 OVER.

SKETCH OF REFERENCE TIES

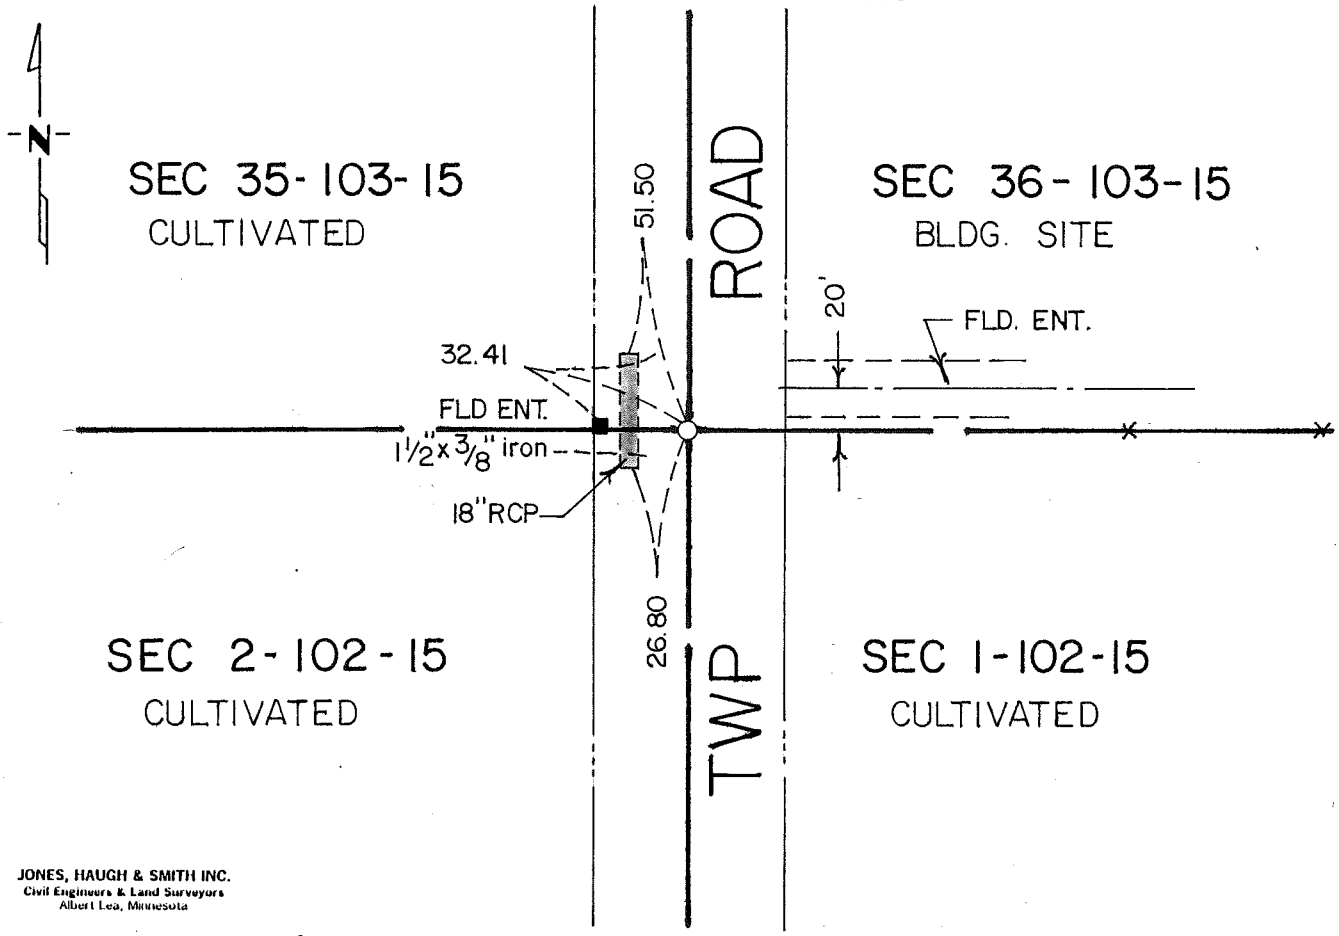

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ SIGNATURE 4-27-92 DATE

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19 ___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

SW corner Sec 36-103-15

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1892 Clausen, Mower County Surveyor, uncovered a stone monument while subdividing the N 1/2 Sec 35.

1946 C.E. Milner, RLS 1476, uncovered a stone monument and the following ties were taken:
32.5' west to iron
45.9' east to 18" Cottonwood
49.1' southeast clump 6' willows
54.7' northeast CFP

1992 Jones, Haugh & Smith Inc crew under the direction of John Schulte, dug with the County backhoe and uncovered a capped pipe on road surface. Continued digging and uncovered a clay brick over a 6"x19" pointed field stone 19" deep. Placed a capped 5/8" diameter iron under stone and set a 5/8" diameter iron capped RLS 13807 over stone on road surface. The capped pipe found on road surface was 0.56 feet north of true corner.

The monument found agrees with past records and fits occupation and road centerlines within the section.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

W 1/4 Corner of Section 36, Township 103N Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 4/13/1992 (DATE) found a 6" CONC. MON. OVER POINTED FIELD STONE.

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 4/13/1992 (DATE) placed a 5/8" DIA. IRON OVER CONCRETE MON. OVER STONE.

SKETCH OF REFERENCE TIES

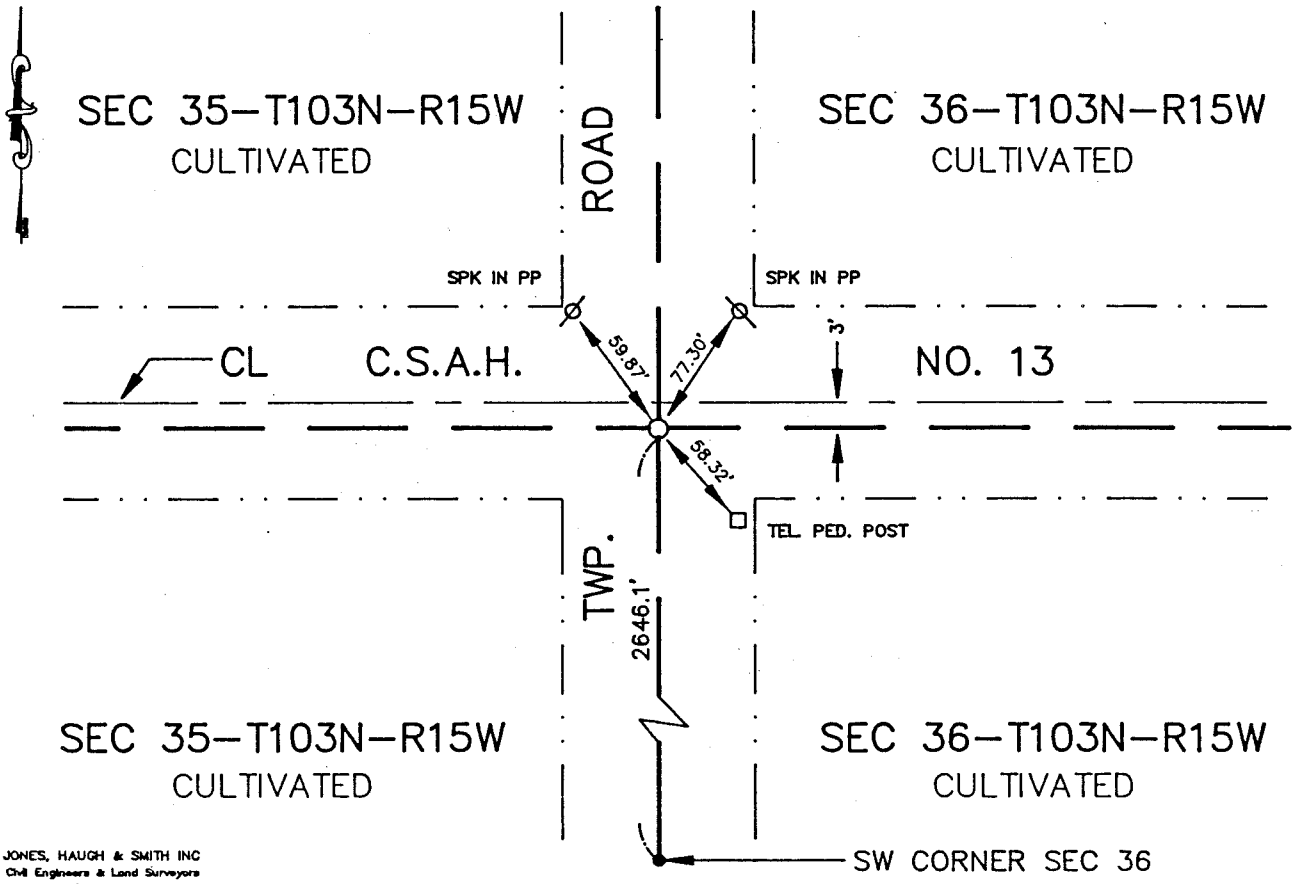

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 11-24-92

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

W 1/4 corner Section 36-103-15

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

1945 Book A in the office of the Mower County Highway Department shows the following information was taken to support evidence of a perpetuation of the original public land survey corner:
Pieces of former concrete tile monument found inplace above stone monument. Set stone monument with iron bolt above stone 4" below road surface. The following ties were taken:
72.2' NE 16" Maple
47.6' NW br. girder corner fence post
27.0' SE end 24" CMP
52.3' SW end 18" S.C. cult

1948 Book A in the office of Mower County Highway Department indicates pieces of tile was inplace. The following ties were taken:
46.2' SE to willow tree
72.2' NE to maple tree
42.4' NW to tele pole
37.6' SW to tele pole

1992 Jones, Haugh & Smith Inc crew, under the direction of John H. Schulte IV, dug with county backhoe and at a depth of 18" found a concrete monument with 1/2" diameter iron in center, 3.25 feet south and one foot west of 3/4" diameter pipe found on road surface. Continued digging and found 3/4" bolt over a pointed field stone. Set concrete monument over stone and 5/8" diameter iron capped RLS 13807 over monument on road surface.

The monument found fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

W 1/4 Corner of Section 36, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☒ On 4-13-1992 (DATE) found a 6" DIA. CONCRETE MONUMENT OVER 3/4"x24" BOLT OVER POINTED FIELD STONE.

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 4-13-1992 (DATE) placed a 6" DIA. CONCRETE MONUMENT OVER STONE. PLACED 5/8" DIA. IRON CAPPED RLS 13807 OVER STONE.

SKETCH OF REFERENCE TIES

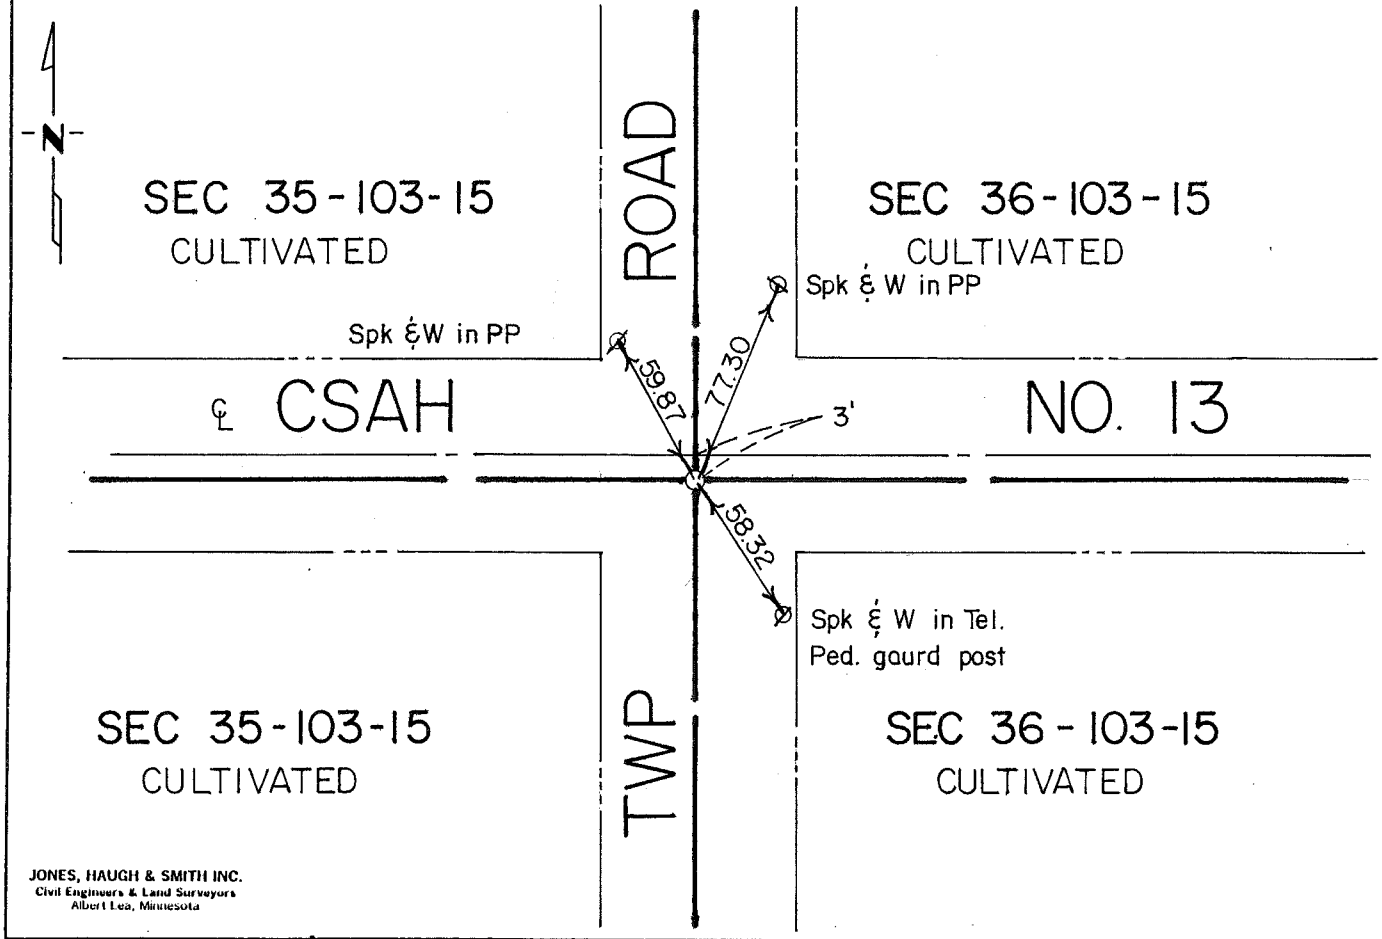

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ SIGNATURE 4-27-92 DATE

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

W 1/4 corner Section 36-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Dept
Mower County Recorder's Office

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1889 Clausen, Mower County Surveyor, uncovered a stone monument while subdividing the N 1/2 Section 35.

1946 C.E. Milner, RLS 1476, uncovered pieces of former concrete tile over stone monument. Placed a bolt over stone and the following ties were taken:

16" Maple	72.2' NE
Br Grider	47.6' NW
End 24" CMP	27.0' SE
End 12" CMP	52.3' SW

1955 Mower County Highway Department uncovered stone monument and set concrete monument over stone. The following ties were taken:

46.2' SE to Willow tree
72.2' NE to Maple tree
42.2' NW to telephone pole
37.6' SW to telephone pole

1992 Jones, Haugh & Smith Inc crew under the direction of John Schulte IV, dug with the County backhoe on centerline centerline and uncovered a capped pipe. Continued digging and found no further evidence. After taking measurement within the section, dug at a point three feet south of capped pipe as per records of C.E. Milner a distance of 2646.3 feet north of southwest corner of Section 36 and uncovered a 6" diameter concrete monument over a 3/4" bolt over a large pointed field stone 3.5 feet deep in virgin soil. Re-set concrete monument over stone and set 5/8" diameter iron capped RLS 13807 over concrete monument on road surface. The pipe on surface was 3.2 feet north one foot east of true corner.

The monument found agrees with past records and fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NW Corner of Section 36, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On _____ (DATE) found a 3/4"ø x 12" IRON CONTINUIED DIGGING AND FOUND 6"x18" POINTED FIELD STONE

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On _____ (DATE) placed a 5/8"ø IRON CAPPED 13807 UNDER STONE AND OVER

SKETCH OF REFERENCE TIES

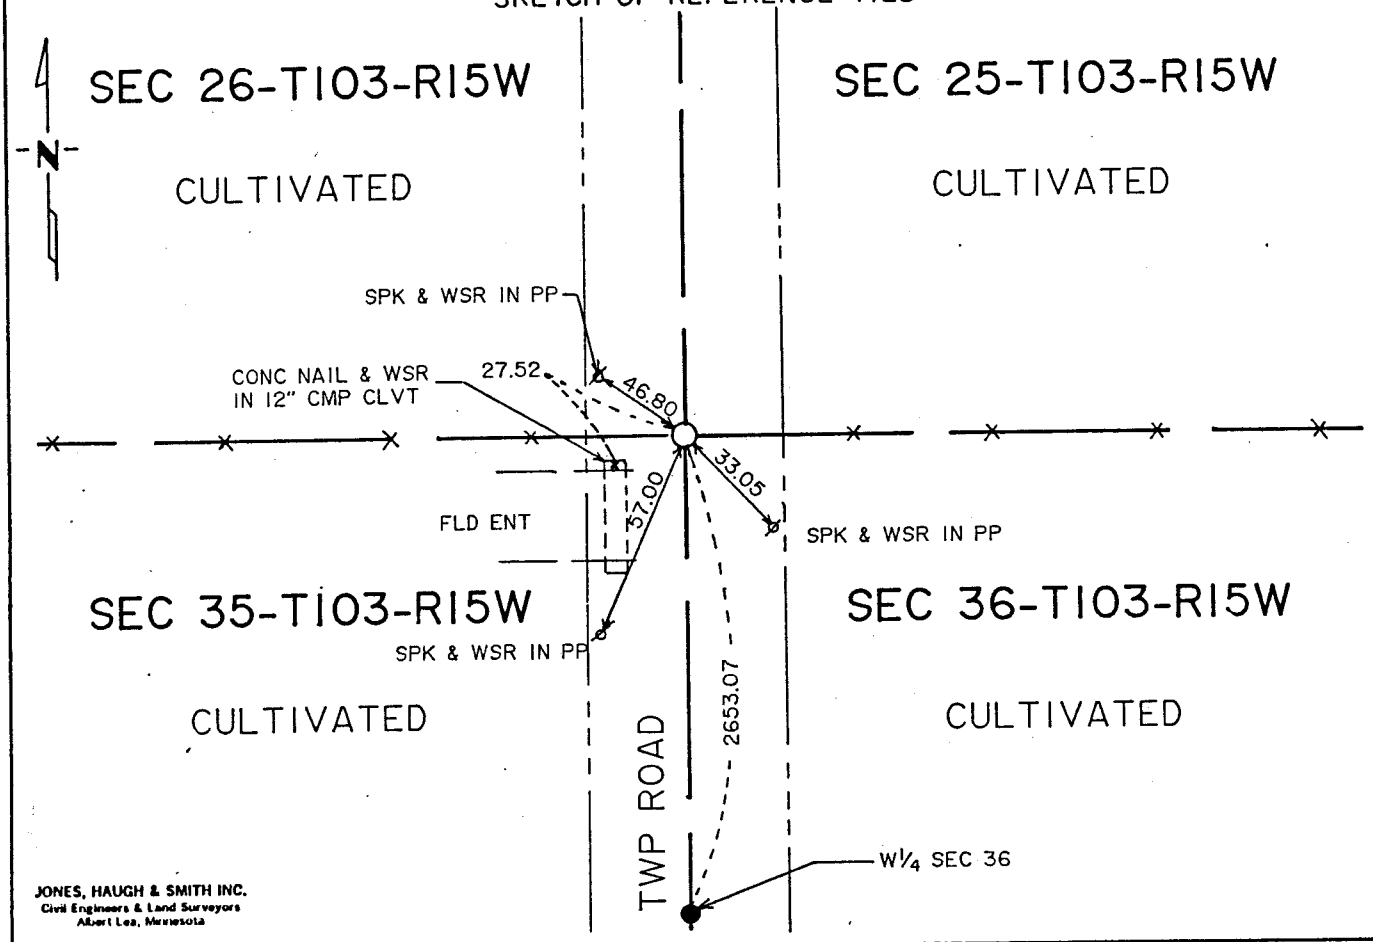

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 11-24-92

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19 ___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NW corner Section 36-103-15

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:

Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1945 Book A in the office of Mower County Highway Department indicates a stone monument found inplace by CE Milner RLS 1476. The following ties were taken:

32.70' NE to braced gate post
28.40' E to corner fence post
36.80' SW to fence post
27.70' W to corner fence post
33.70' NW to fence post

1992 Jones, Haugh & Smith Inc crew, under the direction of John H. Schulte IV, dug with county backhoe on centerline north-south road in line with fence east and west and uncovered a 3/4" diameter x 12" iron 0.1" deep. Continued digging and uncovered a point field stone 6"x18". Stone was 18" deep. Placed a capped iron RLS 13807 under stone and over 0.8" north and 1.5' east of iron.

The monument found fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NW Corner of Section 36, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☒ On 4-13-1992 (DATE) found a POINTED FIELD STONE.

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 4-13-1992 (DATE) placed a 5/8" DIA. IRON UNDER STONE AND PLACED A 5/8" DIA. IRON CAPPED RLS 13807 OVER STONE.

SKETCH OF REFERENCE TIES

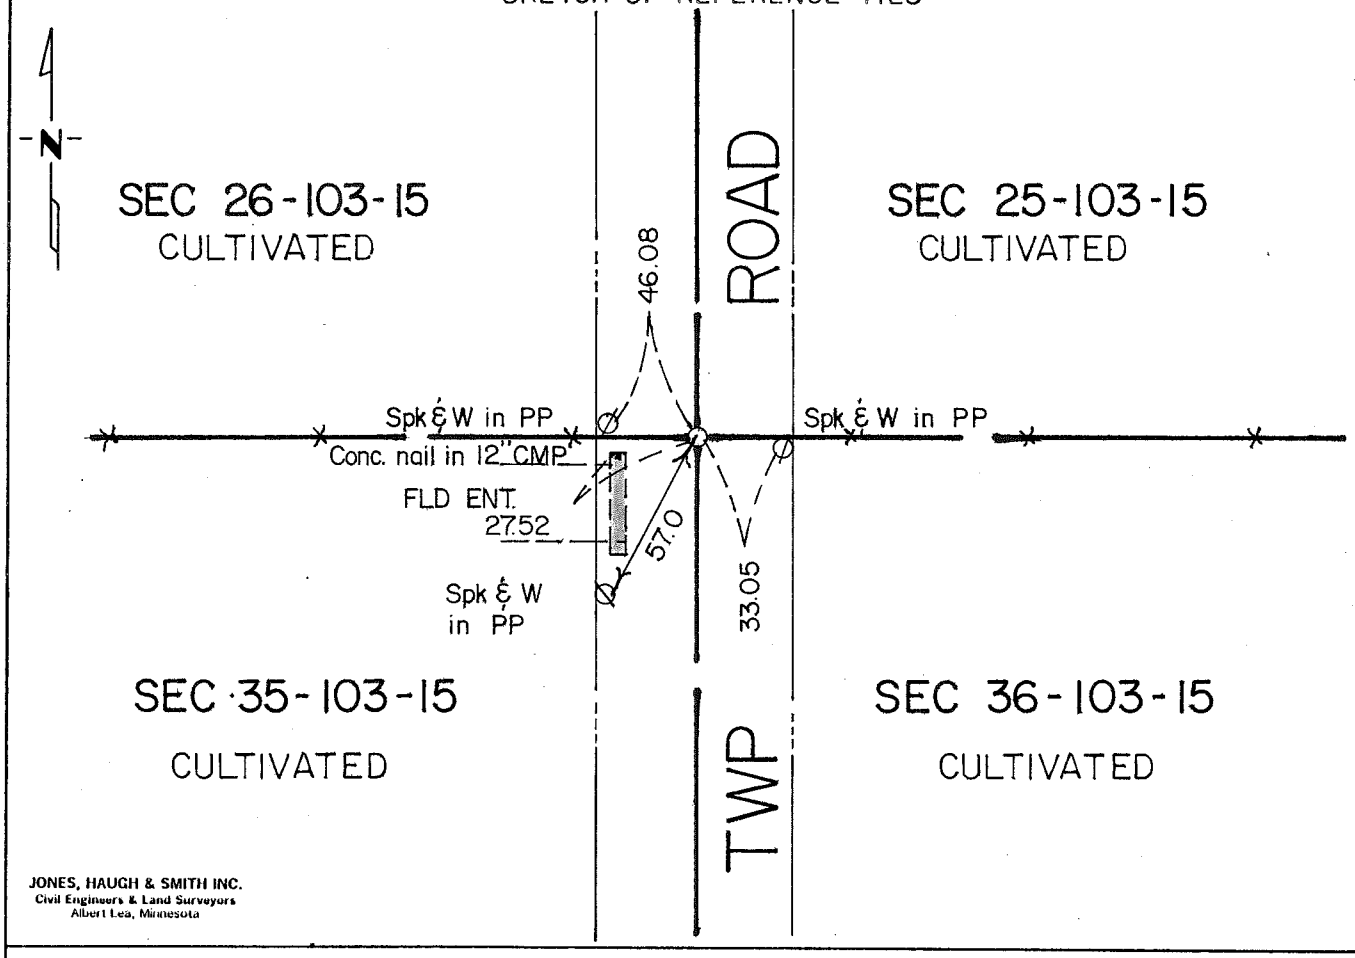

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ (SIGNATURE) 4-27-92 (DATE)

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NW corner Sec 36-103-15

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1892 Clausen, Mower County Surveyor, uncovered a stone monument while subdividing the N 1/2 Sec 35.

1946 C.E. Milner, RLS 1476, uncovered a stone monument 14" below road surface and the following ties were taken:

CFP	28.3' East
Brace post	35.7' East
Fence post	45.0' SW
CFP	34.1' West

1992 Jones, Haugh & Smith Inc crew under the direction of John Schulte, dug with the County backhoe on the centerline north-south road in line with fences east and west and uncovered a 3/4" diameter x 12" iron on road surface. Continued digging and uncovered a 6"x18" long pointed field stone 18" deep in virgin soil. Placed capped 5/8" diameter iron under stone and set capped 5/8" diameter (RLS 13807) over stone on road surface. The 3/4" diameter iron found on surface was 0.8' south 1.5' west of true corner.

The monument found agrees with past records and fits occupation and road centerlines within the section.