Index No. _____

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 8, Township 103N Range 16W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 10-26-94 (DATE) found a 8" x 12" rock 2.5' below surface

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 10-26-94 (DATE) placed a 5/8 Iron on N. side rock

SKETCH OF REFERENCE TIES

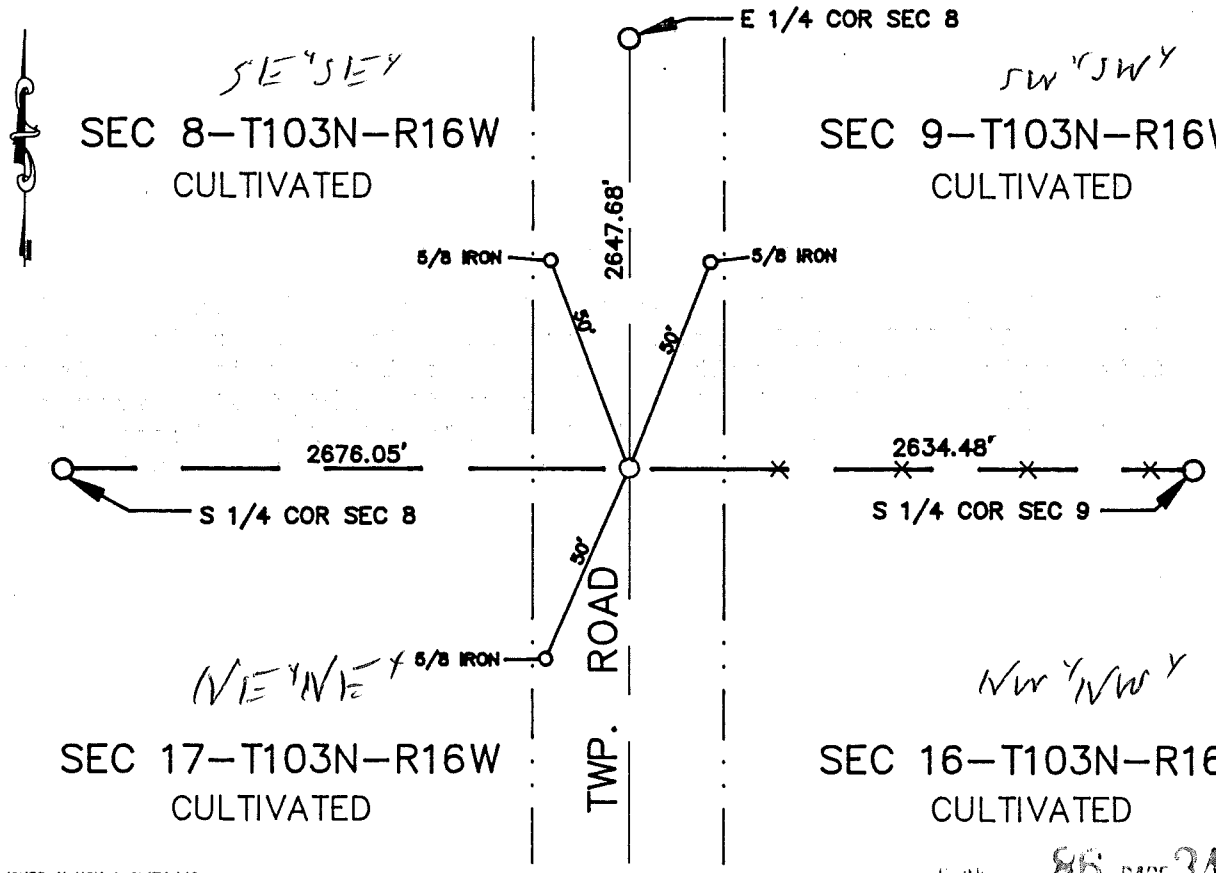


JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

BOOK 86 PAGE 340

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 3-3-95

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 11 A.M. on the 6 day of Mar A.D., 1995

COUNTY RECORDER Charles Engen
By Susan M. Davis, Deputy
DOCUMENT NO. 435273

M.H.D. FORM NO. 2105

BK 86 Misc Pg 340

STATEMENT OF EVIDENCE

SE cor Sec 8-103-16

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

No information was available from the above sources.

1892 Clausen notes indicate a post inplace at this location.

1994 Jones, Haugh & Smith Inc personnel under the direction of John H. Schulte IV, RLS 13807, dug with county backhoe on centerline of township road and in line with a fence line to the east. A 8"x12" stone was found 2.5 feet below the road surface. Continued digging but found no further evidence. The stone is in agreement with Clausens records, therefore accepted stone as best evidence of the original corner. Stone agreed with centerline of the road and the fence line to the east. A 5/8" iron capped RLS 13807 was placed on the north side of the stone. Another iron was placed over the stone approximately 4" below the road surface. Electronic surveying equipment was used to measure the distance to the S 1/4 and E 1/4 Section 8, and S 1/4 Section 9. The distances are as follows:

2676.05' W to the S 1/4 cor Sec 8
2634.48' E to the S 1/4 cor Sec 9
2647.68' N to the E 1/4 cor Sec 8

For electronic survey data and analysis contact the firm of Jones, Haugh & Smith Inc.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.