CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 3, Township 103N Range 18W, 5 P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

On 7-5-90 found 1 1/8" IRON BAR 2.3' BELOW THE SURFACE

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

On 7-11-90 placed COUNTY CAP ON 3/4" REBAR OVER IRON BAR

SKETCH OF REFERENCE TIES

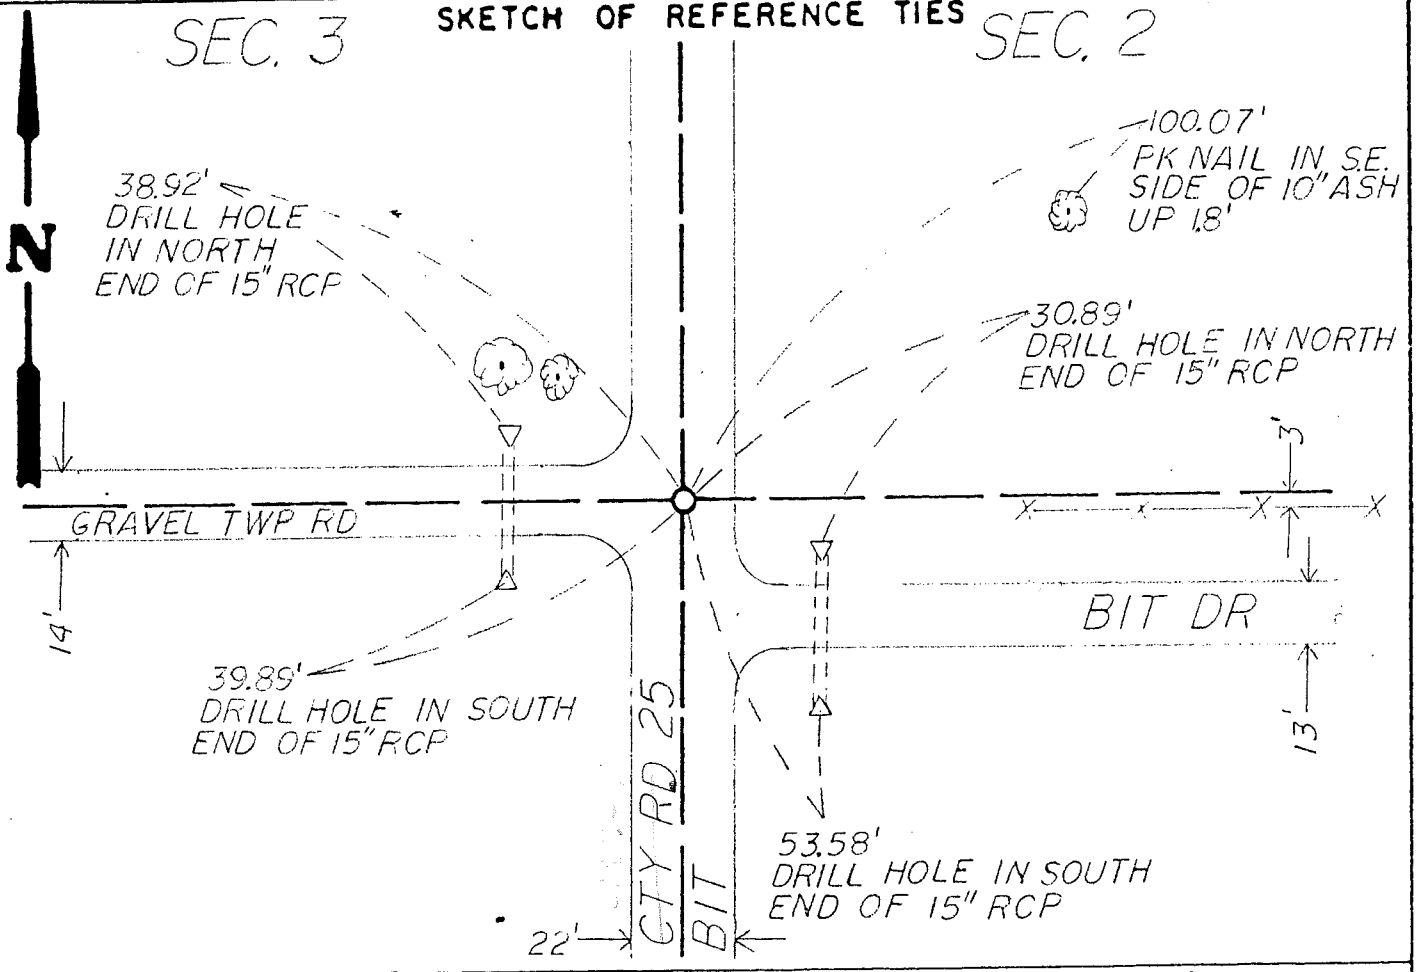

Statement of evidence relative to this corner location is on back of page

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Ronald J Olson — Signature
7-13-90 — Date

Registration No. 11009

☒ Land Surveyor ☐ Prof Engineer
☐ County Surveyor ☐ County Engineer

Zenk·Read·Trygstad & ASSOCIATES, INC.
Engineers / Architects / Land Surveyors / Planners
Box 689, Albert Lea, MN 56007 507/373-0689

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Recorders office at _____ .M. on the ____ day of _____ A.D., 19___.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

Statement of Evidence

EAST QUARTER CORNER SECTION 3, TOWNSHIP 103 NORTH, RANGE 18 WEST, 5TH P.M.

July, 1854 — William J. Anderson, Deputy Surveyor, set a post at quarter section corner, deposited charred stake and made mound with trench and pits as per instructions.

June 1884 — Government post shown in Clausen field notes on Page 104, and used to subdivide Section 3.

1936 — County Engineer's Plans shows no stone found.

July 5, 1990 — Steven J. Thompson, Zenk Read Trygstad & Associates excavated with a backhoe 1 foot East to 3 feet West of centerline and 3 feet South to 8 feet North of Centerline of road to the West and 5.6 feet deep to clayey sand about 2.5 feet below original ground, and found a 1-1/8 inches square x 1.3 feet long iron bar 2.3 feet deep in mottled soil. A 5/8 inch x 1.5 feet rebar with cap # 13807 was found 0.4 foot deep and 0.9 foot Southwest of iron bar.

Testimony from Clifford Strong, a longtime resident of the area, stated that the Rebar was set by prorational measure and that the bar was never found by the party who set the rebar.

An analysis of the record data gives no indication of the origin of the iron bar. The bar was found below the gravel in black dirt. The bar agrees with the occupation lines defined by the road centerline and is accepted as marking the location of the original Public Land Survey Corner.