Index No. ____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NW Corner of Section 8, Township 104N, Range 14W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☒ On 10-17-91 (DATE) found a Harrison cast iron over a MHD capped Telspar post

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On _____ (DATE) placed a _____

SKETCH OF REFERENCE TIES

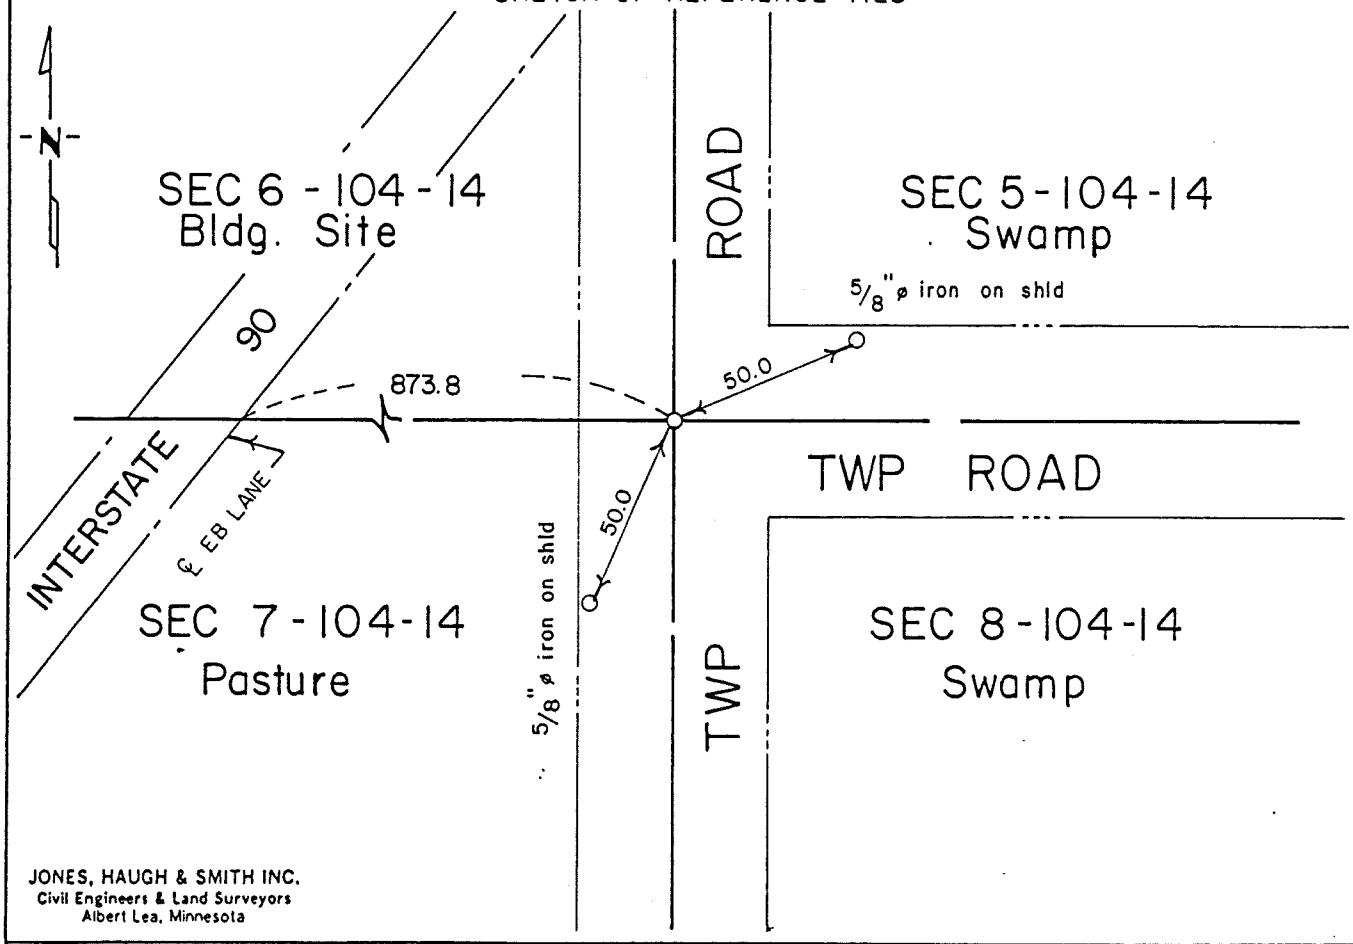

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ 1-6-92
SIGNATURE DATE

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NW corner Section 8-104-14

This corner was originally established by Deputy Surveyor John Taylor of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department
Zenk Engineering
Tucker Land Surveying
Minnesota Dept of Transportation

1956 Minnesota Dept of Transportation I-90 right-of-way map show a boulder inplace on centerline centerline north-south-east roads 873.8 feet east of the centerline of north bound lane from a point where the north line of Section 7 intersects centerline.

1959 Book 'A' in the Office of the Mower County Engineer shows a concrete monument over a field stone and the following ties were taken:
36.0' NE to top CM culvert
38.0' SE to top CM culvert
in line with centerline Township Road east

1991 Jones, Haugh & Smith Inc crew under the direction of John Schulte, County Surveyor, dug with the County backhoe and uncovered a harrison MHD cast iron monument over a MHD capped telspar post. Left all monuments as found.

The monument found fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis contact the firm of Jones, Haugh & Smith Inc.