Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

N 1/4 Corner of Section 18, Township 104N, Range 14W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☒ On 10-17-91 (DATE) found a 5/8" ø iron over a 6" dia. concrete monument

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 10-17-91 (DATE) placed a Cast iron monument over concrete monument

SKETCH OF REFERENCE TIES

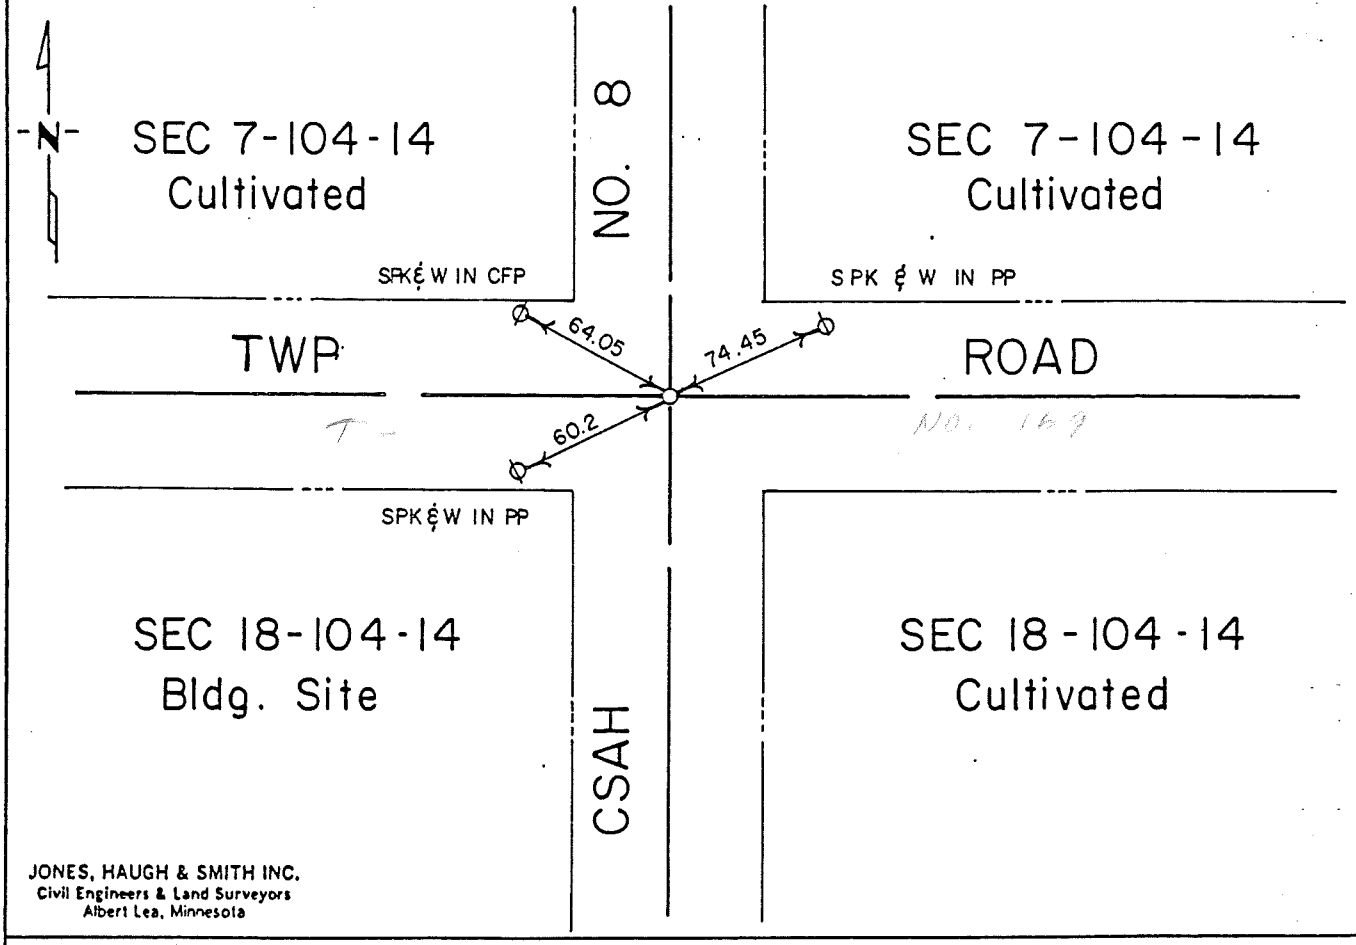

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 12-9-91

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the ____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

N 1/4 corner Section 18-104-14

This corner was originally established by Deputy Surveyor John Taylor of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department
Zenk Engineering
Tucker Land Surveying

1930 Mower County Grading Plans show a tile monument inplace and the following ties were taken:
74.9' NE to PP
51.7' SE to TP
56.9' SW to PP
67.7' WNW to first steel fence post

1965 Book 'A' in the Office of the Mower County Engineer shows a concrete monument inplace and the following ties were taken:
74.9' NE to PP
59.5' SW to PP
60.1' SE to TP

1991 Jones, Haugh & Smith Inc crew under the direction of John Schulte, County Surveyor, dug with the County backhoe on centerline centerline of north-south-east-west roads and uncovered a 5/8" diameter iron one foot below road surface. Continued digging and found a 1/2" diameter iron cast in the center of a 6" diameter concrete monument three feet below road surface in natural soil. Left concrete monument as found and set cast iron monument over on road surface.

The monument found fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data & analysis contact the firm of Jones, Haugh & Smith Inc.