Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NE Corner of Section 32, Township 104N Range 14W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-27-93 (DATE) found a 3/4"ø x 16" PIPE

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-27-93 (DATE) placed a 5/8"ø x 16" IRON

SKETCH OF REFERENCE TIES

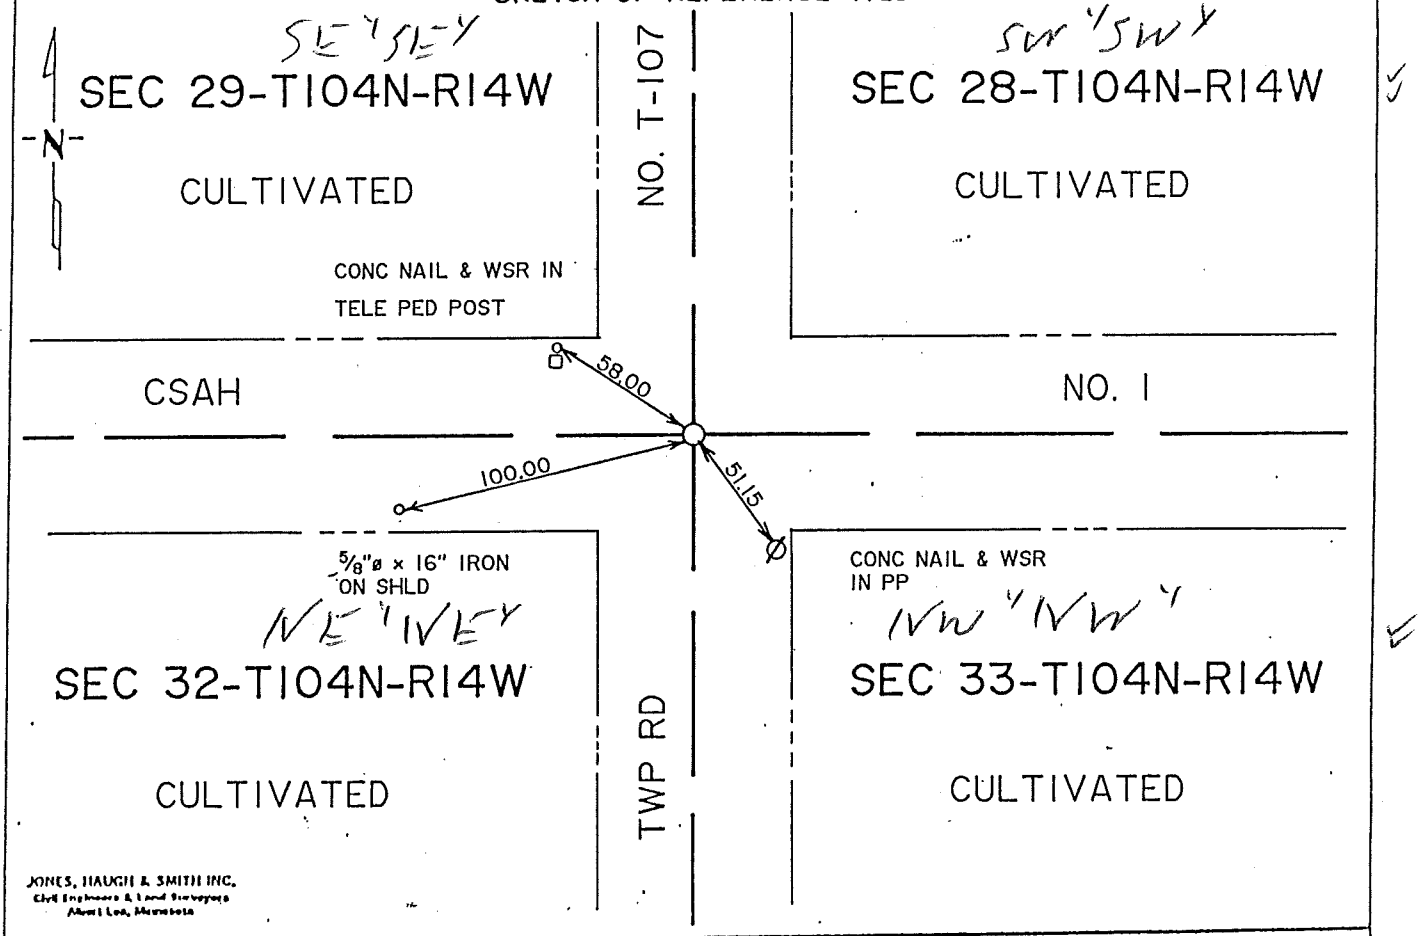

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

[signature] 7-14-93
SIGNATURE DATE

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 2 P.M. on the 15 day of July A.D., 19 93

COUNTY RECORDER Charles Engel

By Marlene Martin, Deputy

DOCUMENT NO. 422859

Bk 80 Misc Pg 329

M.H.D. FORM NO. 2105

BOOK 80 PAGE 329

STATEMENT OF EVIDENCE

NE corner Section 32-104-14

This corner was originally established by Deputy Surveyor John Taylor of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1939 Mower County Highway Department, Book 1, indicates an iron pin inplace at this corner. The following ties were taken:
Stake SSE 75' Stake SSW 74'
Stake NNE 75' Stake NNW 75'

No Date Mower County Highway Department County Road Plans indicates that section corner is on centerline centerline of County State Aid Highway No. 1 and north-south township road.

1993 Jones, Haugh & Smith Inc crew under the direction of John Schulte, RLS 13807, searched area for section corner ties noted in above information and found nothing. We then dug on centerline centerline of intersection with county backhoe a 4'x4'x8' long hole and found a 3/4" diameter x 16" pipe four inches below road surface. We continued digging to a depth of four feet which was into virgin soil and found no evidence of the original public land survey corner. Therefore we accepted 3/4" diameter x 16" pipe as the perpetuation of the original public land survey corner and set a 5/8" diameter x 16" iron near road surface and above monument found.

The monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

BOOK 80 PAGE 330