Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NE Corner of Section 36, Township 104N, Range 14W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☒ On 10-21-91 (DATE) found a 1/2" T iron over 6" dia. concrete monument

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 10-21-91 (DATE) placed a Cast iron monument over concrete monument

SKETCH OF REFERENCE TIES

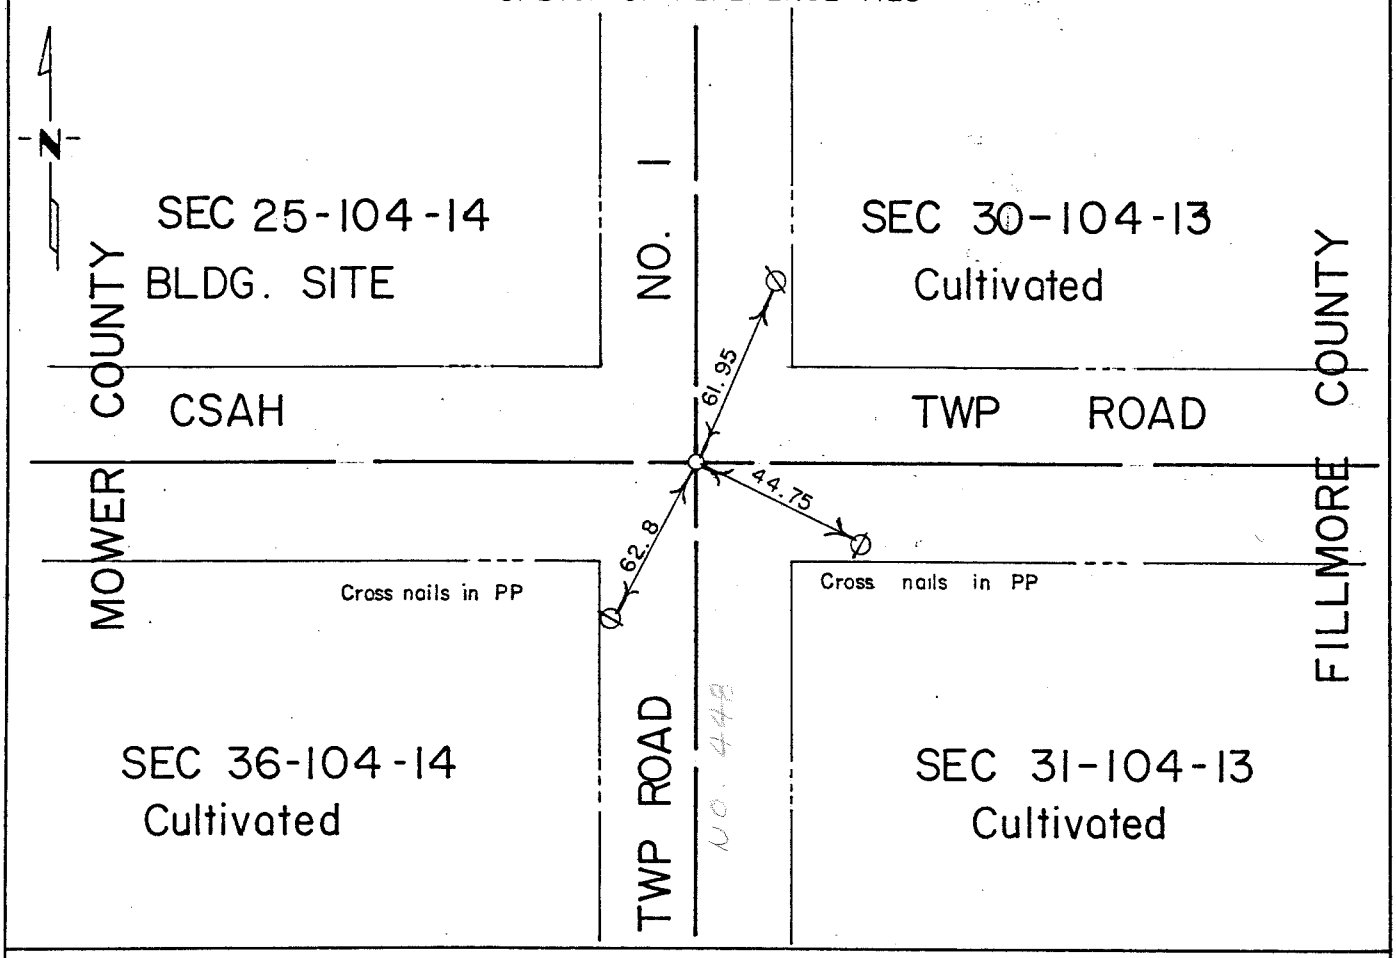

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 11-14-91

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the ____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NE corner Section 36-104-14

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Dept
Mower County Recorder's Office
Zenk Engineering
Tucker Land Surveying

1883 Clausen, County Surveyor, uncovered a wood post during the subdivision of the SW 1/4.

1955 Book 'A' in the Office of the Mower County Engineer shows a monument found. The following ties were taken:
54.5' NE to TP
60.2' NW to 6" Pine
63.9' SE to drive post
53.4' SW to second fence post

1966 Sandstone, RLS 5325, uncovered a concrete monument with 2"x2" hub 2 feet below road surface. A "T" iron was set over monument. The following ties were taken:
68.85' NE to X nails in TP
44.75' SE to X nails in PP
62.80' SSW to X nails in PP
110.15' SW to X nails in CFP

1975 Wallace, Holland & Associates uncovered "T" iron and made notes in Book "A" in the County Engineers Office.

1991 Jones, Haugh & Smith Inc crew dug with County backhoe on centerline centerline of north-east-west-south road and uncovered a 1/2" 'T' iron over a 6" diameter concrete monument with a 3/4" diameter iron cast in center 3 feet below road surface in virgin soil. Left concrete monument as found and set a cast iron monument over concrete monument on road surface.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NE Corner of Section 36, Township 104N, Range 14W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☒ On 3-11-91 (DATE) found a concrete nail & washer on bituminous surface.

☒ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 3-11-91 (DATE) placed a CAST IRON MONUMENT AT ROAD SURFACE OVER CONCRETE MONUMENT FOUND.

SKETCH OF REFERENCE TIES

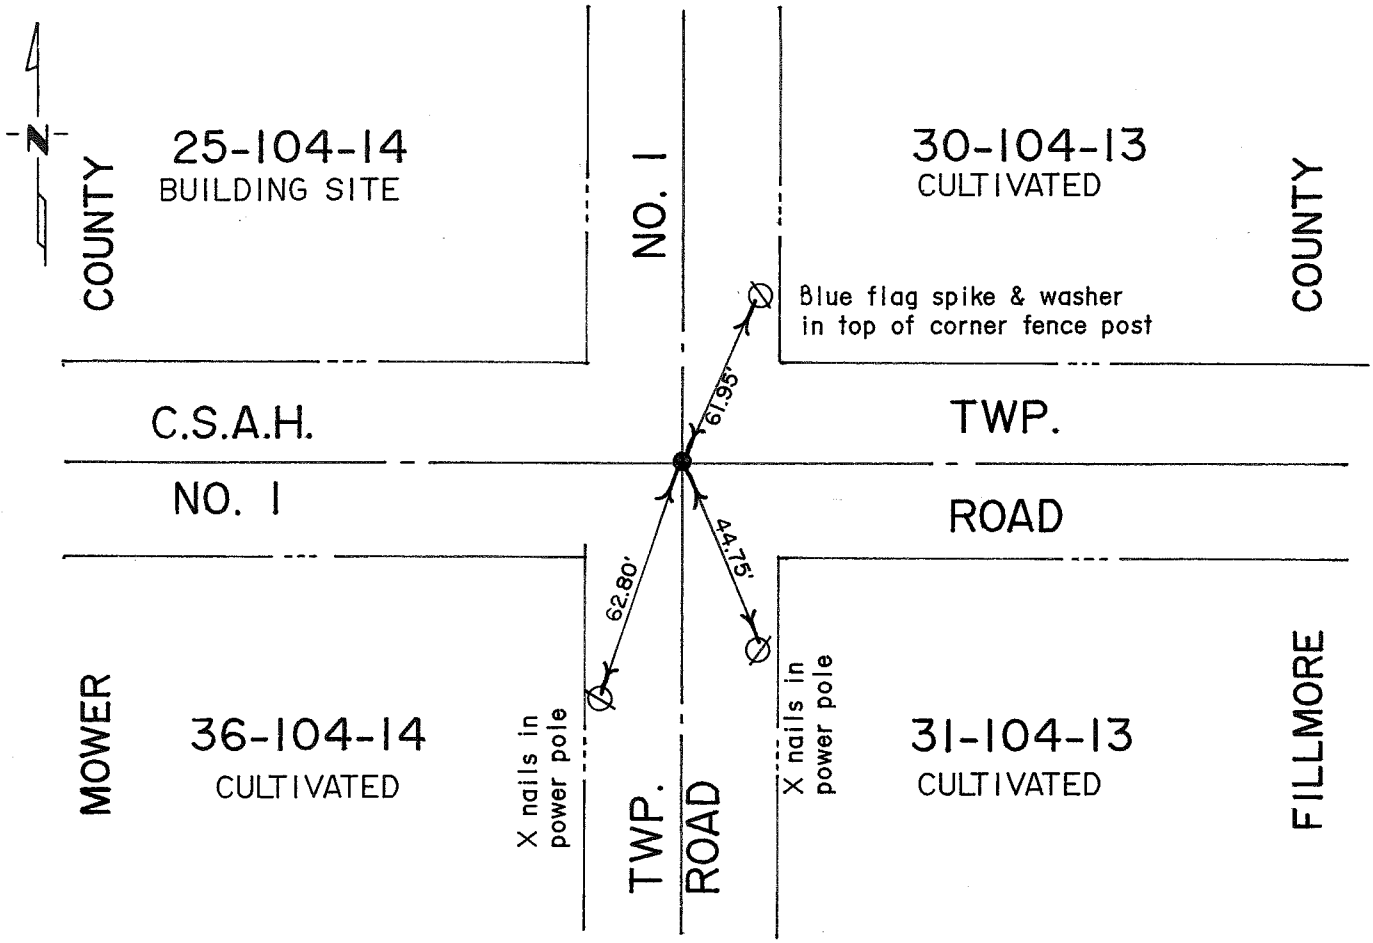

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 4-3-91

Registration No. 13807

☒ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19 ___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NE cor Sec 36-104-14

1853 John Ball, Deputy Surveyor set a post for corner during the original public land survey.

1955 Mower County Engineer of Surveyor uncovered a concrete monument and ties were taken and recorded in 'Book A' in the Office of the Mower County Engineer.

1980 Fillmore County Surveyor found a concrete monument at the corner. Mower County has set similar monuments along their east line. This concrete monument is hereby accepted as the section corner.

1991 Jones, Haugh & Smith Inc personnel found a concrete nail and washer flush on bituminous road. All ties taken by Fillmore County Surveyor checked. Left monument as found.

The monument found fits occupation and road centerlines and is accepted as best evidence of a perpetuation of the original public land survey corner. Placed a cast iron monument at road surface over concrete monument found.