Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NW Corner of Section 23, Township 104N, Range 15W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☒ On 10/18/1991 (DATE) found a 6" SQUARE STONE

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 10/18/1991 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

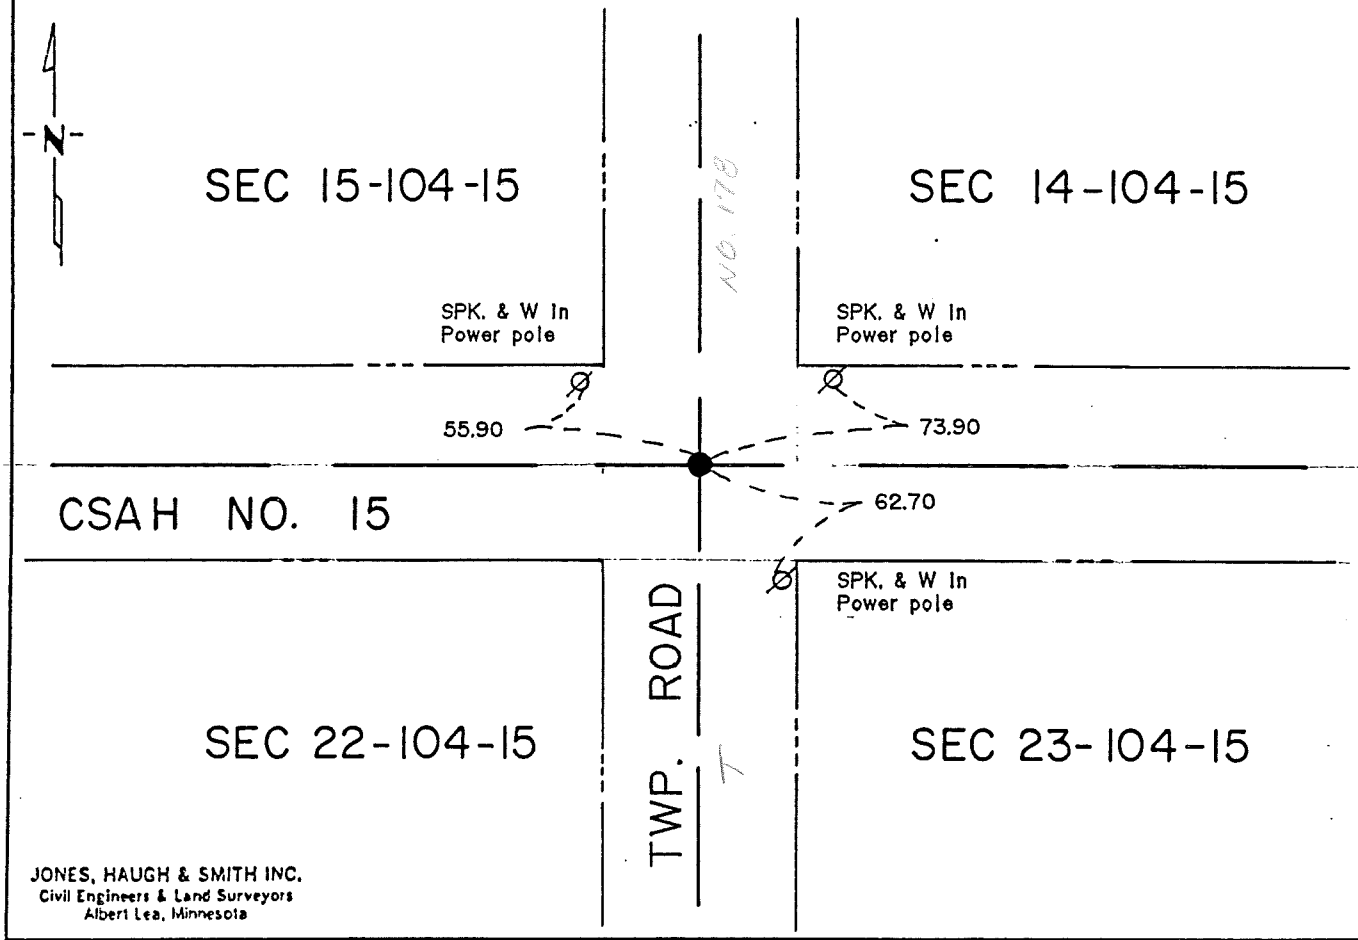

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 12-6-91

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NW corner Section 23-104-15

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department
Zenk Engineering
Tucker Land Surveying

1940 Mower County Grading Plans show a monument found and the following ties were taken:

33.5' NE to CFP	41.2' SE to CFP
42.7' SW to CFP	44.5' SW to TP

1954 Mower County Grading Plans show a stone monument found and a concrete monument found on road surface with the following ties:
67.6' SSW to first steel fence post
81.3' NNW to third steel fence post
62.4' SW to CFP
61.4' to steel CFP

1991 Jones, Haugh & Smith Inc crew under the direction of John Schulte, County Surveyor, dug with the County backhoe on the centerline centerline of north-south-east-west roads. A 4'x8'x3.5' deep hole was dug and a 6" square stone was found 3.5' deep in virgin soil. A 5/8" diameter iron was placed on the east side of stone and a cast iron monument set over stone on road surface.

The monument found fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data & analysis contact the firm of Jones, Haugh & Smith Inc.