Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SW Corner of Section 14, Township 104N Range 16W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-24-93 (DATE) found a 6"ø×18" CONC MOUNMENT WITH IRON IN CENTER

■ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-24-93 (DATE) placed a CAST IRON MONUMENT OVER CONC MONUMENT

SKETCH OF REFERENCE TIES

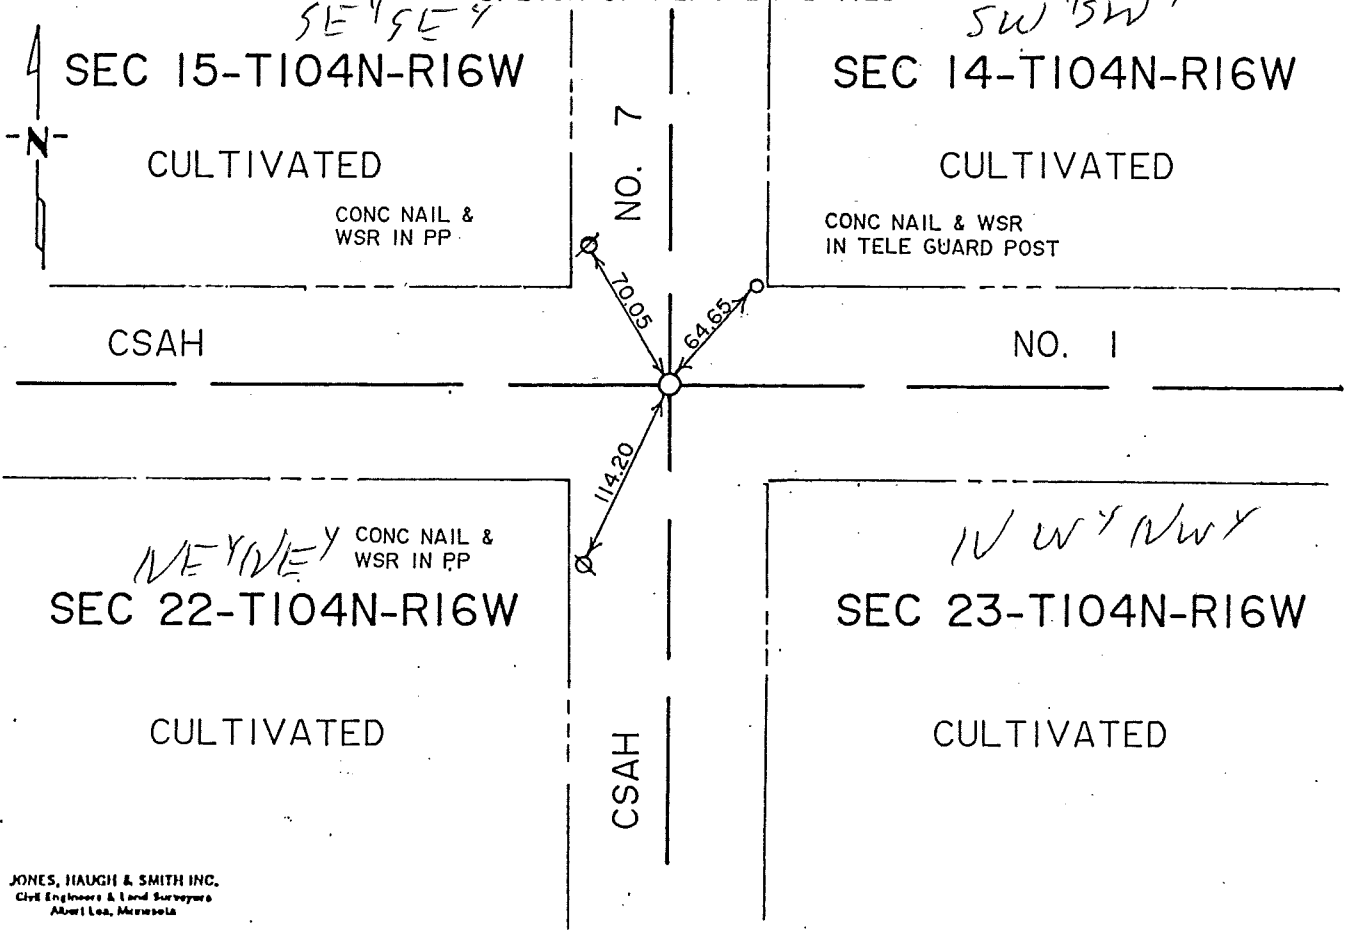

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 6-11-93

Registration No. 13607

☐ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 10 A .M. on the 21 day of June A.D., 19 93

COUNTY RECORDER Quanda Enger

By Marlene Martin, Deputy

DOCUMENT NO. 421599

Bk 79 Misc Pg. 602

M.H.D. FORM NO. 2105

BOOK 79 PAGE 602

STATEMENT OF EVIDENCE

SW cor Sec 14-104-16

This corner was originally established by Deputy Surveyor John Fitzpatrick of the U.S. General Land Office in 1853. The government notes show a wood post and stone were set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of the perpetuation of the original public land survey corner.

1888 Clausen, Mower County Surveyor, indicates a government post at this corner and also a distance of 40.22 chains from the N 1/4 corner of Section 22-104-16.

1890 Clausen, Mower County Surveyor, indicates government post at this corner.

1943 Mower County Highway Department Book 1 indicates a concrete monument inplace at this corner. The following ties were taken:

88.8' NE to tele post face	88.1' NNW to cor fence post
79.9' WNW to cor fence post	85.9' SW to tele post
89.1' SSW to cor fence post	88.1' SE to tele post

1993 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, RLS 13807, dug a 3'x3'x5' hole on the centerline centerline intersection of County State Aid Highway No. 1 and County State Aid Highway No. 1. At a depth of three feet we uncovered a 6" diameter x 18" concrete monument with iron in center, which is in agreement with past records. Therefore we accepted concrete monument found as the location of the corner and set a cast iron monument near road surface and above concrete monument found.

The monument found and cast iron monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.