Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NW Corner of Section 36, Township 104N Range 18W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 10-2-92 (DATE) found a 8"x16" POINTED FIELD STONE

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 10-2-92 (DATE) placed a 5/8"ø IRON ON WEST SIDE OF STONE AND 5/8"ø IRON OVER STONE ON SURFACE

SKETCH OF REFERENCE TIES

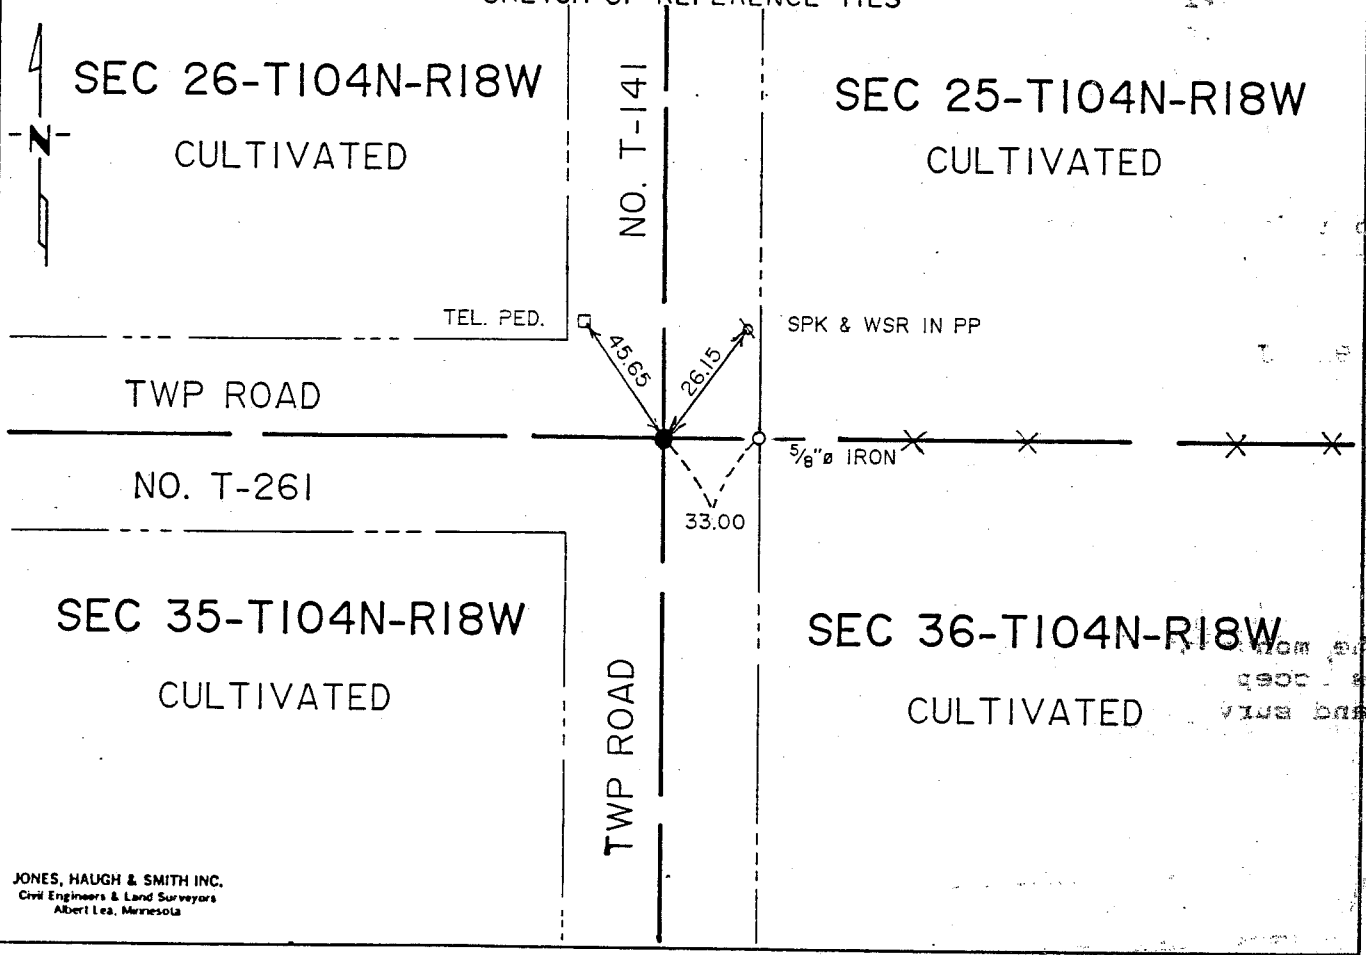

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 11-12-92

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NW corner Section 36-104-18

This corner was originally established by Deputy Surveyor William I. Anderson of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench. The following ties were taken:

10" Burr Oak	S 2 1/2° E	25 links (16.5 ft)
9" Red Oak	N 44° E	73 links (48.18 ft)

The following were contacted for section corner information:

Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

No information was obtained to support evidence of a perpetuation of the original public land survey corner.

1992 Jones, Haugh & Smith Inc crew, under the direction of John H. Schulte, dug with the county backhoe on centerline centerline of township roads and uncovered a 8" diameter x 18" long pointed field stone three feet deep in virgin soil. Set cast iron monument over pointed stone on road surface and placed a 5/8" diameter iron on west side of stone.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public
land survey corner.