"I" TIE BOOK p.54 Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NE Corner of Section 30, Township 102N, Range 17W, 5TH P.M.

STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☐ On _____ (DATE) found a _____

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 8-7-85 (DATE) placed a concrete nail & washer in bridge deck

SKETCH OF REFERENCE TIES

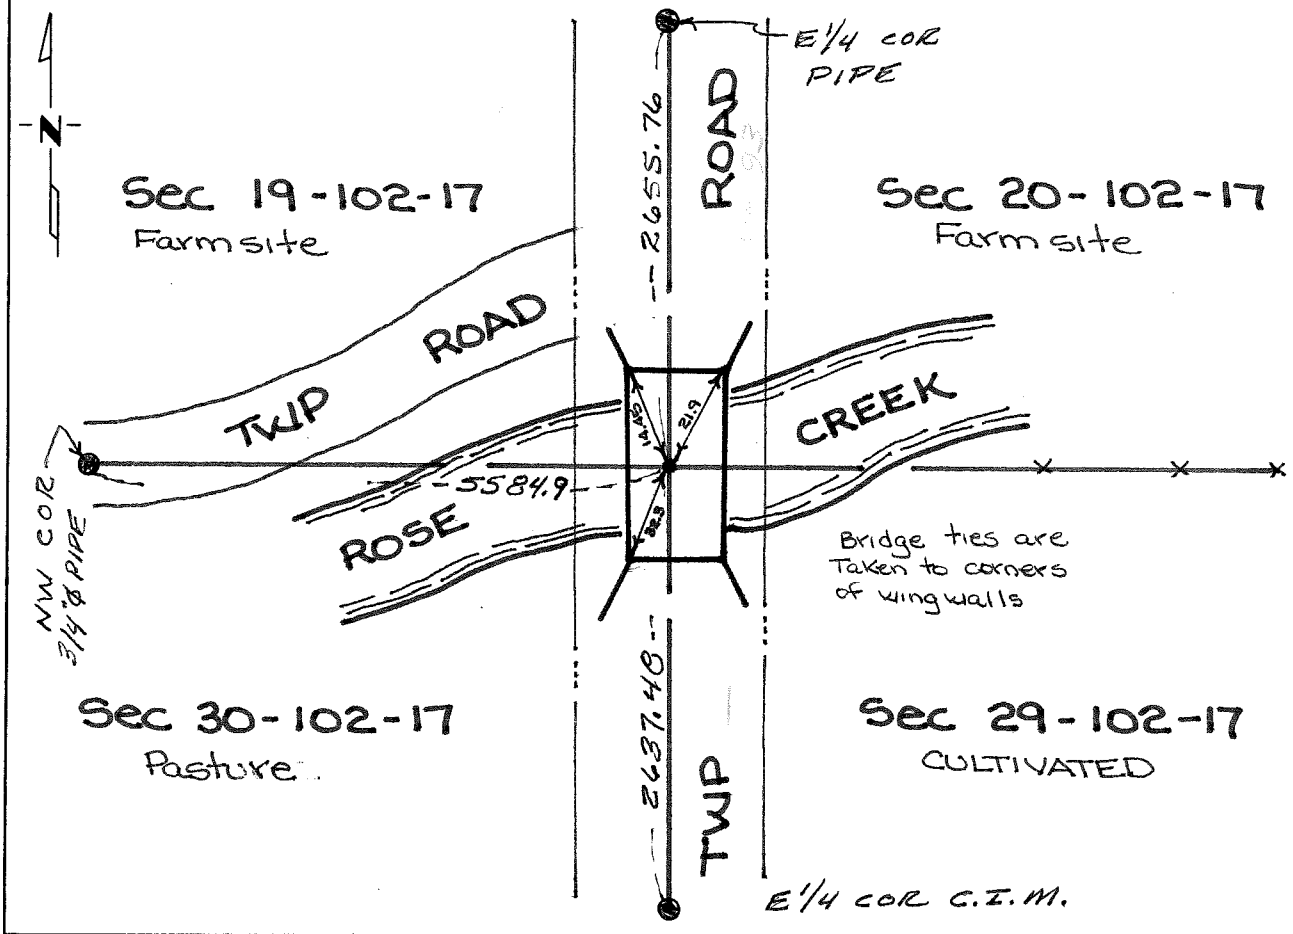

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

John H. Schutt III
SIGNATURE

10-10-95
DATE

Registration No. 13807

☑ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NE corner Section 30-102-17

1854 William I. Anderson, Deputy Surveyor, set wood post during public land survey.

1985 Jones, Haugh & Smith Inc survey crew found no evidence of original public land survey corner or bearing trees. Therefore established the corner using obliterated methods, as follows:

Used centerline of bridge at northeast corner to control east-west position since it fit centerline of roads to north and south.

Measured north from E¼ corner Section 30 to existing fence line west at northeast corner of the SE¼ NE¼ Section 30 and found a distance of 1318.74 feet. Doubled this distance and set temporary point on centerline of bridge for northeast corner. Then measured north from temporary point to field division west at northeast corner of the SE¼ SE¼ Section 19-102-17 and found distance of 1328 feet more or less. Continued measuring north to E¼ corner Section 19, and found 2655.76 feet.

Found remains of old fence line east on south bank of creek, which fits temporary point and extended centerline of township road to west and found that it checked with temporary point.

Found that temporary point fits existing fence lines, field division and road centerlines. Therefore we set concrete nail and washer at temporary point and took ties as shown; and accepted this location as best of location of the original public land survey corner using existing extrinsic evidence.