Revised.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E1/4 Corner of Section 13, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-28-93 (DATE) found a 5/8"ø x 18" IRON AND A 6"ø x 18" CONC MON WITH IRON IN CNT

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 9-25-96 (DATE) placed a 5/8"ø x 16" IRON

SKETCH OF REFERENCE TIES

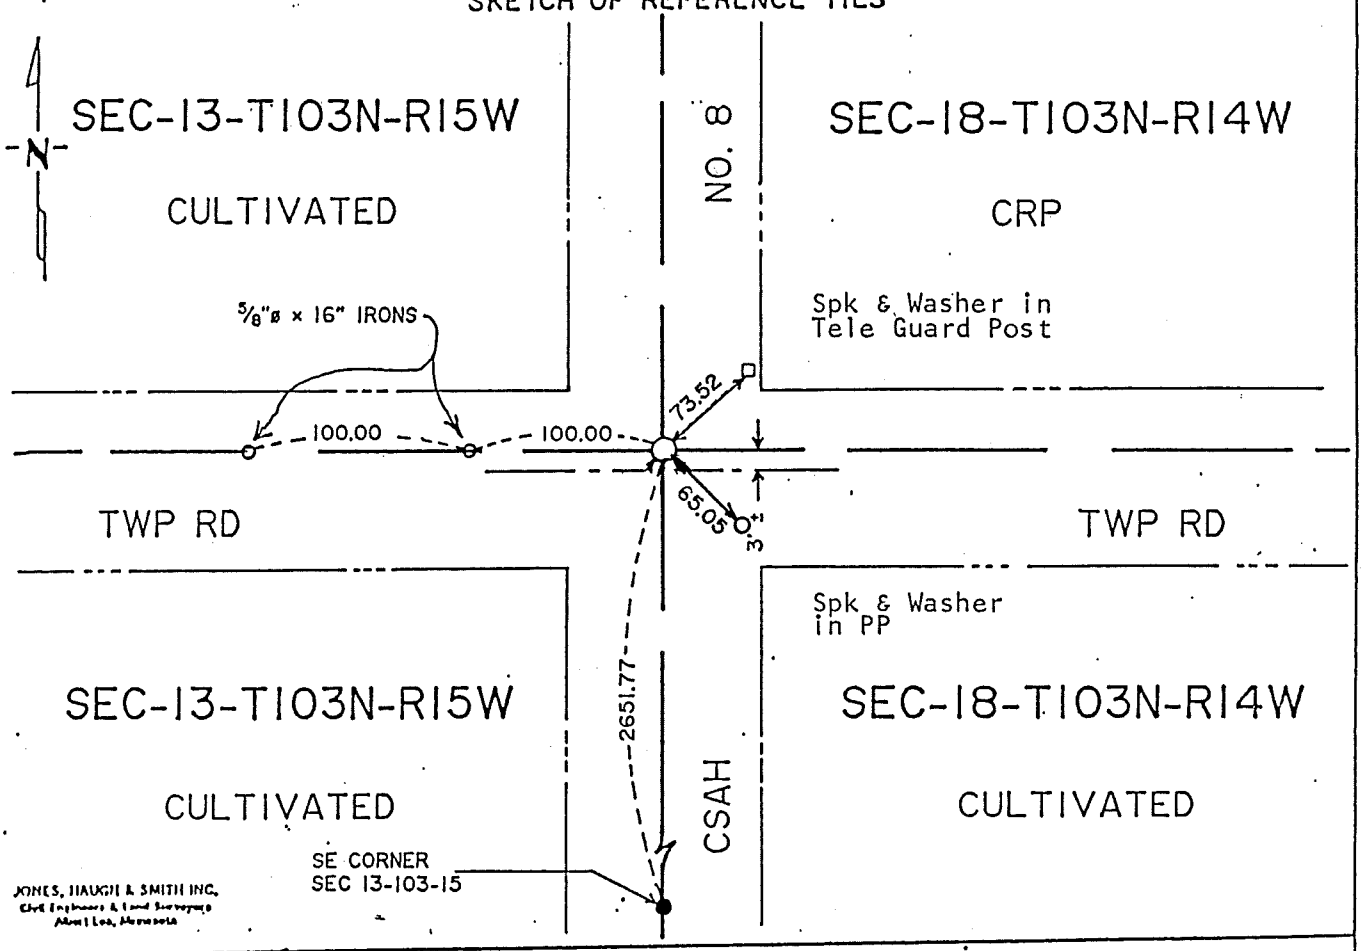

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ SIGNATURE _____ DATE

Registration No. _____

☐ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the ____ day of _____ A.D., 19 ____

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

E 1/4 corner Section 13-103-15

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1885 Clausen, Mower County Surveyor, notes indicate a post at this corner.

1945 Mower County Highway Department, Book 1, indicates a clay tile filled with concrete and an iron in center. Monument was set at the split between northeast corner and southeast corner of Section 13 and also on a straight line.

1993 Jones, Haugh & Smith Inc crew under the direction of John Schulte, RLS 13807, dug a 3'x2'x8' long hole with county backhoe on centerline centerline of County State Aid Highway No. 8 and east-west township roads. We found a 5/8" diameter x 18" iron on centerline centerline of said roads six inches below road surface. Continued digging to a depth of two feet and found a 6" diameter clay tile filled with concrete and a 3/8" diameter iron in center. Concrete monument found was three feet north of centerline of east-west township road and one foot west of centerline County State Aid Highway No. 8. Therefore we discarded 5/8" diameter x 18" iron and accepted concrete monument found which is noted in 1945 Mower County Highway Department notes as the perpetuation of the original public land survey corner. We set a 5/8" diameter x 16" iron near road surface and above concrete monument found.

1996 Jones, Haugh & Smith Crew re-set corner from ties.

The monument set fits occupation lines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.