Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NW Corner of Section 36, Township 103N Range 15W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☒ On 4-13-1992 (DATE) found a POINTED FIELD STONE.

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 4-13-1992 (DATE) placed a 5/8" DIA. IRON UNDER STONE AND PLACED A 5/8" DIA. IRON CAPPED RLS 13807 OVER STONE.

SKETCH OF REFERENCE TIES

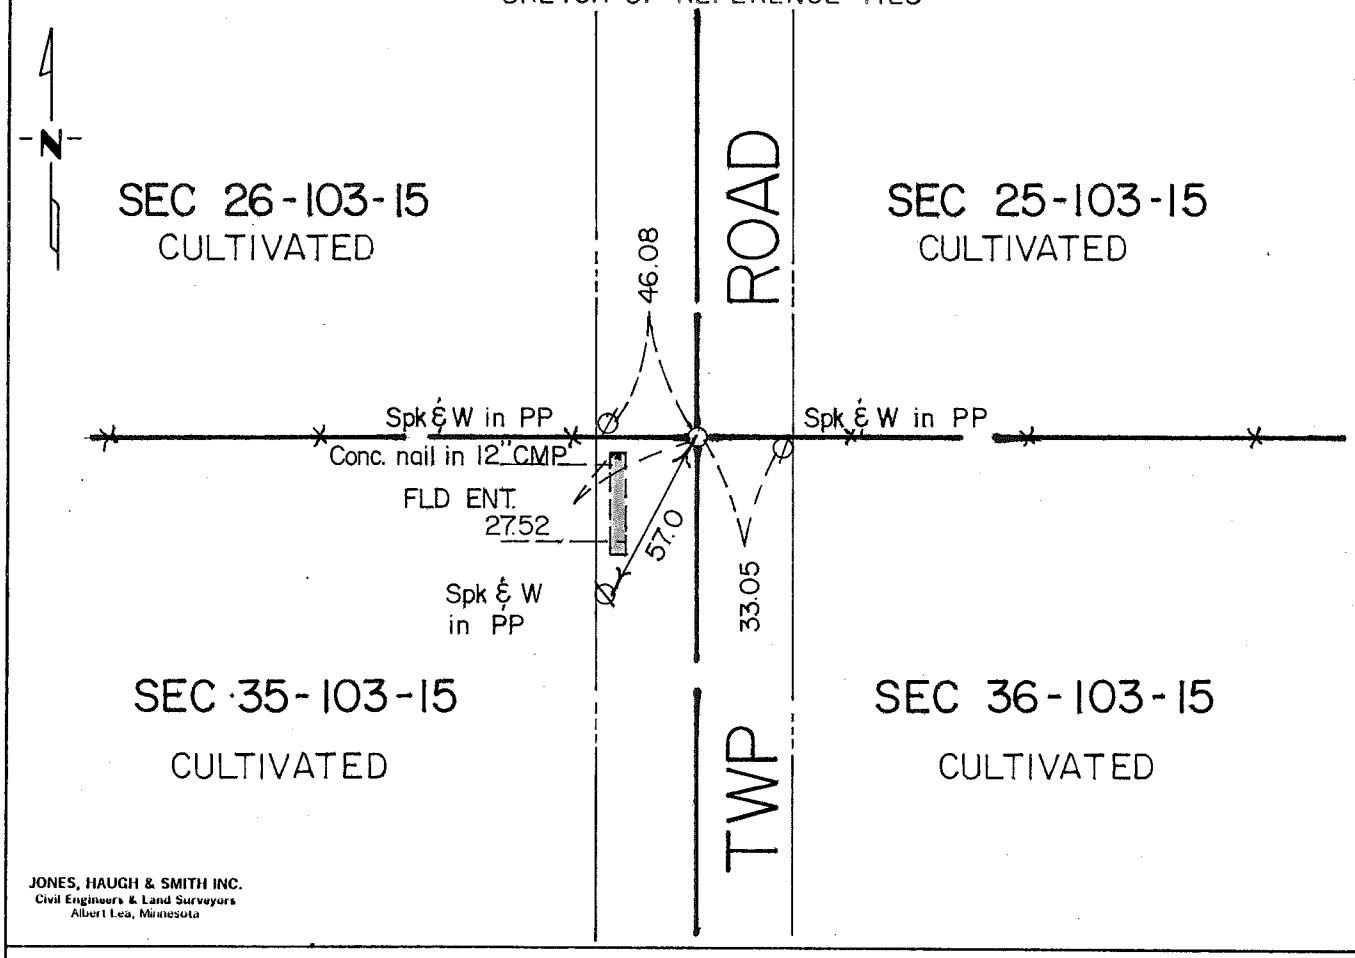

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ (SIGNATURE) 4-27-92 (DATE)

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NW corner Sec 36-103-15

This corner was originally established by Deputy Surveyor John Quigley of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Recorder's Office
Mower County Highway Department

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1892 Clausen, Mower County Surveyor, uncovered a stone monument while subdividing the N 1/2 Sec 35.

1946 C.E. Milner, RLS 1476, uncovered a stone monument 14" below road surface and the following ties were taken:

CFP	28.3' East
Brace post	35.7' East
Fence post	45.0' SW
CFP	34.1' West

1992 Jones, Haugh & Smith Inc crew under the direction of John Schulte, dug with the County backhoe on the centerline north-south road in line with fences east and west and uncovered a 3/4" diameter x 12" iron on road surface. Continued digging and uncovered a 6"x18" long pointed field stone 18" deep in virgin soil. Placed capped 5/8" diameter iron under stone and set capped 5/8" diameter (RLS 13807) over stone on road surface. The 3/4" diameter iron found on surface was 0.8' south 1.5' west of true corner.

The monument found agrees with past records and fits occupation and road centerlines within the section.