Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NW Corner of Section 24, Township 103N, Range 17W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-29-91 (DATE) found a 1/2"Øx24" long re-bar capped RLS 15471

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-29-91 (DATE) placed a cast iron monument

SKETCH OF REFERENCE TIES

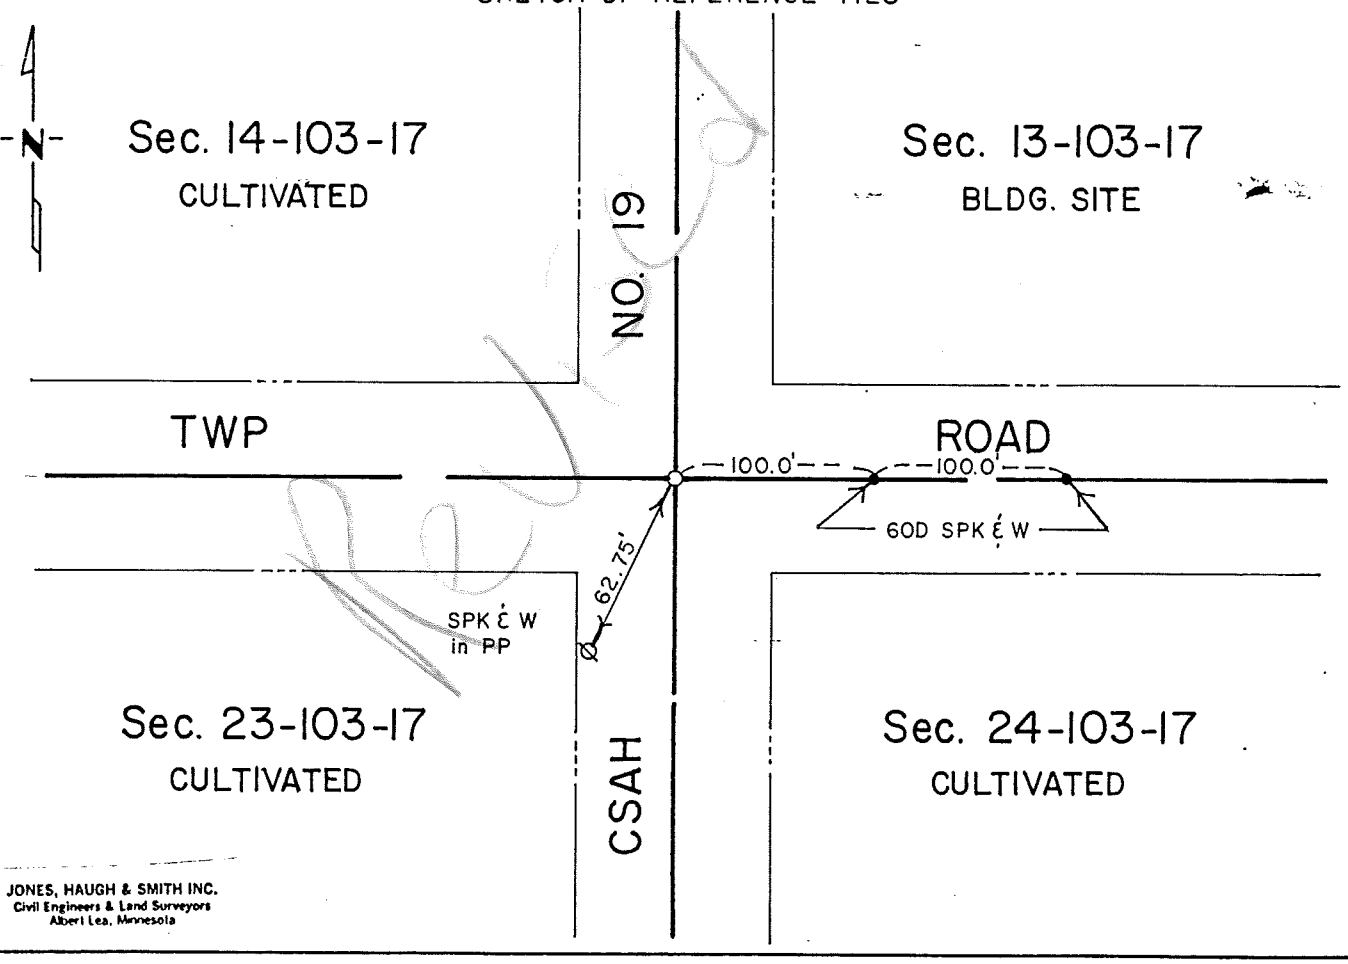

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 6-5-91

Registration No. 13807

☑ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the ____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NW corner Section 24-103-17

This corner was originally established by Deputy Surveyor William I. Anderson of the U.S. General Land Office in 1853. The government notes show a charred stake was set with a mound of earth and trench.

The following were contacted for section corner information:
Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1986 Ray Tucker, RLS 15471, recorded in Book "A" in the County Engineer's office that the corner was a 1/2" diameter re-bar with plastic cap RLS 15471 and the following ties were taken:

62.65	SW	Double headed nail in PP
57.18	SE	Nail in fence post
65.0	NE	Nail in fence post
80.0	SE	to 3/4" diameter iron
75.0	SW	to 3/4" diameter iron
80.0	NE	to 3/4" diameter iron

1991 Jones, Haugh & Smith Inc crew, under the direction of John H. Schulte RLS 13807, dug with the County backhoe for 1991 grading project SAP 50-619-15 and uncovered a 1/2" X 24" iron capped RLS 15471. Continued digging a 6' x 8' x 5' deep hole and found no further evidence of a public land survey corner or a perpetuation of. Statement from County Engineer and Employees indicate Ray Tucker excavated with the County backhoe for the corner, but no Certificate of Location was ever filed. If this being the case, any evidence was probably destroyed at that time. Accepted a 1/2" diameter iron and set a cast iron monument at the same location.

The monument fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.