Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 1, Township 103N Range 18W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On NOV 1991 (DATE) found a HARRISION CIM OVER A 5"ø CLAY TILE WITH 3/4"ø CAST IRON IN CONC.

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On NOV 1991 (DATE) placed a CIM NEAR ROAD SURFACE

SKETCH OF REFERENCE TIES

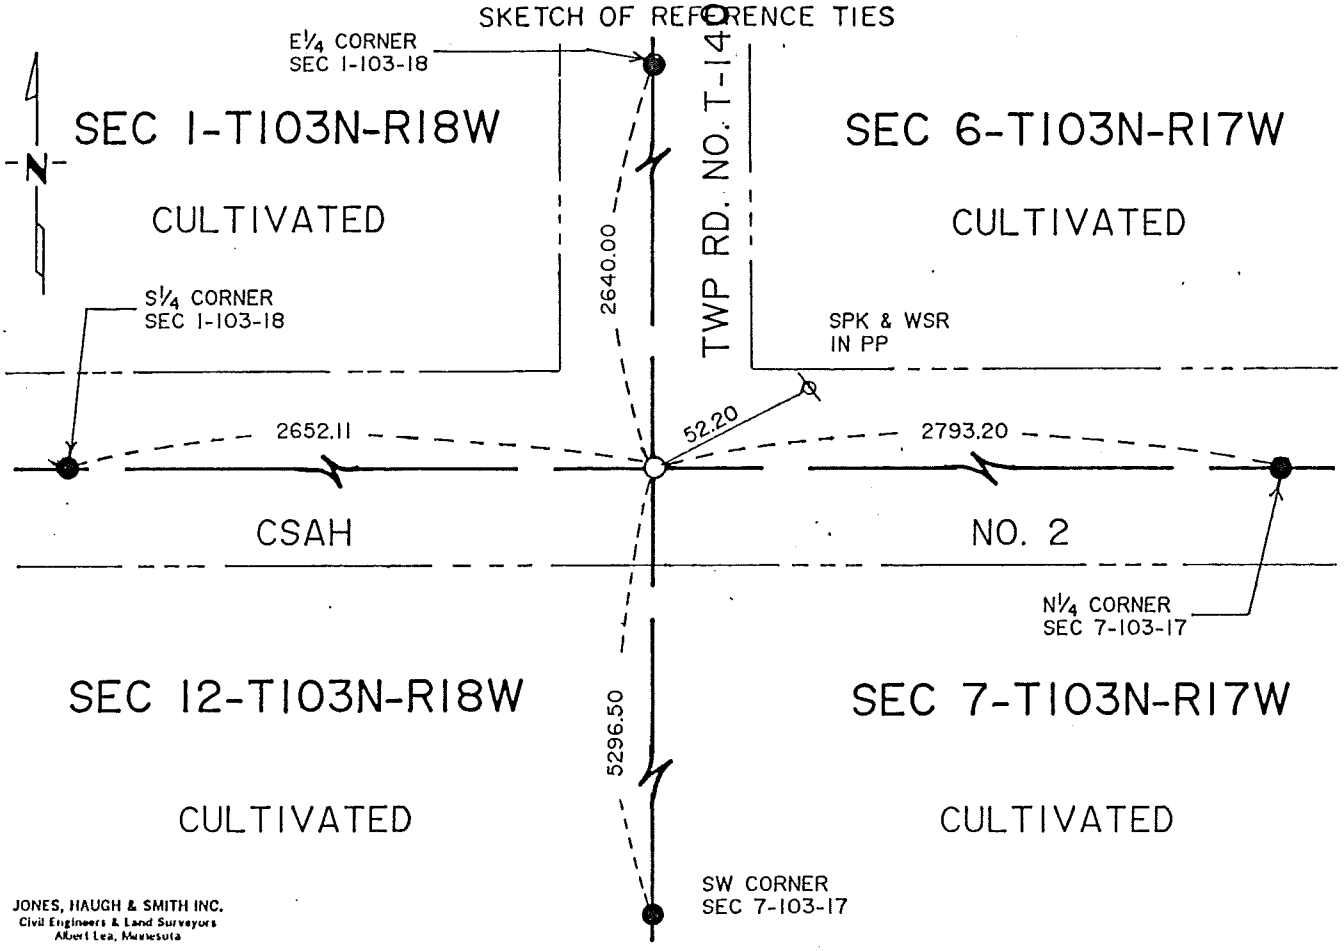

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 5-10-93

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 11 A .M. on the 13 day of May A.D., 19 93

COUNTY RECORDER Amanda Ezrow

By Marlene Martin, Deputy

DOCUMENT NO. 420706

Bk 79 Misc Pg. 415

M.H.D. FORM NO. 2105

BOOK 79 PAGE 415

STATEMENT OF EVIDENCE

SE corner Section 1-103-18

This corner was originally established by Deputy Surveyor Elisha S. Norris of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench. The following ties were taken:

8" Burr Oak	N 15° E	291 links (192.06 ft)
16" Burr Oak	S 45° E	144 links (95.04 ft)
7" Burr Oak	S 67° W	131 links (86.46 ft)

The following were contacted for section corner information:

Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

The following information was obtained to support evidence of a perpetuation of the original public land survey corner.

1884 Clausen, Mower County Surveyor, found a government post at the southeast corner of Section 1.

1926 Mower County Highway Department found southeast corner during survey of CSAH No. 2. The following ties were taken:

83.0' SW to big Burr Oak
32.5' NW to corner fence post
27.4' S to fence post

1942 Mower County Highway Department indicates a tile monument was found at the southeast corner during a survey of CSAH No. 2. The following ties were taken:

53.0'	SE to tele pole	46.3'	S to corner fence post
54.0'	NE to power pole	86.0'	S to wood fence post
87.0'	NNW to steel fence post (stake)		
86.0'	S to wood fence post at knob		
98.2'	NNE to 2nd steel post (stake)		

1987 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, Reg. No. 13807, dug on centerline centerline of north-east-west roads and found a 5/8" diameter iron cast in concrete in a 6" diameter clay tile 2.5 feet below road surface. Set a cast iron monument over monument found.

1991 Jones, Haugh & Smith Inc crew under the direction of John H. Schulte IV, Reg. No. 13807, dug with county backhoe and found a harrison cast iron monument over a 5" diameter clay tile with 3/4" diameter cast iron in concrete at a depth of 3 feet deep. Found no further evidence of original public land survey corner. The monument found is in agreement with past said records. Therefore we set cast iron monument near road surface over monuments found.

The monument set fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

BOOK 79 PAGE 416