Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

S 1/4 Corner of Section 6, Township 104N Range 17W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 09/03/1993 (DATE) found a _____

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 09/03/1993 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

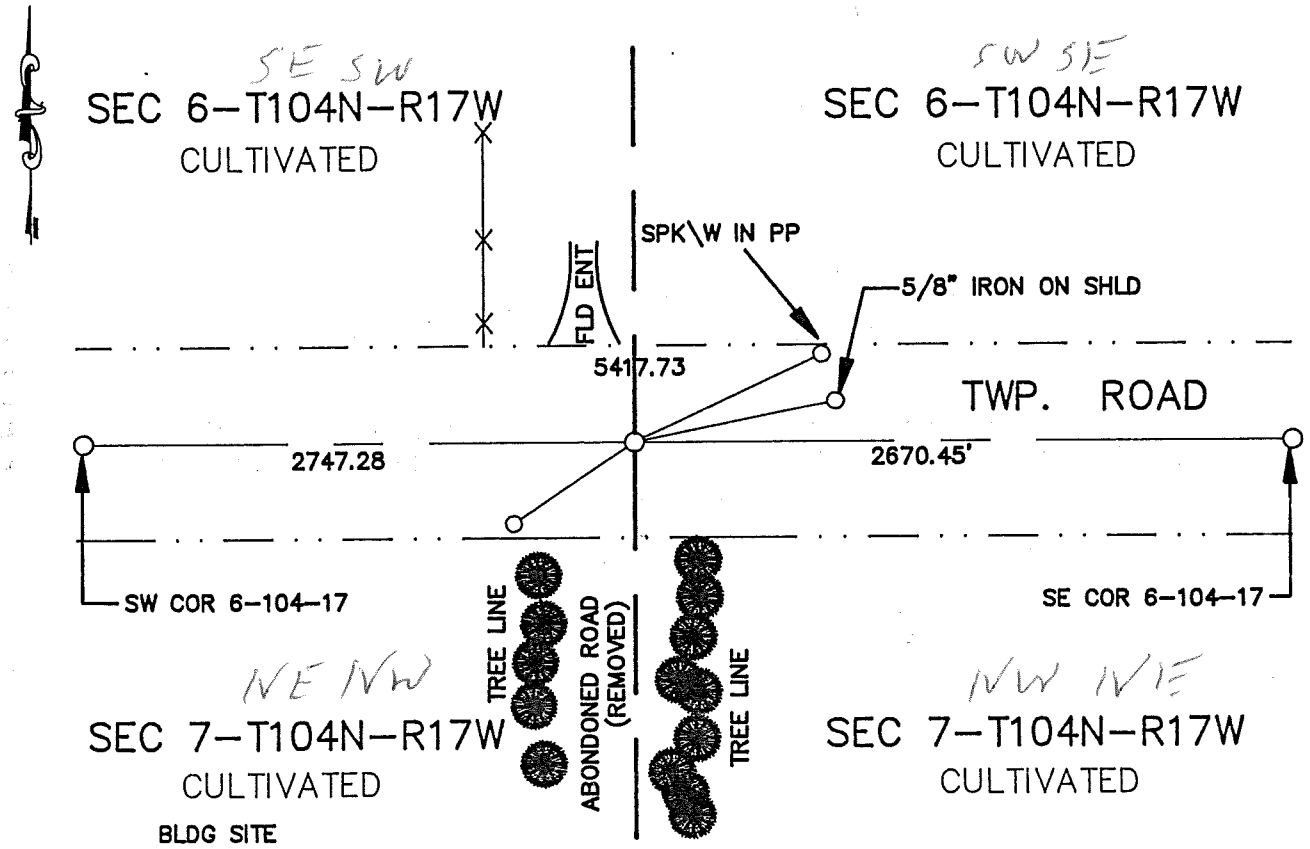

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

_____ (SIGNATURE) 1-30-96 (DATE)

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 3p .M. on the 2 day of Feb A.D., 1996

COUNTY RECORDER Charles Engen

By Susan M. Davis, Deputy

DOCUMENT NO. 442319

M.H.D. FORM NO. 2105 BOOK 90 PAGE 172 Book 90 Misc Page 172

S 1/4 Cor SEC 6-104-17

This corner was originally established by Deputy Surveyor John Fitzpatrick of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

1882 M.N. Claussen, Mower County Surveyor, placed a stone on a straight line between NW and NE corners of section 7.

1993 Jones, Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug with county backhoe at the CL of township road E-W and in line with line fence North. Dug to clay and found no evidence of corner. We then measured Claussen distance of 2671.68' from the SE corner of section 6 and found this point to be 30'+- East of fence line to the North but in line with CL of old road bed south, we then dug a 5'x15'x6' deep hole on the CL of E-W township road at this location and found no evidence of corner. We also dug a 4'x12'6' deep hole on a straight line between the SW and SE corners of section 6 at the Claussen's distance from the SE corner and found no evidence of corner. We then placed a cast iron monument on a straight line between the SW and SE corners at a proportional part distance in accordance with PLS rules the distance to the SE corner was found to be 2670.45 vs. Claussen 2671.68 and the distance to the SW corner was found to be 2747.28 vs. Claussen 2746.92. CIM is 7+- South of township road CL. This location is in accordance with Claussen's record for the S 1/4 corner.

The monument fit occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.