Index No. _____

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NE Corner of Section 30, Township 102N, Range 17W, 5TH P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 8-7-85 (DATE) found a NO EVIDENCE OF CORNER

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 8-7-85 (DATE) placed a conc. nail & W. in bridge deck

SKETCH OF REFERENCE TIES

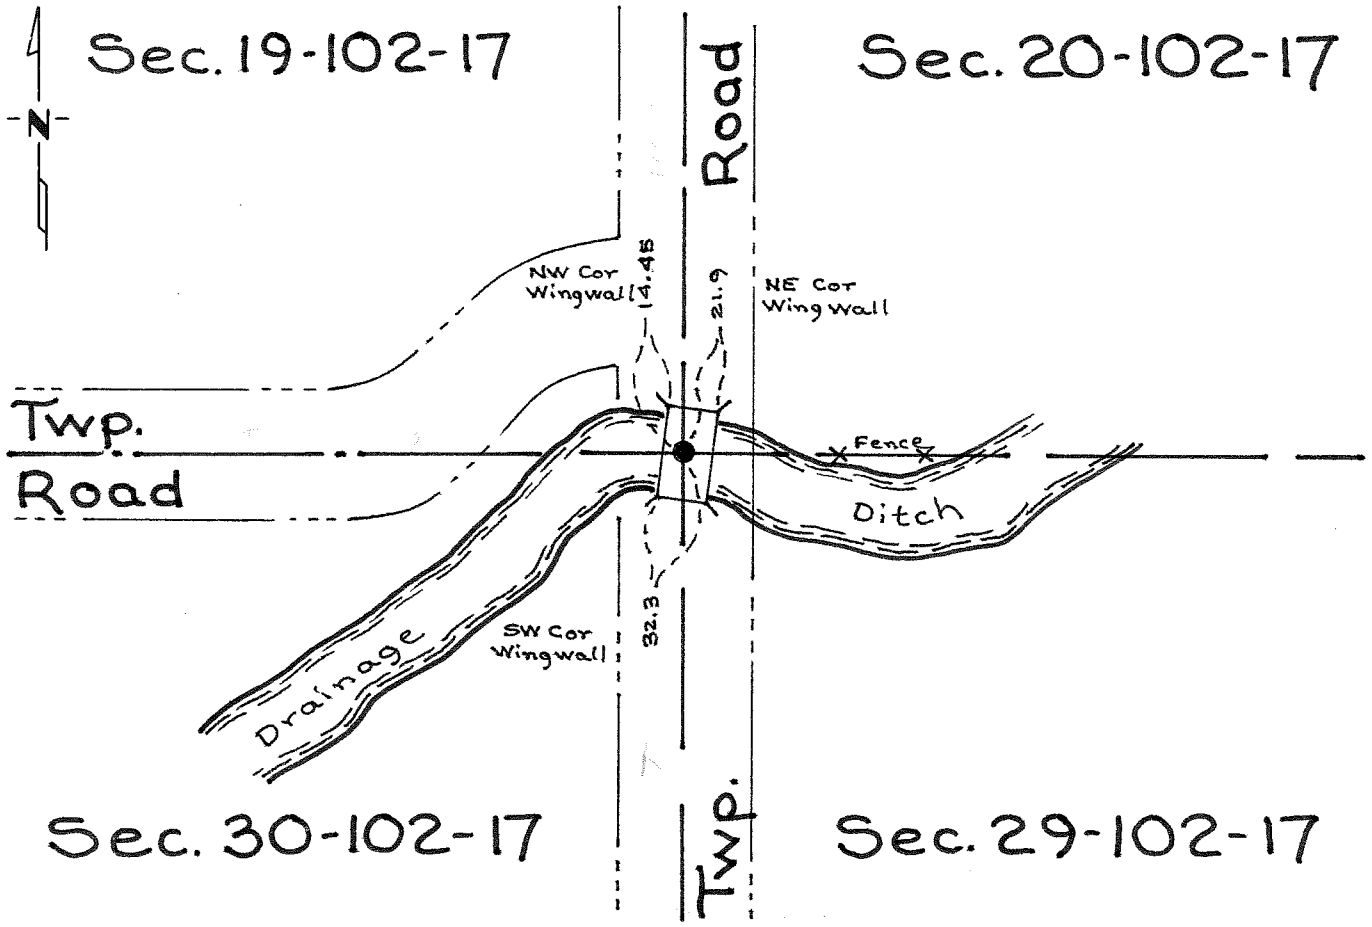


Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE 12-12-88

Registration No. 13807

☒ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE
NE corner Section 30-102-17

This corner was originally established by Deputy Surveyor William I. Anderson of the US General Land Office in 1854. The government notes show this corner was marked with a wood post and the following bearing trees were marked:

| | | |
|---|---|---|
| 9" Burr Oak | N $15\frac{1}{2}^{o}$ W | 238 Links |
| 7" Burr Oak | N $55^{o}$ E | 174 Links |

The following were contacted for section corner information:

Mower County Highway Department

1985 Jones, Haugh & Smith crew found no evidence of public land survey corner or a perpetuation of. Appears corner was destroyed by rechanneling of creek and bridge construction. Therefore established position of corner using obliterated methods.

For electronic survey data and analysis, contact firm of Jones, Haugh & Smith

"I" TIE BOOK p.54 Index No. _____

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NE Corner of Section 30, Township 102N, Range 17W, 5TH P.M.

STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☐ On _____ (DATE) found a _____

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On 8-7-85 (DATE) placed a concrete nail & washer in bridge deck

SKETCH OF REFERENCE TIES

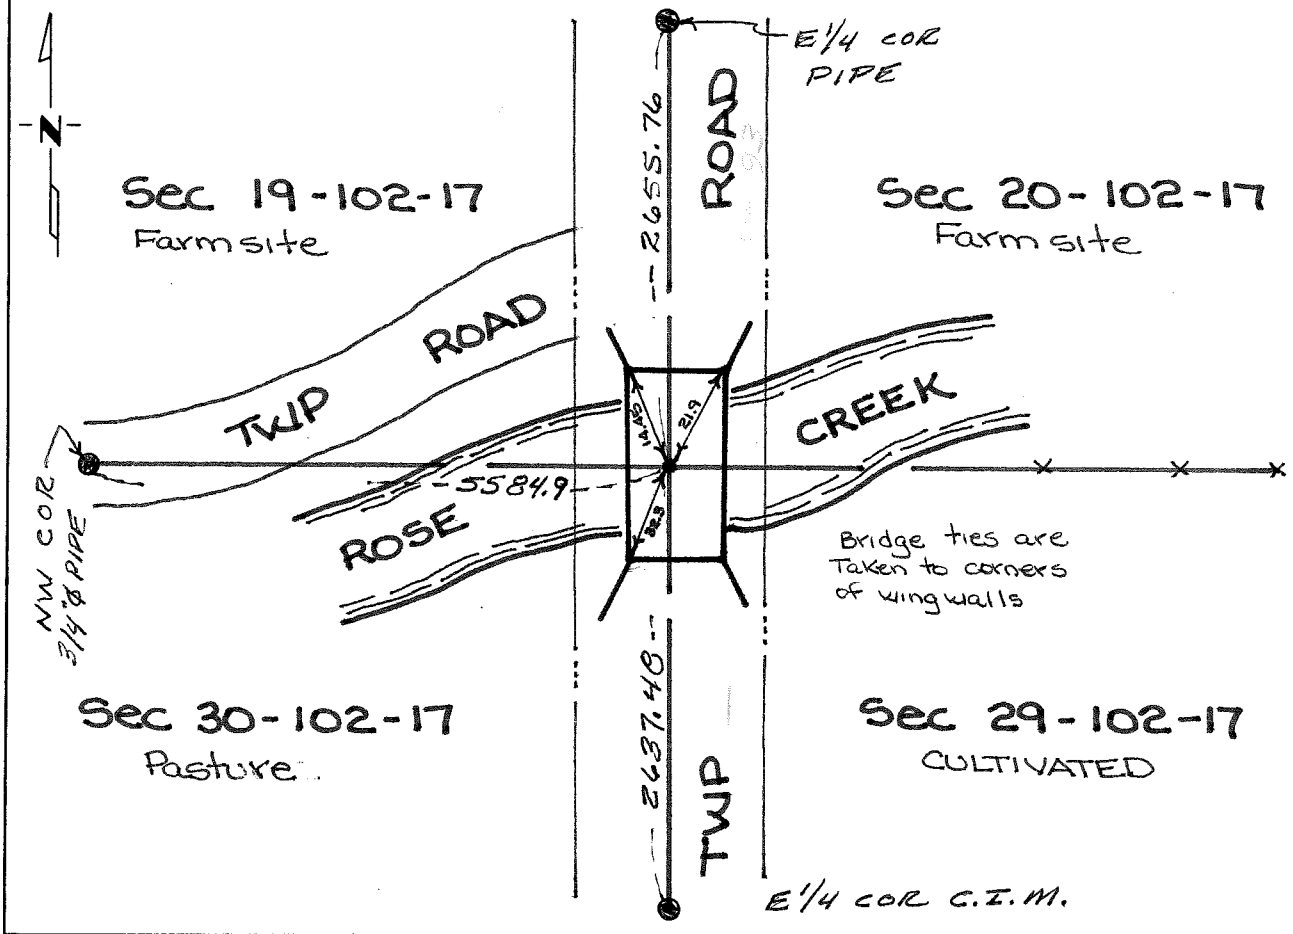


Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

John H. Schutt III
SIGNATURE

10-10-95
DATE

Registration No. 13807

☑ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

NE corner Section 30-102-17

1854 William I. Anderson, Deputy Surveyor, set wood post during public land survey.

1985 Jones, Haugh & Smith Inc survey crew found no evidence of original public land survey corner or bearing trees. Therefore established the corner using obliterated methods, as follows:

Used centerline of bridge at northeast corner to control east-west position since it fit centerline of roads to north and south.

Measured north from E¼ corner Section 30 to existing fence line west at northeast corner of the SE¼ NE¼ Section 30 and found a distance of 1318.74 feet. Doubled this distance and set temporary point on centerline of bridge for northeast corner. Then measured north from temporary point to field division west at northeast corner of the SE¼ SE¼ Section 19-102-17 and found distance of 1328 feet more or less. Continued measuring north to E¼ corner Section 19, and found 2655.76 feet.

Found remains of old fence line east on south bank of creek, which fits temporary point and extended centerline of township road to west and found that it checked with temporary point.

Found that temporary point fits existing fence lines, field division and road centerlines. Therefore we set concrete nail and washer at temporary point and took ties as shown; and accepted this location as best of location of the original public land survey corner using existing extrinsic evidence.

Index No. _____

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

S1/4 Corner of Section 35, Township 102N Range 17W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 09/20/1995 (DATE) found a –

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 09/20/1995 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

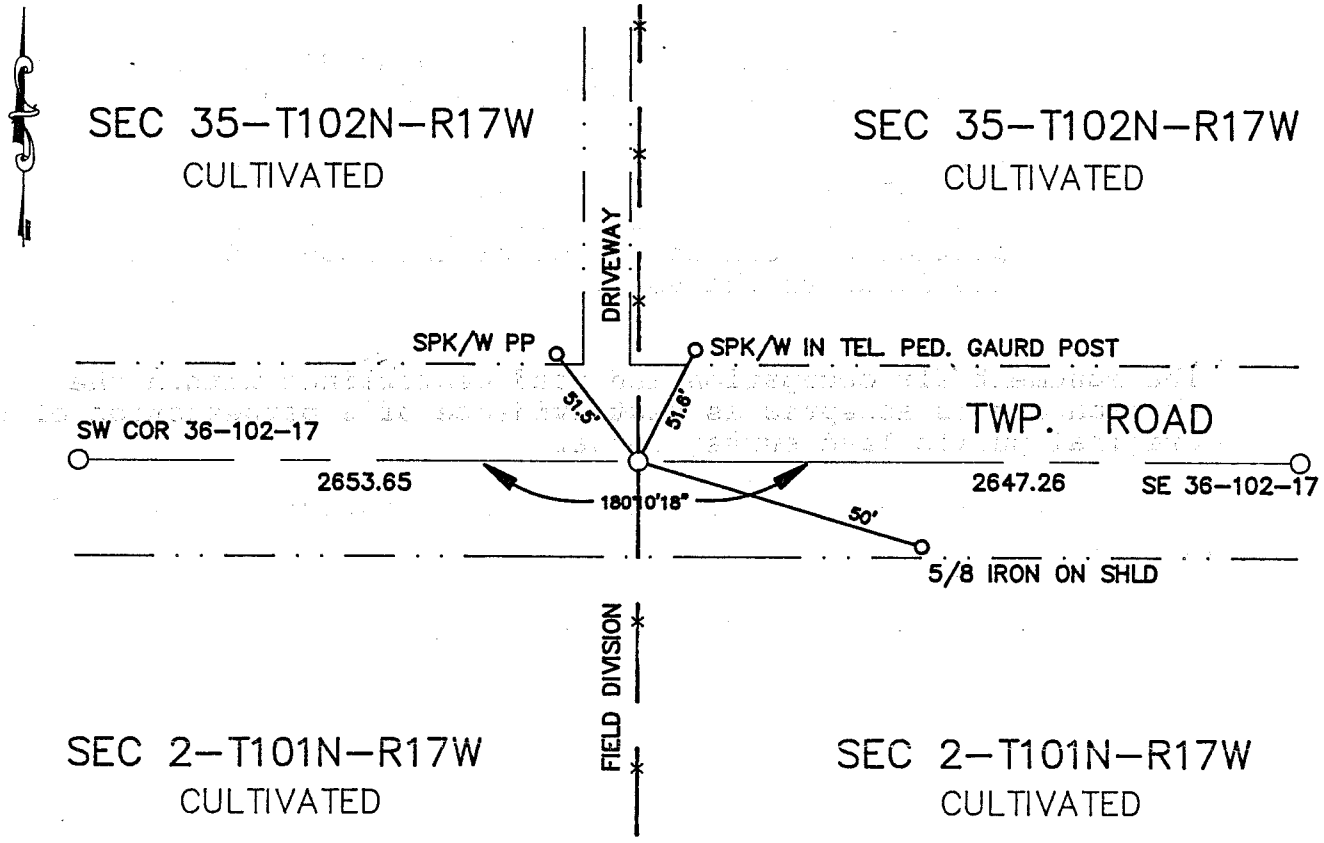


JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

[signature] 1-26-96
SIGNATURE DATE

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 3 p .M. on the 29 day of Jan A.D., 1996

COUNTY RECORDER Charles Enger
By Susan M. Davis, Deputy
DOCUMENT NO. 44201

M.H.D. FORM NO. 2105 BOOK 90 PAGE 107

Book 90 Misc Page 107

S 1/4 Cor SEC 35-102-17

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

No record of this corner was obtained from the above mentioned offices.

1995 Jones, Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug with county backhoe at the CL of township road E-W and in line with field divisions North and South. Dug to virgin soil and found no evidence of original PLS corner. Placed a cast iron on the CL of road and in line with field divisions North and South.

The monument fit occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

Index No. _____

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SE Corner of Section 35, Township 102N Range 17W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 09/20/1995 (DATE) found a 5/8" IRON PIN OVER WOOD HUB 1'x4"x1/2' METAL OBJECT

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 09/20/1995 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

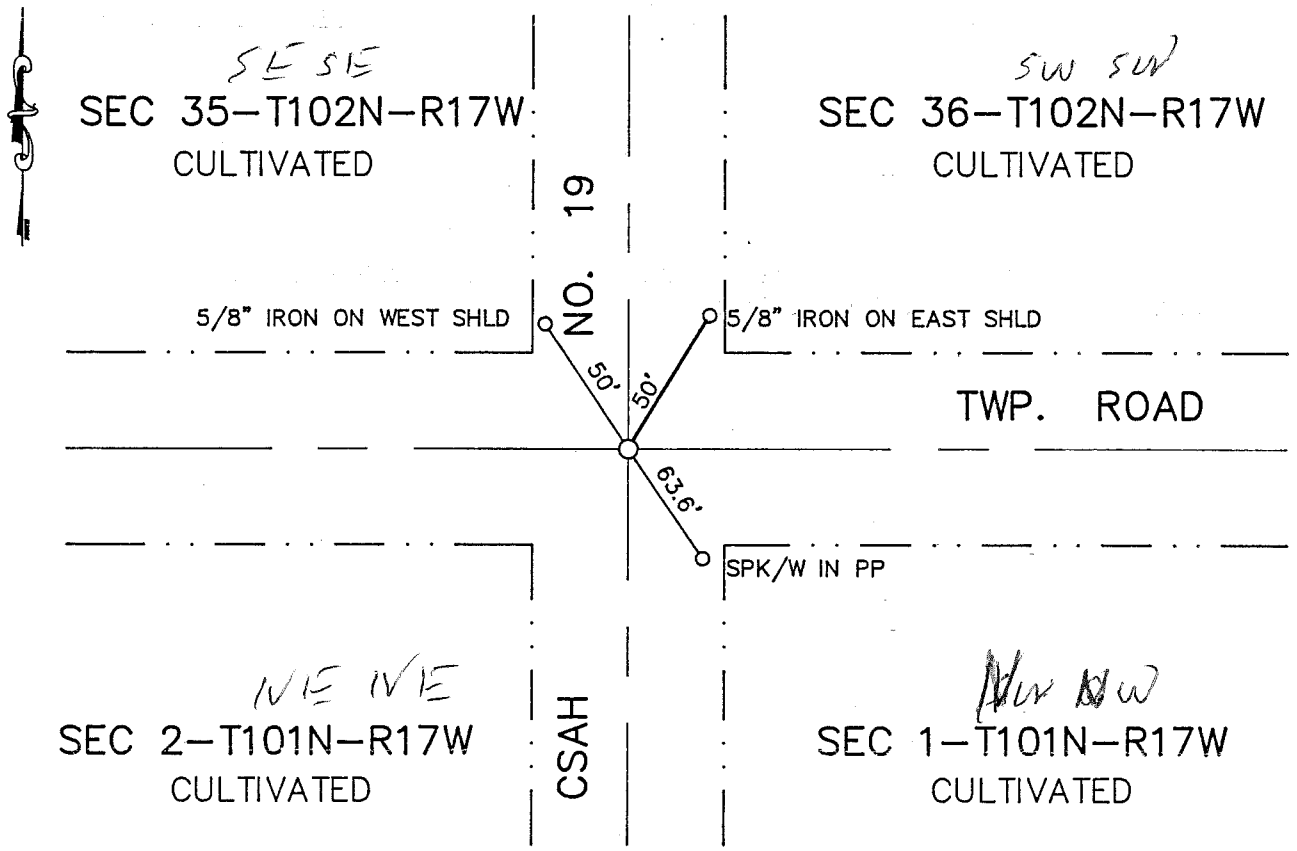


JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 1-5-96

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☒ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 2 P.M. on the 8 day of Jan A.D., 1996

COUNTY RECORDER Charles Engen

By Susan M. Davis, Deputy

DOCUMENT NO. 441814

M.H.D. FORM NO. 2105 BOOK 90 PAGE 11 Book 90 Misc Pg 11

SE Cor SEC 35-102-17

This corner was originally established by Deputy Surveyor John Ball of the U.S. General Land Office in 1853. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

1930+- Mower Co. road plans show a monument in this location.

1977 Jones, Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug by hand at the intersection of township roads. Found a 2x2' wooden hub on the North side of a 1'x4"x1/2" metal object. Placed a 5/8" iron on the South side of the wood hub.

1995 Set a cast iron monument over 5/8" iron found.

The monument fit occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.