CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHEAST Corner of Section 22, Township 102N Range 18W, 5 P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

On 7-11-90 found 5/8" REBAR AND CAP #13807 REMOVED DURING EXCAVATION

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

On 7-11-90 placed COUNTY CAP ON 3/4" REBAR

SKETCH OF REFERENCE TIES

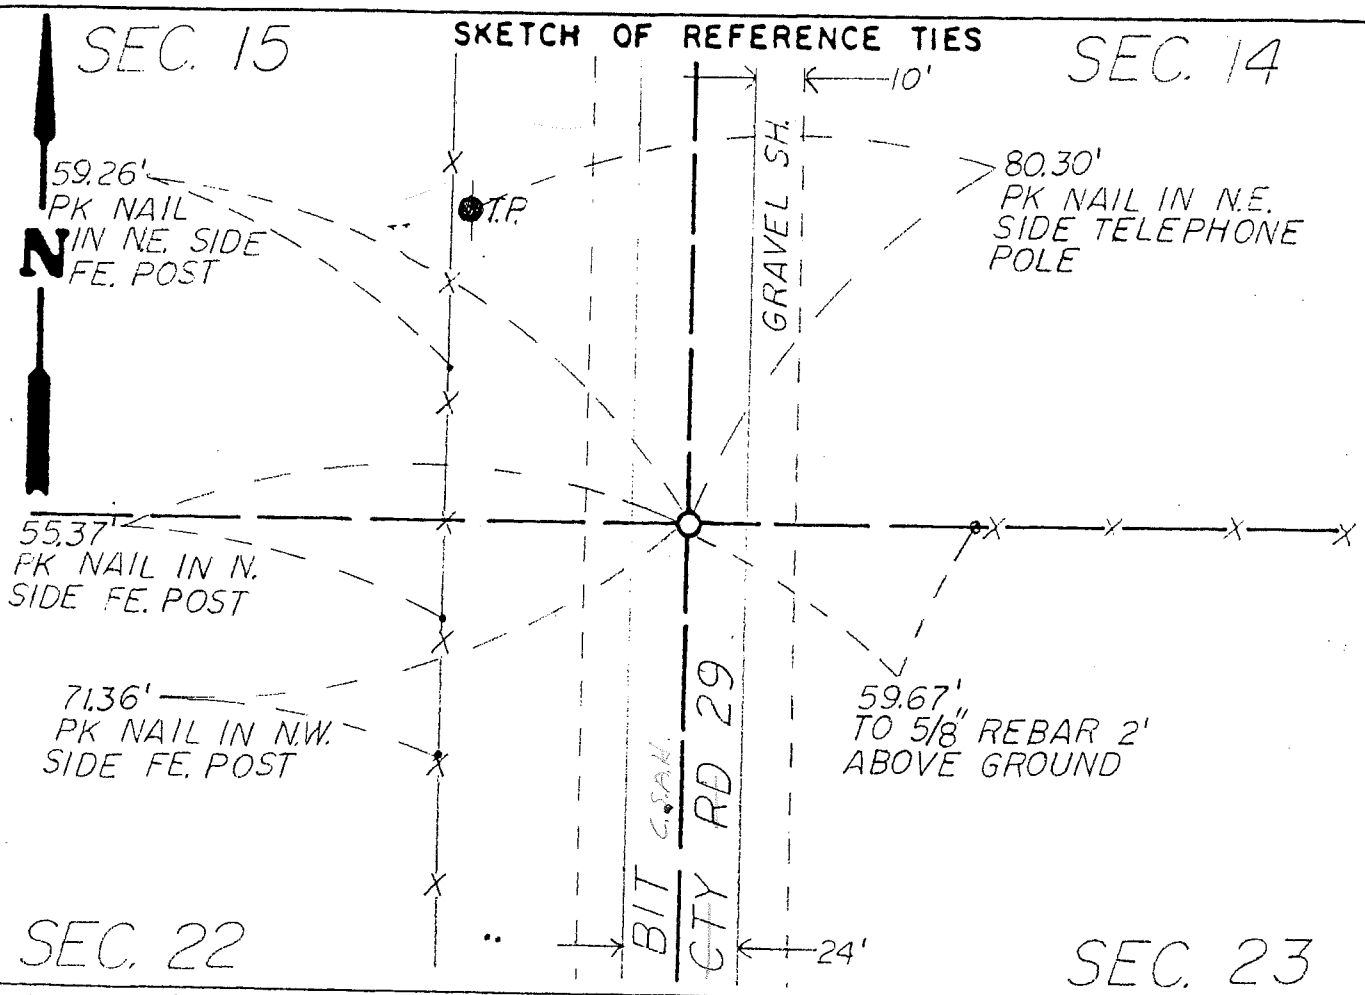

Statement of evidence relative to this corner location is on back of page

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Ronald J. Olson — Signature
7-13-90 — Date

Registration No. 11009

☒ Land Surveyor ☐ Prof Engineer
☐ County Surveyor ☐ County Engineer

Zenk·Read·Trygstad & ASSOCIATES, INC.
Engineers / Architects / Land Surveyors / Planners
Box 689, Albert Lea, MN 56007 507/373-0689

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Recorders office at _____.M. on the _____ day of _____ A.D., 19___.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

Statement of Evidence

NORTHEAST CORNER SECTION 22, TOWNSHIP 102 NORTH, RANGE 18 WEST, 5TH P.M.

July, 1854 — William Anderson, Deputy Surveyor set post during the original Public Land Survey.

1914 — County Engineer's plan - Profile & Cross-Section sheet for State Road #5 shows a stone inplace.

1969 — County Engineers Plans show a concrete Monument inplace.

1989 — County Engineers Plans show that a 3/4" diameter iron Rod was set at the corner. This area was core cut during road construction and evidence of the corner was lost.

Nov., 1989 — County Engineers office set PK and recorded Post Construction Ties

1989 — Jones Haugh & Smith Inc. placed a rebar with cap at the corner location based on their survey records.

June, 1990 — Zenk Read Trygstad & Associates excavated with a backhoe a trench 7 feet below surface and 1 foot West to 5 feet East of centerline from 6 feet South to 6 feet North of centerline. A 3/4" Diameter rod was found at the surface and nothing more was recovered during the excavation.

An analysis of the record data indicates the corner was obliterated by road construction in 1989 and was replaced from survey records in 1989. The position of the rod is accepted as marking the location of the original Public Land Survey Corner.

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 22, Township 102 N, Range 18 W, 3 P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

On 7-11-90 found 5/8" REROD

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

On 7-11-90 placed 3/4" REROD AND COUNTY CAP

SKETCH OF REFERENCE TIES

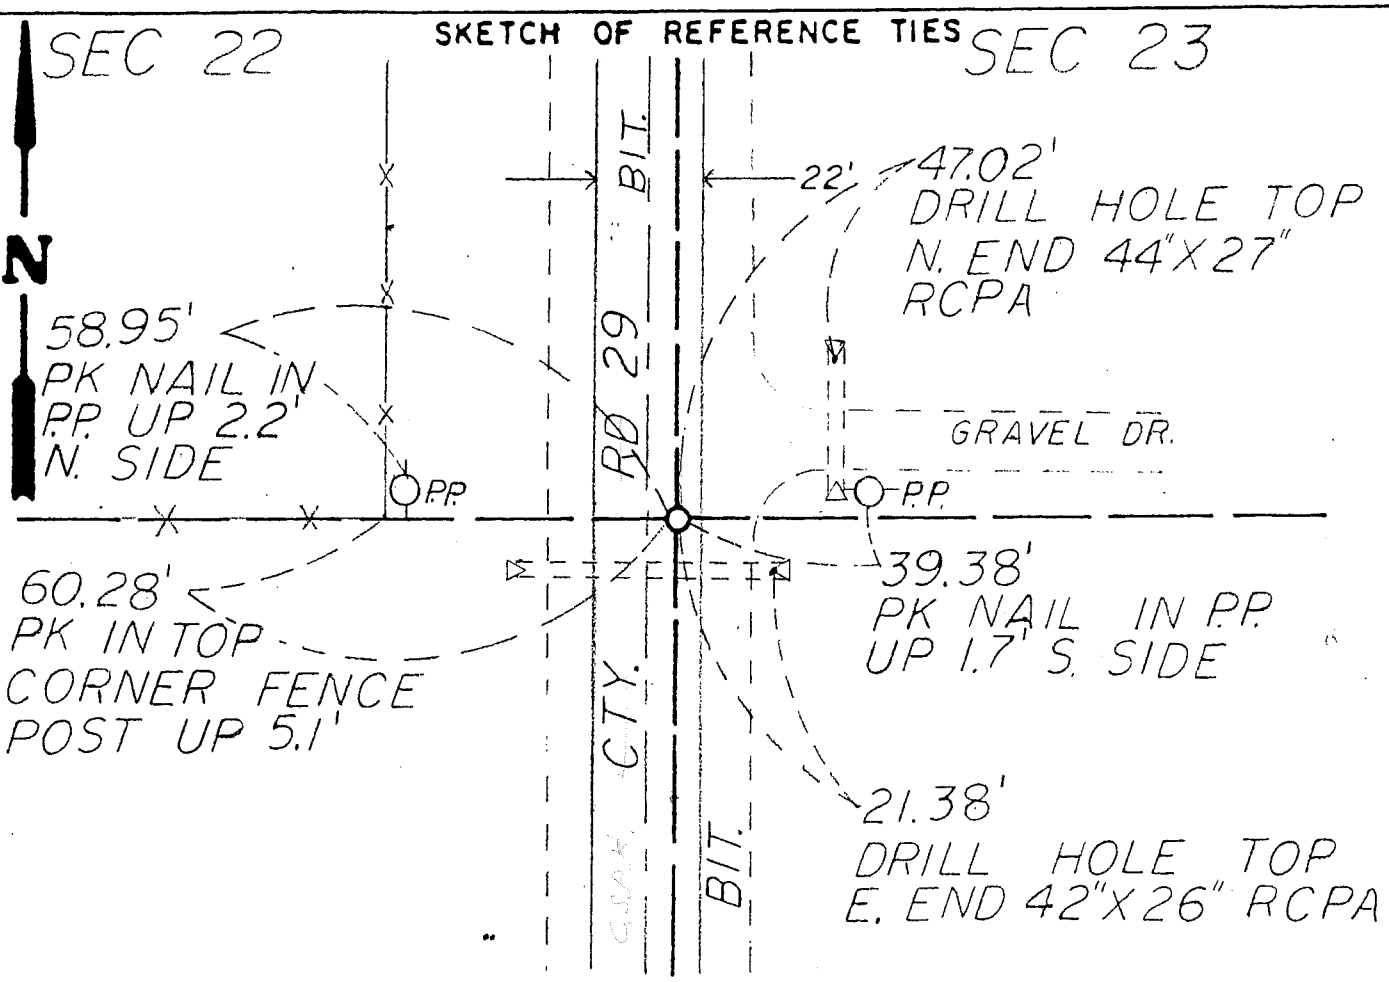

Statement of evidence relative to this corner location is on back of page

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Ronald J. Olson — Signature
7-13-90 — Date

Registration No. 11009

☒ Land Surveyor ☐ Prof Engineer
☐ County Surveyor ☐ County Engineer

Zenk•Read•Trygstad & ASSOCIATES, INC.
Engineers / Architects / Land Surveyors / Planners
Box 689, Albert Lea, MN 56007 507/373-0689

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Recorders office at _____.M. on the ____ day of _____ A.D., 19___.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

Statement of Evidence

EAST QUARTER CORNER SECTION 22, TOWNSHIP 102 NORTH, RANGE 18 WEST, 5TH P.M.

July, 1854 — William Anderson, Deputy Surveyor, set a post at the corner during the original Public Land Survey.

1962 — County Engineers Road Plans shows a 1/2" diameter iron rod inplace, and later set a PK on the new Road surface after construction.

Oct., 1983 — A survey crew for Hormel Inc. found a 5/8" rod in the Road during a survey for an Experimental Farm.

1989 — Mower County Engineer reconstructed the road and sub cut this area 2 feet. All evidence of the corner in this area was lost.

1989 — Jones Haugh & Smith Inc. placed a rebar and cap at the corner based on the information from their survey records.

June 1990 — Zenk Read Trygstad & Associates excavated with a backhoe 4.5 feet deep 2 feet East to 2 feet West of centerline by 4 feet South to 8 feet North of the fence line East. A stone was found 3.3 feet deep with pieces of a concrete monument on the Southwest side. A 1/2" pipe and cap #11009 was set on the Northwest side of the stone.

An analysis of the record data gives no indication of the origin of the stone. Similar stones have been found throughout the County at other Corner locations. The stone agrees with the occupation lines and is accepted as the location of the original Public Land Survey Corner.

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

W1/4 Corner of Section 25, Township 102N, Range 18W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

☐ On 5-14-91 (DATE) found a 5/8"Ø iron capped (13807)

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 5-14-91 (DATE) placed a cast iron monument over iron found.

SKETCH OF REFERENCE TIES

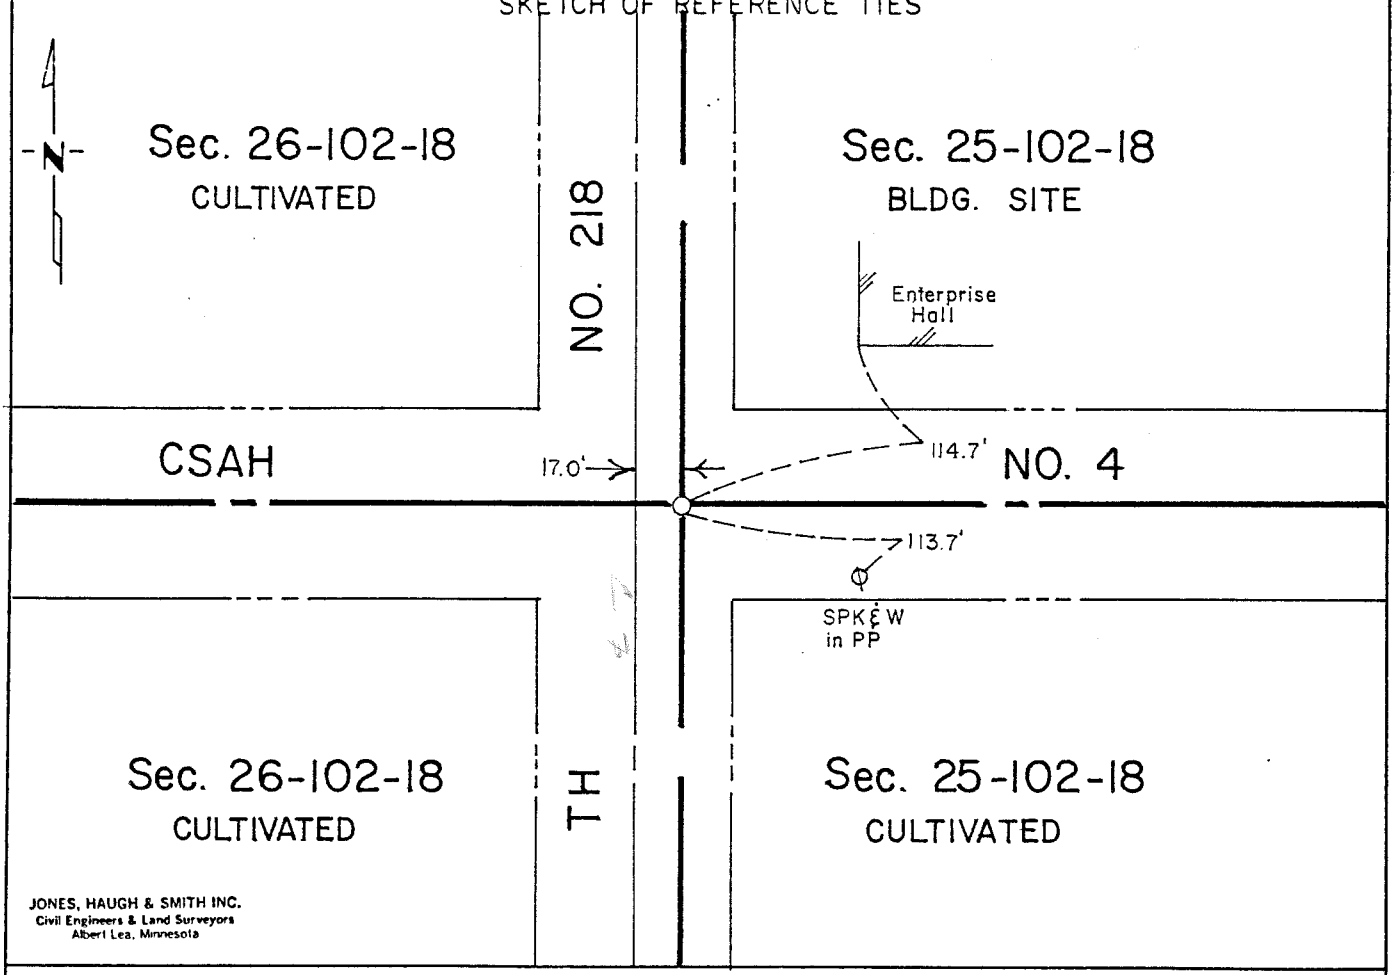

JONES, HAUGH & SMITH INC.
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

_____ SIGNATURE 5-16-91 DATE

Registration No. 13807

☑ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19__

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

W 1/4 corner Section 25-102-18

This corner was originally established by Deputy Surveyor William I. Anderson of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench. The following ties were taken:

12" Burr Oak S 73° E 130 links (85.80 ft)
6" Burr Oak S 82 1/2° W 150 links (99.0 ft)

The following were contacted for section corner information:

Mower County Highway Department
Mower County Recorder
Zenk Engineering
Tucker Land Survey

1972 Private notes from Jones, Haugh & Smith tie book shows the corner 17.1 feet east of the centerline of U.S. Highway 218. The following notes were taken:

MHD Sta. 281+99.9
Spike and W 36" Elm NE 63.85'
Spike and W TP NW 66.1'

1982 Jones, Haugh and Smith Inc crew located a corner and placed a capped 5/8" diameter iron 1.45' south of old corner and 17.1' east of the centerline of Highway 218 during the survey in SE 1/4 SE 1/4 Section 26-102-18 using monumentation and information from TH 218 R/W map.

1991 Jones, Haugh & Smith Inc crew, under the direction of John H. Schulte, for bituminous overlay project SAP 50-604-18, placed a cast iron monument over 5/8" diameter iron capped 13807 placed in 1982 on centerline of E-W road and 17.1' east of the N-S road centerline.

The monument agrees with past records and fits occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHEAST Corner of Section 27, Township 102N Range 18W, 5 P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

On 7-11-90 found NOTHING

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

On 7-11-90 placed 5/8" ROD AND COUNTY CAP

SKETCH OF REFERENCE TIES

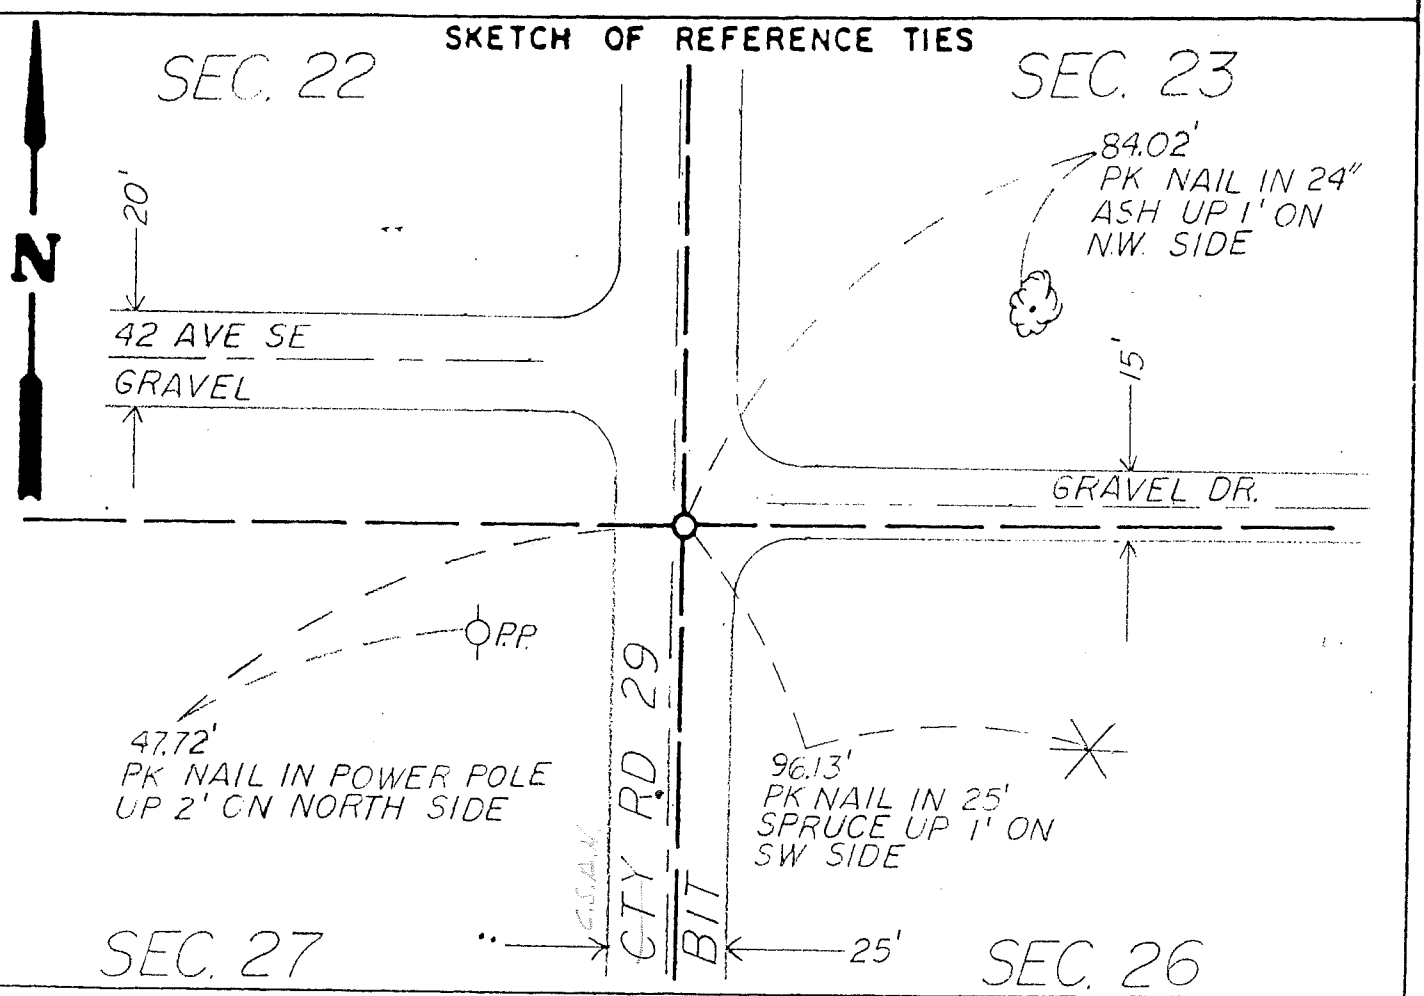

Statement of evidence relative to this corner location is on back of page

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Ronald J. Olson — Signature
1-13-90 — Date

Registration No. 11009

☒ Land Surveyor ☐ Prof Engineer
☐ County Surveyor ☐ County Engineer

Zenk·Read·Trygstad & ASSOCIATES, INC.
Engineers / Architects / Land Surveyors / Planners
Box 689, Albert Lea, MN 56007 507/373-0689

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the County Recorders office at _____ .M. on the ____ day of _____ A.D., 19___.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

Statement of Evidence

NORTHEAST CORNER SECTION 27, TOWNSHIP 102 NORTH, RANGE 18 WEST, 5TH P.M.

July, 1854 — William Anderson, Deputy Surveyor, set a post at the corner during the original Public Land Survey.

Oct., 1983 — Hormel Inc. Survey Crew found a 3/4" diameter rod during a survey for an Experimental Farm.

1989 — County Engineers Plans shows a PK nail inplace over the corner.

1989 — Mower County Engineer reconstructed the road in this area and subcut to 2 feet below the surface. Evidence of the corner at this depth was lost.

May 24, 1990 — A Zenk Read Trygstad & Associates crew searched the area with a magnetic locator and found nothing.

Analysis of the record data indicates the corner evidence was lost during road reconstruction. The corner was reestablished by survey from the Plats of Riverwood Estates and Riverwood Estates Second Subdivision.

The position is accepted as the location of the original Public Land Survey Corner.

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 27, Township 102 N, Range 18 W, 5 P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch:

On 7-2-90 found STONE 1.2 x 1.2 x 2.1 H.

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

On 7-11-90 placed COUNTY CAP ON A 3/4" REBAR

SKETCH OF REFERENCE TIES

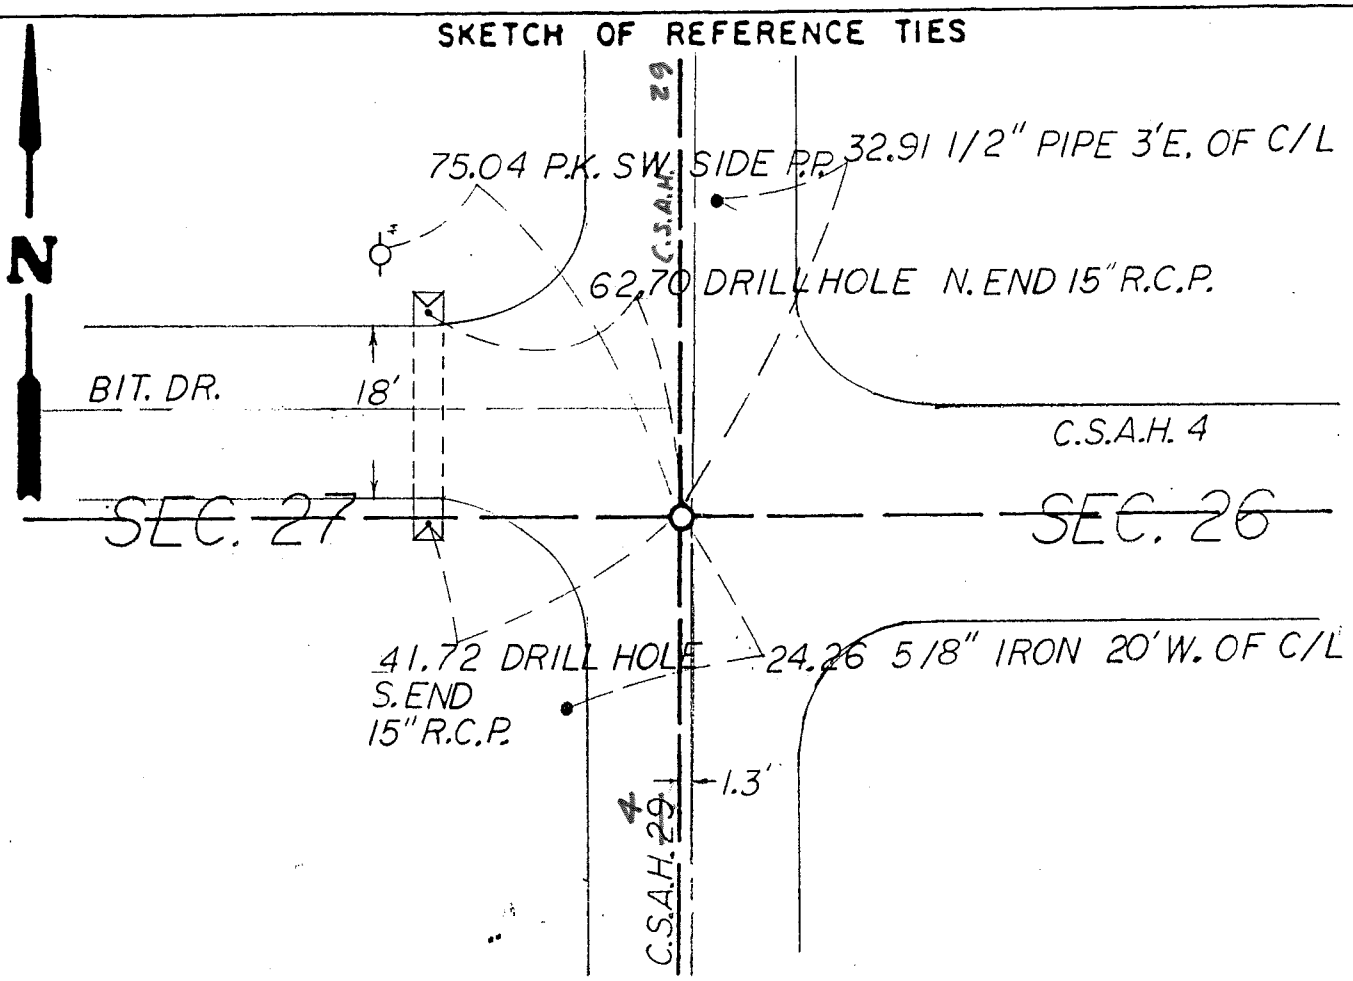

Statement of evidence relative to this corner location is on back of page

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Ronald J. Olson — Signature

7-13-90 — Date

Registration No. 11009

☒ Land Surveyor ☐ Prof Engineer

☐ County Surveyor ☐ County Engineer

Zenk•Read•Trygstad & ASSOCIATES, INC.

Engineers / Architects / Land Surveyors / Planners

Box 689, Albert Lea, MN 56007 507/373-0689

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Recorders office at _____ .M. on the ____ day of _____ A.D., 19___.

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

Statement of Evidence

EAST QUARTER CORNER SECTION 27, TOWNSHIP 102 NORTH, RANGE 18 WEST, 5TH P.M.

July, 1854 — William Anderson, Deputy Surveyor, set a post at the corner during the original Public Land Survey.

1964 — Page 127 of the Mower County Surveyors Record shows a stone and 1" pipe inplace.

1989 — County Engineers Road Plans shows a PK nail inplace over the corner.

July 2, 1990 — Ronald J. Olson, RLS #11009, excavated with a backhoe a trench two feet North to three feet South of centerline of C.S.A.H. #4 and 2 feet East, four feet below surface, to three feet West, 4.5 feet below surface, of the centerline of C.S.A.H. 29 and found a 1.2'x1.2'x2.1' H stone 2.5 feet below surface and set in mottled soil. A 3/4 inch rebar was found two feet below surface driven into one inch pipe on North side of stone.

An analysis of the record data gives no indication of the origin of the stone. Stones of this size have been found and identified as replacements for many other corners throughout this county. The stone has been recognized as the corner by the County for the past 26 years and is accepted as marking the location of the original Public Land Survey Corner.