P 108 Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E. 1/4 Corner of Section 16, Township 103, Range 17, 5th P.M.

STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☐ On _____ (DATE) found a _____

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On Nov. 20, 1978 (DATE) placed a Chiselled "X" in concrete

SKETCH OF REFERENCE TIES

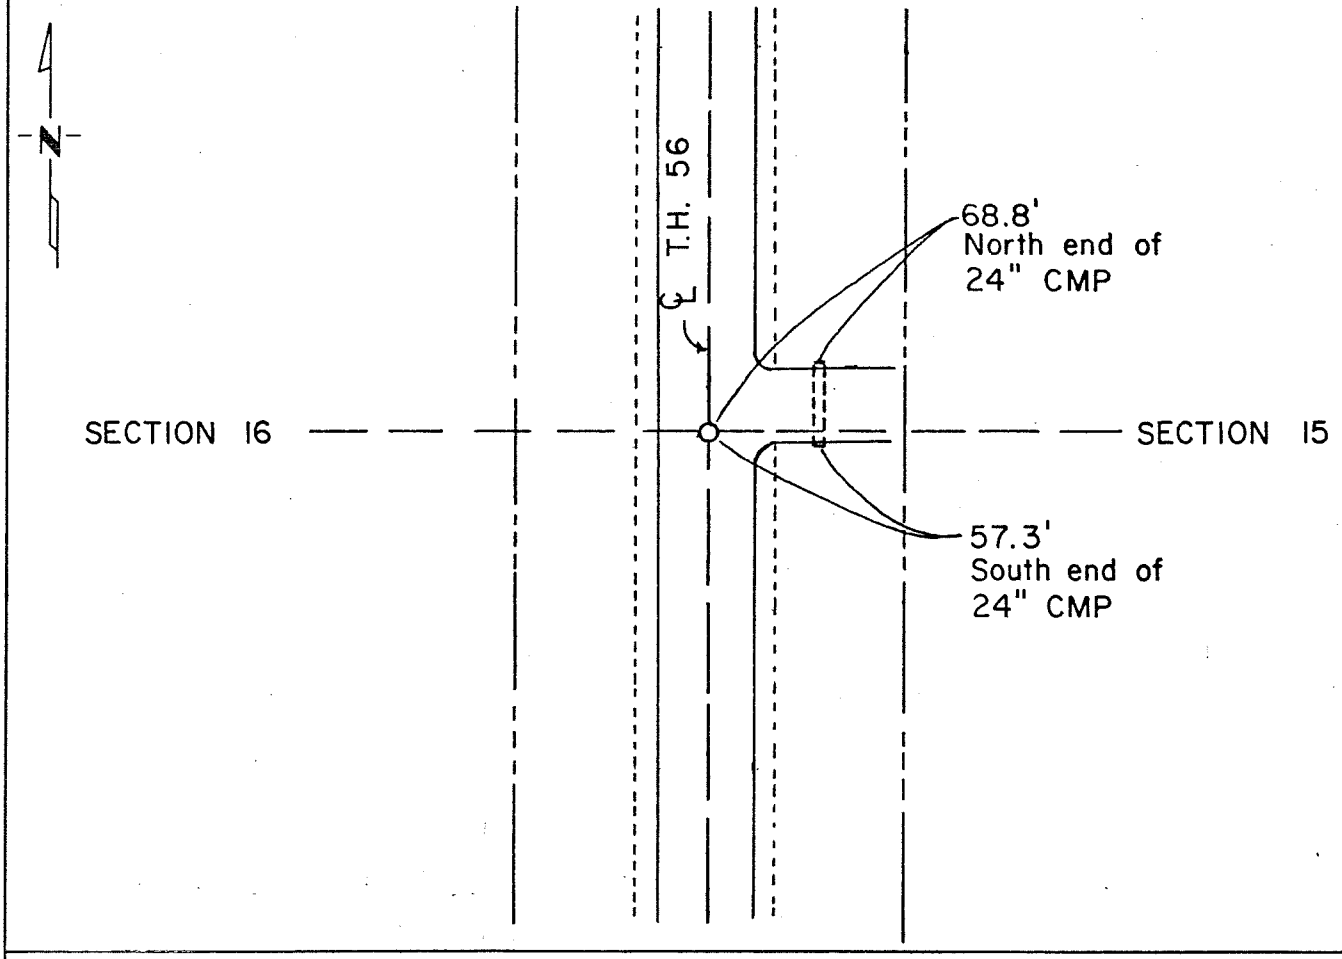

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Ronald J. Olson (SIGNATURE) 3-13-80 (DATE)

Registration No. 11009

☒ Land Surveyor, ☒ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the Recorder's office at 3:00 P.M. on the 13 day of March A.D., 1980

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. 343775

M.H.D. FORM NO. 2105

Statement of Evidence:

EAST QUARTER CORNER SECTION 16, TOWNSHIP 103 NORTH, RANGE 17 WEST, 5 P.M.

1854 William Anderson, Deputy Surveyor, set the corner in the original Public Land Survey.

1937 Minnesota Department of Transportation graded T.H. 56 at the corner and no evidence of the corner was indicated.

1973 Minnesota Department of Transportation regraded and placed concrete pavement on T.H. 56. No evidence of the corner was found.

1978 Zenk Engineering searched the area at the location of corner indicated by electronic measurement with a magnetic locator and no evidence of the corner was found.

An analysis of the record data and electronic survey data gives no indication of monument perpetuation for over 40 years. The corner was set on the extension of the fence of the E-W 1/4 line in Section 16 on the centerline of T.H. 56. The occupation lines in Section 15 & 16 agree with this location.

For details of the analysis and electronic survey data contact Zenk Engineering, Inc., Albert Lea, Minnesota 56007

TIE BOOK P 108 Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 16, Township 103, Range 17, _____ P.M.

STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☐ On _____ (DATE) found a _____

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☒ On ~~Nov. 20, 1978~~ (DATE) placed a Chiselled "X" in concrete

SKETCH OF REFERENCE TIES

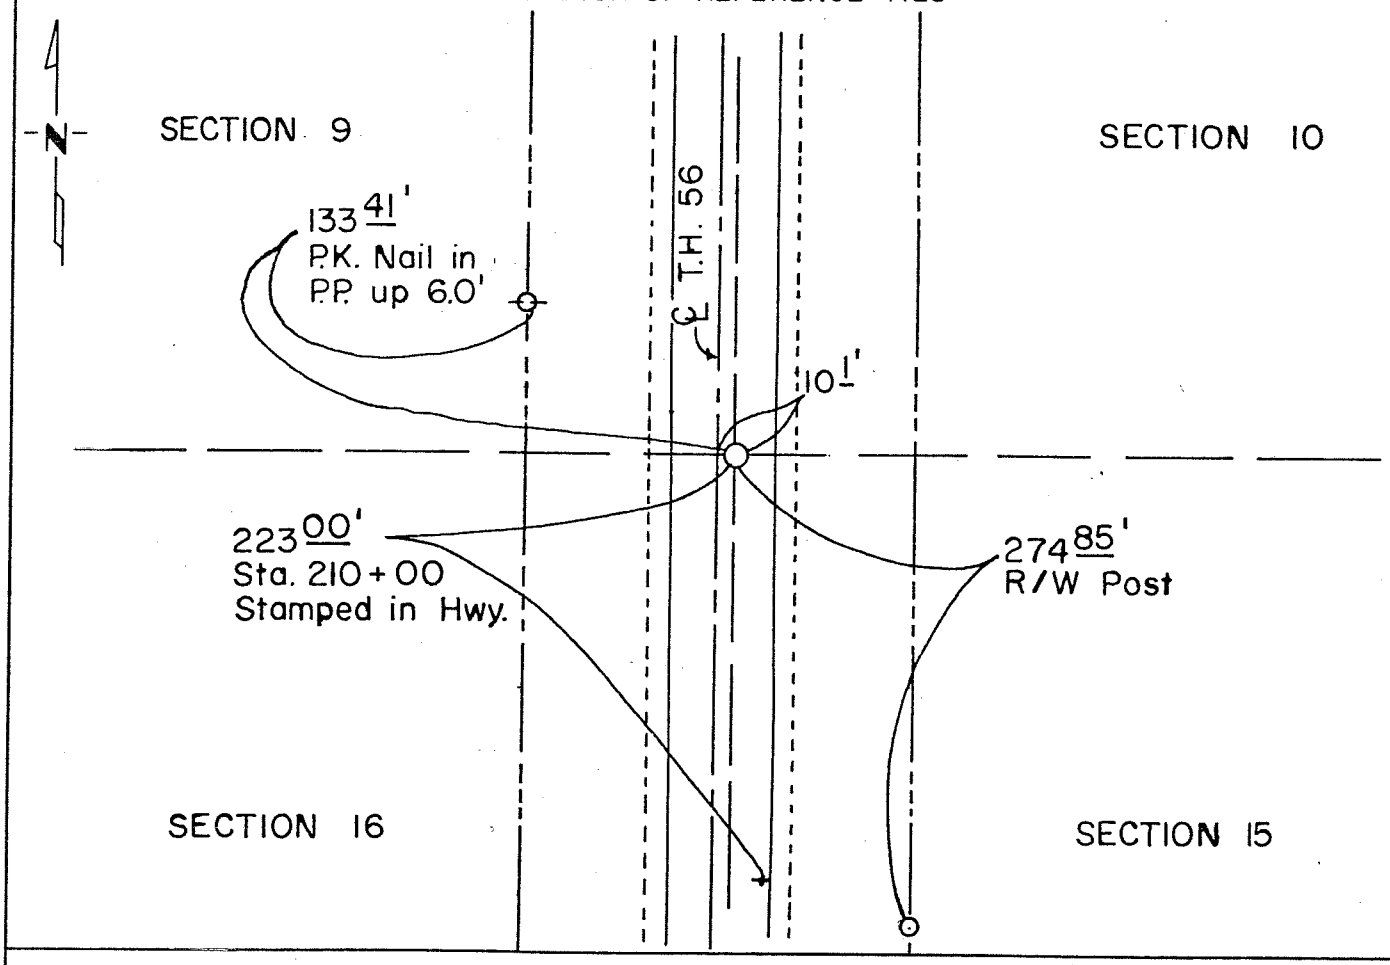

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Ronald A. Olson (SIGNATURE) 3-13-80 (DATE)

Registration No. 11009

☒ Land Surveyor, ☒ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the Recorder's office at 3:00 P.M. on the 13th day of March A.D., 19 80

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. 343776

M.H.D. FORM NO. 2105

Statement of Evidence:

NORTHEAST CORNER SECTION 16, TOWNSHIP 103 NORTH, RANGE 17 W, 5th P.M.

1854 William Anderson, Deputy Surveyor, set the corner in the original Public Land Survey.

1937 Minnesota Department of Transportation graded T.H. 56 through this area. No evidence of the corner was found.

1973 Minnesota Department of Transportation constructed a concrete pavement over the corner. A search was made but no evidence of the corner was found.

1978 Zenk Engineering, Inc. made an electronic survey and search of the area around this corner, with a magnetic locator, and no evidence of any metal monument at this location. Excavation was not made through the concrete highway.

An analysis of the record data gives no indication of monument perpetuation for over 40 years. The corner was restored by obliterated methods. The corner was set by doubling the distance from the occupied N 1/4 corner of Section 15 over the occupied location of the N 1/16 corner of the NW 1/4 of Section 15 and by doubling the distance between the E 1/4 Corner of Section 16 and the occupied E 1/16 Corner of the NE 1/4 of Section 16. This location agreed with other occupation lines in Section 16 and is accepted as the corner of the original Public Land Survey.

For details of the analysis and electronic survey data, contact Zenk Engineering, Inc., Albert Lea, Minnesota 56007

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E 1/4 Corner of Section 18, Township 103N Range 17W, 5th P.M.

STATE OF MINNESOTA, County of MOWER


At the corner location shown on the sketch

☐ On 06/28/1994 (DATE) found a –

☐ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☐ On 06/28/1994 (DATE) placed a CAST IRON MONUMENT

SKETCH OF REFERENCE TIES

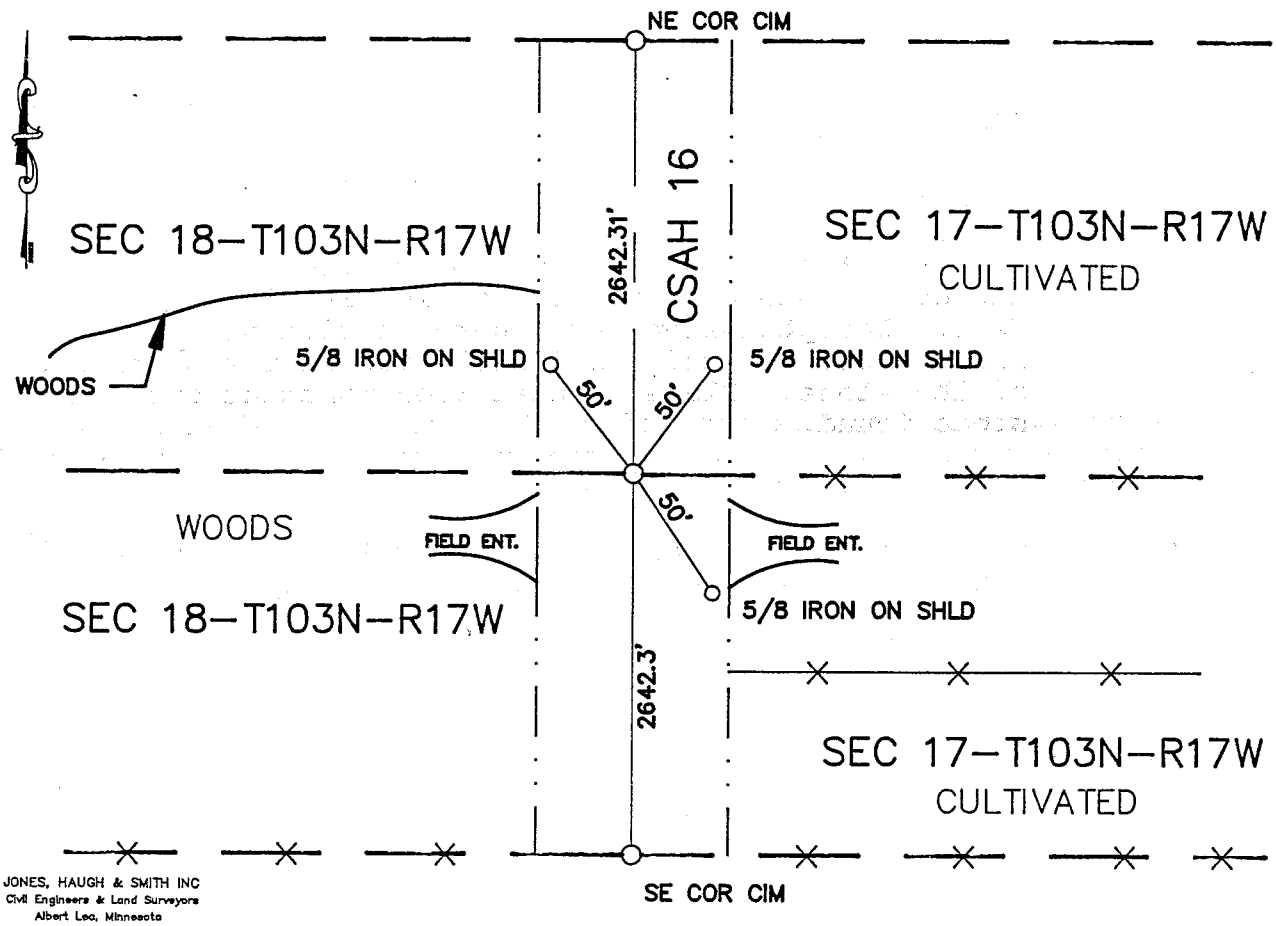

JONES, HAUGH & SMITH INC
Civil Engineers & Land Surveyors
Albert Lea, Minnesota

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein were prepared by me or under my direct supervision.

SIGNATURE _____ DATE 1-26-96

Registration No. 13807

☐ Land Surveyor, ☐ Professional Engineer

☑ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER
County of Mower

I hereby certify that this document was filed in the County Rec. office at 3 p. M. on the 29 day of Jan A.D., 1996

COUNTY RECORDER Charles Enger

By Susan M. Davis, Deputy

DOCUMENT NO. 442200

M.H.D. FORM NO. 2105

BOOK 90 PAGE 105 Book 90 Misc Page 105

E 1/4 SEC 18-103-17

This corner was originally established by Deputy Surveyor William Anderson of the U.S. General Land Office in 1854. The government notes show a wood post was set with a mound of earth and trench.

The following were contacted for section corner information.

Mower County Highway Dept.
Mower County Recorder
Zenk Engineering
Tucker Land Surveying

No record of this corner was obtained from the above mentioned offices.

1994 · Jones, Haugh and Smith crew, under direction of John Schulte, Mower County Surveyor RLS 13807, dug with county backhoe at CL N-S road and in line with fence to the east. Excavated a 5.5' X 8' X 3.5' hole into virgin soil. No evidence was found of the corner. A CIM was placed on the split between the NE and SE section corners on the CL of the road and in line with the fence to the east.

The monument fit occupation and road centerlines within the section and is accepted as best evidence of a perpetuation of the original public land survey corner.

For electronic survey data and analysis, contact the firm of Jones, Haugh and Smith Inc.

TIE BOOK P10

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SW Corner of Section 20, Township 103N, Range 17W, 5TH P.M.

STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☑ On 1-27-84 (DATE) found a concrete mon. with iron pin in center 1'± deep

☑ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☑ On 1-27-84 (DATE) placed a cast iron monument over conc. marker

SKETCH OF REFERENCE TIES

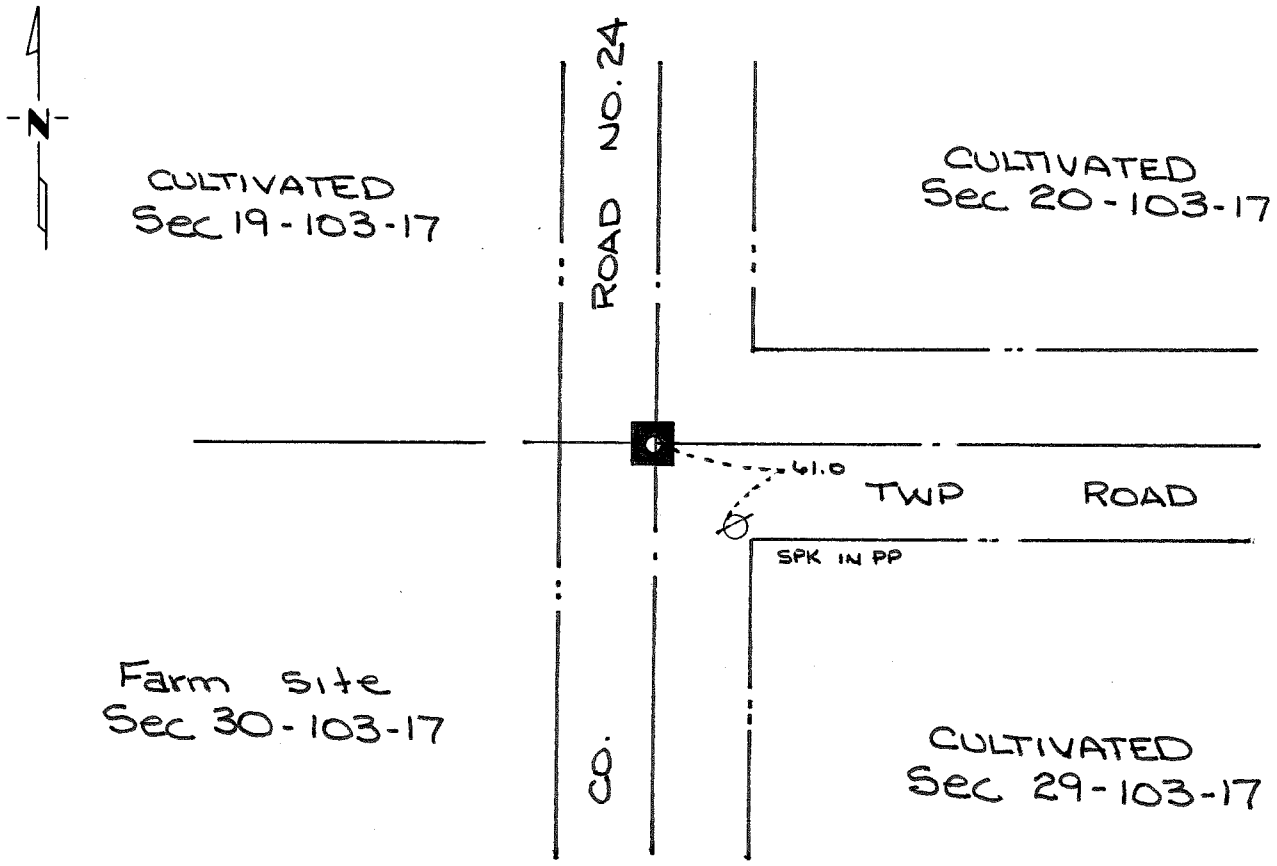

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

[signature] 2-7-84
SIGNATURE DATE

Registration No. 13807

☑ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the _____ day of _____ A.D., 19 ___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

SW corner Section 20-103-17

1856 Wm I. Anderson, Deputy Surveyor, set wood post during public land survey.

1954 Records from Mower County Engineer shows a concrete monument was found and ties were taken during a road survey.

1984 Jones, Haugh & Smith crew dug for section corner in bituminous surface road and at a depth of one foot more or less. Found a concrete monument with a iron pin cast in the center of the monument.

The monument found is in agreement with county records and fits occupation and road centerlines and is accepted as a perpetuation of the public land survey corner.

TIES BOOK P70 "A"

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

W 1/4 Corner of Section 20, Township 103N, Range 17W, 5TH P.M.

STATE OF MINNESOTA, County of Mower


At the corner location shown on the sketch:

☑ On 1-27-84 (DATE) found a concrete mon. with iron pin in center 2'± deep

☑ left monument as found, ☐ lowered monument, ☐ removed monument (explain)

☑ On 1-27-84 (DATE) placed a cast iron moument over conc. marker

SKETCH OF REFERENCE TIES

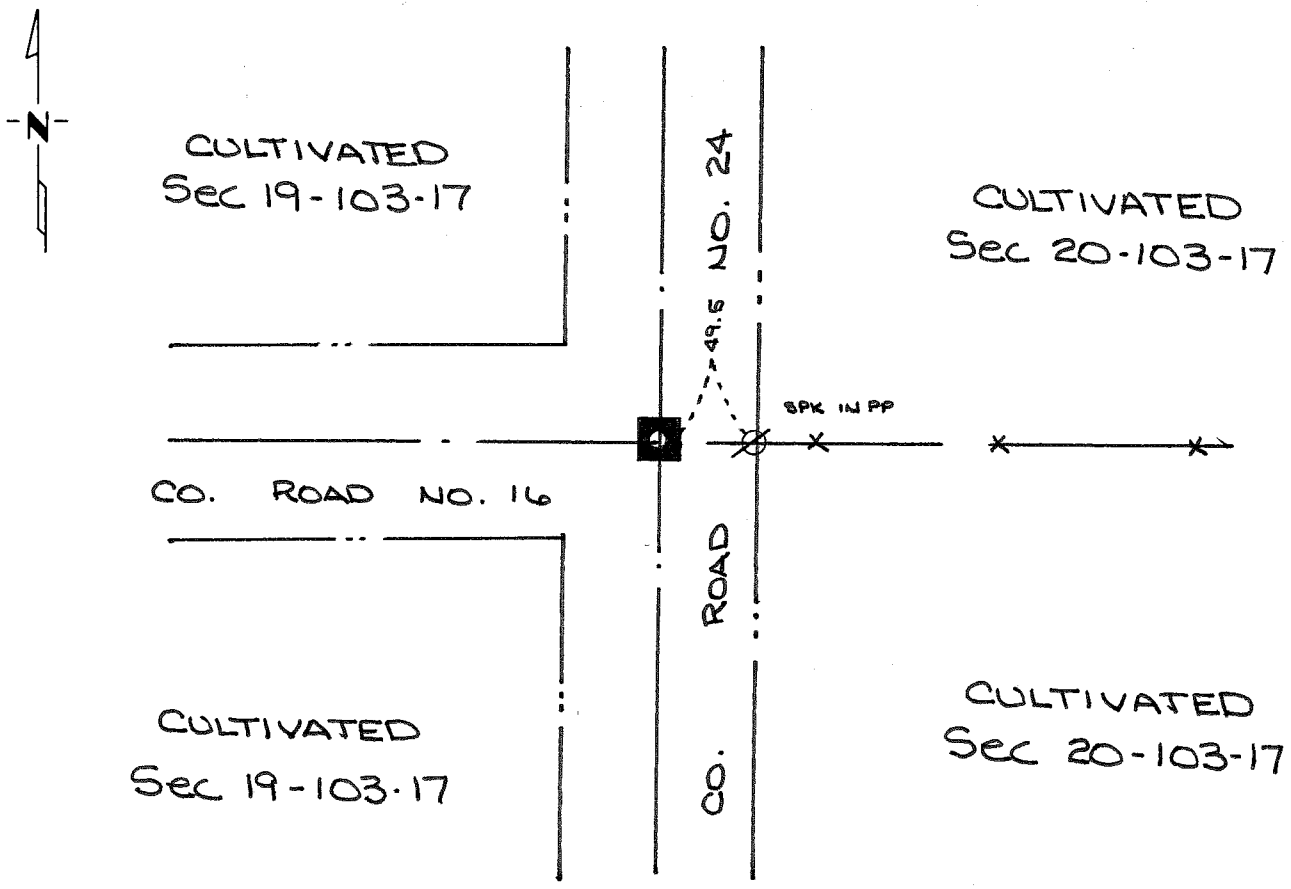

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

J. H. [illegible] 2-7-84
SIGNATURE DATE

Registration No. 13807

☑ Land Surveyor, ☐ Professional Engineer

☐ County Surveyor, ☐ County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Rec. office at _____ .M. on the ____ day of _____ A.D., 19 ___

COUNTY RECORDER _____

By _____, Deputy

DOCUMENT NO. _____

M.H.D. FORM NO. 2105

STATEMENT OF EVIDENCE

$W\frac{1}{4}$ corner Section 20-103-17

1856 Wm I. Anderson, Deputy Surveyor, set wood post during public land survey.

1954 Records from Mower County Engineer shows a concrete monument was found and ties were set during road survey.

1984 Jones, Haugh & Smith crew dug for $\frac{1}{4}$ corner in bituminous surface road and at a depth of two feet more or less. Found a concrete monument with a iron pin cast in center of the monument.

The monument found is in agreement with Mower County records and fits occupation and road centerlines and is accepted as a perpetuation of the public land survey corner.